

9-1-2005

Justification for Class III Permit Modification September 2005 SWMU 148 OU 1295 Building 9927 Septic System, Coyote Test Field

Sandia National Laboratories/NM

Follow this and additional works at: https://digitalrepository.unm.edu/snl_complete

Recommended Citation

Sandia National Laboratories/NM. "Justification for Class III Permit Modification September 2005 SWMU 148 OU 1295 Building 9927 Septic System, Coyote Test Field." (2005). https://digitalrepository.unm.edu/snl_complete/108



This Technical Report is brought to you for free and open access by the Sandia National Labs/NM Technical Reports at UNM Digital Repository. It has been accepted for inclusion in Regulatorily Completed by an authorized administrator of UNM Digital Repository. For more information, please contact disc@unm.edu.



This work supported by the United States Department of Energy under contract DE-AC04-94185000.



Drain and Septic Systems - Solid Waste Management Units (SWMUs) 137, 146, 148, 152, and 153

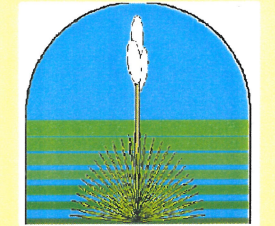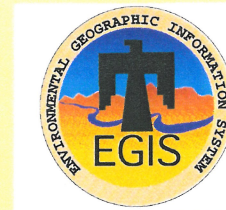

Environmental Restoration Project

Site History

Drain and septic system site histories for the five sites are as follows:

SWMU Number	Site Name	Location	Year Bldg and System Built	Year Drain or Septic System Abandoned	Year(s) Septic Tank Effluent Sampled	Year Septic Tank Pumped For the last Time	Year Septic Tank Inspected and Closure Forms Signed
137	Bldg 6540/6542 Septic Systems	TA-III	1959 (north septic tank); 1975 (south septic tank)	1991	1992, 1994	Unknown (north tank removed in 1995); 1996 (south septic tank backfilled)	1995
146	Bldg 9920 Drain System	Coyote Test Field	1958	~1980	No septic tank at this site	NA	NA
148	Bldg 9927 Septic System	Coyote Test Field	1962	1991	1992, 1994, 1995	1995/1996 (backfilled)	1995
152	Bldg 9950 Septic System	Coyote Test Field	1964	1991	1992, 1994	1996 (backfilled)	1996
153	Bldg 9956 Septic System	Coyote Test Field	1969 (east septic system); 1988 (west septic system)	1993	1992 (east septic tank); 1994, 1995 (east and west septic tank)	1995/1996 (backfilled)	1995

Depth to Groundwater

Depth to groundwater at the five sites is as follows:

SWMU Number	Site Name	Location	Groundwater Depth (ft bgs)
137	Bldg 6540/6542 Septic System	TA-III	480
146	Bldg 9920 Drain System	Coyote Test Field	420
148	Bldg 9927 Septic System	Coyote Test Field	355
152	Bldg 9950 Septic System	Coyote Test Field	460
153	Bldg 9956 Septic System	Coyote Test Field	470

Constituents of Concern

- VOCs
- SVOCs
- Metals
- Cyanide
- Radionuclides

Investigation

- All these SWMUs were selected by NMED for passive soil vapor sampling to screen for VOCs and SVOCs. No significant contamination was identified at any of the five sites.
- A backhoe was used to positively locate buried components (drainfield drain lines, drywells) for placement of soil vapor samplers, and soil borings.
- Soil samples were collected from directly beneath drainfield drain lines, seepage pits, and septic tanks to determine if COCs were released to the environment from drain systems.
- A 150-ft-deep, active soil-vapor monitoring well with vapor sampling ports at 5, 20, 70, 100, and 150-ft bgs, was installed at SWMU 137 for active soil vapor sampling to screen for VOCs. VOC concentrations were significantly lower than the 10 ppmv action level established by NMED.

The years that site-specific characterization activities were conducted, and soil sampling depths at each of these five sites are as follows:

SWMU Number	Site Name	Buried Components (Drain Lines, Drywells) Located With Backhoe	Soil Sampling Beneath Drainlines, Seepage Pits, Drywells	Type(s) of Drain System, and Soil Sampling Depths (ft bgs)	Passive Soil Vapor Sampling	Active Soil Vapor Monitor Well Installation and Sampling
137	Bldg 6540/6542 Septic Systems	1994	1990, 1994, 1995	North System: Drainfield-5, 15 Septic Tank-9; South system: Drainfield-7, 17 Septic Tank-11	1994	2003
146	Bldg 9920 Drain System	None	1995	Drywell: 4, 14	1994	None
148	Bldg 9927 Septic System	None	1994	Seepage Pit: 14, 24 Septic Tank: 12	1994	None
152	Bldg 9950 Septic System	1994	1994, 1995	Drainfield: 5, 15 Septic Tank: 9	1994	None
153	Bldg 9956 Septic System	1994	1994, 1995	West System: Drainfield-6, 16 Septic Tank-8; East System: Seepage Pits-8, 18 Septic Tank: 8	1994	None

Summary of Data Used for NFA Justification

- Soil samples were analyzed at on- and off-site laboratories for VOCs, SVOCs, PCBs, HE compounds, metals, cyanide, isotopic uranium, tritium, and radionuclides by gamma spectroscopy.
- There were detections of VOCs at all five sites; SVOCs were detected at SWMUs 137, and 146.
- Arsenic was detected at concentrations above the background value at SWMUs 137, 148, and 152. Total chromium was at concentrations above the background value at SWMU 153. Barium and silver were detected at concentrations above the background values at SWMU 137, and lead was detected at concentrations above the background value at SWMU 153. No other metals were detected at concentrations above the background values.
- Cyanide was detected above the MDL at SWMUs 137 and 153.
- Thorium-232 was detected at an activity slightly above the background activity at all five sites. The MDAs for U-235 and U-238 exceeded background activities at SWMUs 137, 146, 152, and 153. The MDA for tritium exceeded the background activity at SWMU 148.
- All confirmatory soil sample analytical results for each site were used for characterization, for performing the risk screening assessment, and as justification for the NFA proposal.

Recommended Future Land Use

- Industrial land use was established for these five sites.

Results of Risk Analysis

- Risk assessment results for industrial and residential land-use scenarios are calculated per NMED risk assessment guidance as presented in "Supplemental Risk Document Supporting Class 3 Permit Modification Process".
- Because COCs were present in concentrations greater than background-screening levels or because constituents were present that did not have background-screening numbers, it was necessary to perform risk assessments for these five sites. The risk assessment analysis evaluated the potential for adverse health effects for the industrial and residential land-use scenarios.
- The maximum concentration value for lead was 27.3 J mg/kg at SWMU 153; this exceeds the background value. The EPA intentionally does not provide any human health toxicological data on lead; therefore, no risk parameter values could be calculated. The NMED guidance for lead screening concentrations for construction and industrial land-use scenarios are 750 and 1,500 mg/kg, respectively. The EPA screening guidance value for a residential land-use scenario is 400 mg/kg. The maximum concentration for lead at this site is less than all the screening values; therefore, lead was eliminated from further consideration in the human health risk assessment.
- The non-radiological total human health HIs and estimated excess cancer risks for the five sites are below NMED guidelines for the residential land-use scenarios.
- For SWMU 152, the HI is below the residential land-use guideline, but the total estimated excess cancer risk is slightly above the residential land-use guideline. However, the incremental excess cancer risk value for this site is below the NMED residential land-use guideline.
- The human health TEDEs for industrial land-use scenarios ranged from 5.7E-2 to 2.9E-8 mrem/yr, all of which are substantially below the EPA numerical guideline of 15 mrem/yr. The human health TEDEs for residential land-use scenarios ranged from 1.9E-5 to 0.15 mrem/yr, all of which are substantially below the EPA numerical guideline of 75 mrem/yr. Therefore, these sites are eligible for unrestricted radiological release.
- Using the SNL predictive ecological risk and scoping assessment methodologies, it was concluded that a complete ecological pathway for each of the five sites was not associated with the respective COPECs for that site. Thus, a more detailed ecological risk assessment to predict the level of risk was not deemed necessary for these sites.
- In conclusion, human health and ecological risks are acceptable per NMED guidance. Thus, these sites are proposed for CAC without institutional controls.

The total HIs and excess cancer risk values for a residential land-use scenario for the nonradiological COCs at the five SWMUs are as follows:

SWMU Number	SWMU Name	Residential Land-Use Scenario	
		Hazard Index	Excess Cancer Risk
137	Bldg 6540/6542 Septic System	0.90	1E-7 Total
146	Bldg 9920 Drain System	0.00	3E-8 Total
148	Bldg 9927 Septic System	0.39	3E-8 Total
152	Bldg 9950 Septic System	0.37	2E-5 Total ^a /9.06E-6 Incremental
153	Bldg 9956 Septic System	0.00	6E-8 Total
NMED Guidance		≤ 1	<1E-5

^aValue exceeds NMED guidance for specified land-use scenario; therefore, incremental values are shown.

For More Information Contact



U.S. Department of Energy
Sandia Site Office
Environmental Restoration
Mr. John Gould
Telephone (505) 845-6089

Sandia National Laboratories
Environmental Restoration Project
Task Leader: Mike Sanders
Telephone (505) 284-2478





This work supported by the United States Department of Energy under contract DE-AC04-94185000.

Drain and Septic Systems - Solid Waste Management Units (SWMUs) 137, 146, 148, 152, and 153

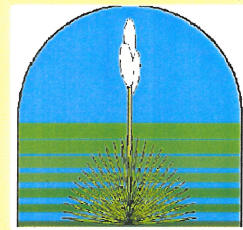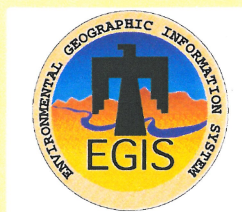



Environmental Restoration Project

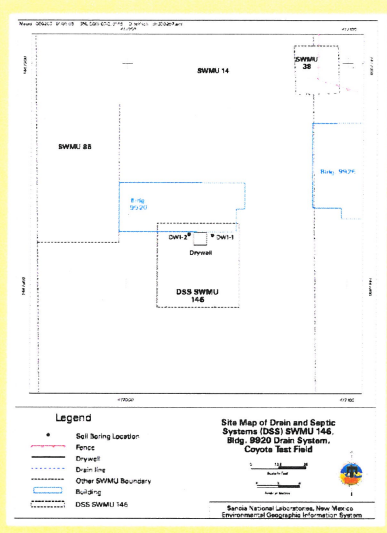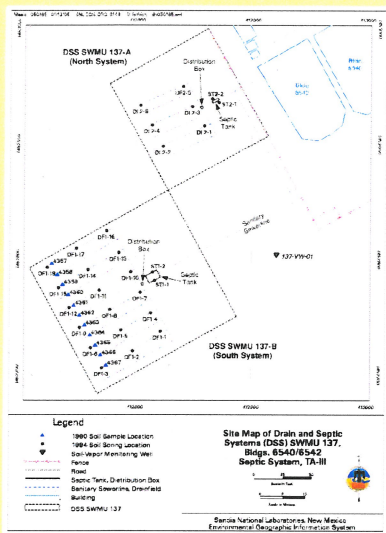


Collecting soil samples with the Geoprobe



System drainline terminating at the seepage pit.

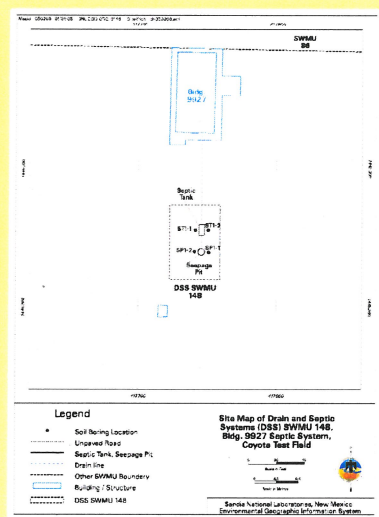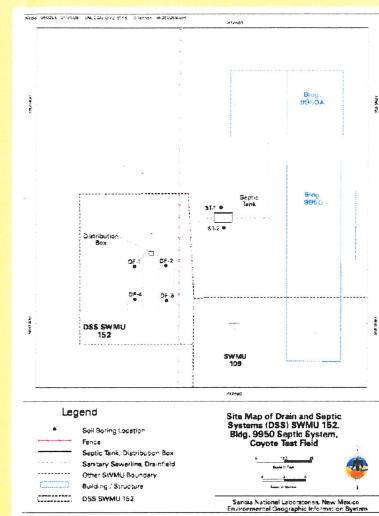


Platform and Geoprobe sampling equipment used to collect soil samples from beneath the center of the seepage pit.

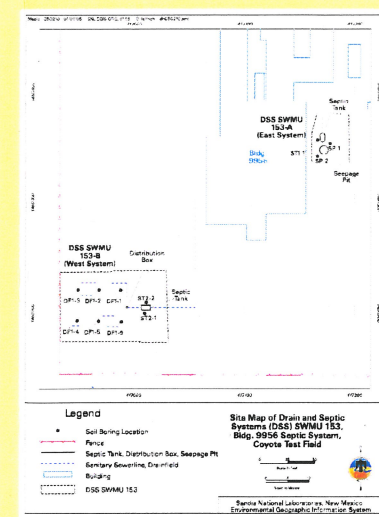

For More Information Contact

U.S. Department of Energy
Sandia Site Office
Environmental Restoration
Mr. John Gould
Telephone (505) 845-6089

Sandia National Laboratories
Environmental Restoration Project
Task Leader: Mike Sanders
Telephone (505) 284-2478

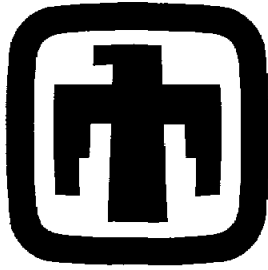

Sandia National Laboratories

Justification for Class III Permit Modification

September 2005

SWMU 148

OU 1295

**Building 9927 Septic System, Coyote Test
Field**

NFA Submitted August 1995

NOD Submitted June 1997

NOD Submitted March 2005

**Environmental
Restoration
Project**



**United States Department of Energy
Sandia Site Office**

NFA



Department of Energy
Albuquerque Operations Office
Kirtland Area Office
P. O. Box 5400
Albuquerque, New Mexico 87185-5400

AUG 28 1995

CERTIFIED MAIL - RETURN RECEIPT REQUESTED

Mr. David Neleigh, Chief
New Mexico and Federal Facilities Section
RCRA Permits Branch
U. S. Environmental Protection Agency, Region VI
1445 Ross Avenue, Suite 1200
Dallas, TX 75202-2733

Dear Mr. Neleigh:

Enclosed are copies of the second set of No Further Action (NFA) proposals for 23 solid waste management units (SWMUs) from the Resource Conservation and Recovery Act (RCRA) Hazardous and Solid Waste Amendments (HSWA) Final Permit for Sandia National Laboratories/New Mexico (SNL/NM), ID No. NM5890110518.

Copies of these proposals are also being submitted for comment to the New Mexico Environment Department (NMED), Hazardous and Radioactive Materials Bureau. The Class 3 permit modification process will be initiated after regulatory comments are addressed.

If you have any questions, please contact John Gould at (505) 845-6089 or Mark Jackson at (505) 845-6288.

Sincerely,

for Michael J. Zamorski
Acting Area Manager

Enclosures

cc w/enclosures:
T. Trujillo, AL, ERD
L. Aker, AIP (2 copies)
W. Cox, SNL, MS 1147



Printed on recycled paper

Mr. David Neleigh

2

cc w/o enclosures:

M. Jackson, KAO

J. Johnsen, KAO-AIP

C. Soden, AL, EPD


N. Morlock, EPA, Region VI

T. Roybal, SNL, MS 1147

M. Davis, SNL, MS 1147

T. Vandenberg, SNL, MS 0141

E. Krauss, SNL, MS 0141

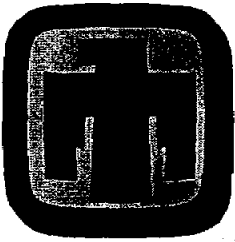

Sandia National Laboratories / New Mexico

**PROPOSAL FOR NO FURTHER ACTION
ENVIRONMENTAL RESTORATION PROJECT
SITE 148, BUILDING 9927 SEPTIC SYSTEM
OPERABLE UNIT 1295**

FY 1995

August 1995

**Environmental
Restoration
Project**



**United States Department of Energy
Albuquerque Operations Office**

**PROPOSAL FOR
NO FURTHER ACTION
Environmental Restoration Project**

**Site 148, Building 9927 Septic System
OU 1295**

Prepared by
Sandia National Laboratories/New Mexico
Environmental Restoration Project
Albuquerque, New Mexico

Prepared for the
United States Department of Energy

TABLE OF CONTENTS

	Page
1. Introduction	1
1.1 ER Site 148, Building 9927 Septic System	1
1.2 SNL/NM Confirmatory Sampling NFA Process	1
1.3 Local Setting	2
2. History of the SWMU	5
2.1 Sources of Supporting Information	5
2.2 Previous Audits, Inspections, and Findings	6
2.3 Historical Operations	6
3. Evaluation of Relevant Evidence	8
3.1 Unit Characteristics	8
3.2 Operating Practices	8
3.3 Presence or Absence of Visual Evidence	8
3.4 Results of Previous Sampling/Surveys	8
3.5 Assessment of Gaps in Information	10
3.6 Confirmatory Sampling	10
3.7 Rationale for Pursuing a Confirmatory Sampling NFA Decision	12
4. Conclusion	16
5. References	17
5.1 ER Site 148 References	17
5.2 Other References	17

LIST OF FIGURES

Figure	Page
1 ER Site 148 Location Map	3
2 ER Site 148 Site Map	4
3 ER Site 148: Photograph	7

LIST OF TABLES

Table	Page
1 ER Site 148: Confirmatory Sampling Summary Table	11
2 ER Site 148: Summary of Organic and Other Constituents Detected in Confirmatory Soil Samples Collected Around the Septic Tank and Seepage Pit	13
3 ER Site 148: Summary of RCRA Metals Beryllium, and Hexavalent Chromium Analytical Results for Confirmatory Soil Samples Collected Around the Septic Tank and Seepage Pit	14
4 ER Site 148: Summary of Isotopic Uranium and Tritium Analyses of Confirmatory Soil Samples Collected From Adjacent to the Seepage Pit and Septic Tank	15

LIST OF APPENDICES

Appendix	Page
A ER Site 148: Results of Previous Sampling and Surveys	
A.1 ER Site 148, Summary of Constituents Detected in 1992 Septic Tank Samples	A-1
A.2 ER Site 148, Summary of Constituents Detected in 1994 Septic Tank Sample	A-4
A.3 ER Site 148, Summary of 1994 PETREX Passive Soil-Gas Survey Results . . .	A-6
A.4 ER Site 148, Gamma Spectroscopy Screening Results for Seepage Pit Shallow Interval Composite Soil Sample	A-7
A.5 ER Site 148, Gamma Spectroscopy Screening Results for Seepage Pit Deep Interval Composite Soil Sample	A-9

1. Introduction

1.1 ER Site 148, Building 9927 Septic System

Sandia National Laboratories/New Mexico (SNL/NM) is proposing a no further action (NFA) decision based on confirmatory sampling for Environmental Restoration (ER) Site 148, Building 9927 Septic System, Operable Unit (OU) 1295. ER Site 148 is listed in the Hazardous and Solid Waste Amendment (HSWA) Module IV (EPA August 1993) of the SNL/NM Resource Conservation and Recovery Act (RCRA) Hazardous Waste Management Facility Permit (NM5890110518) (EPA August 1992).

1.2 SNL/NM Confirmatory Sampling NFA Process

This proposal for a determination of an NFA decision based on confirmatory sampling was prepared using the criteria presented in Section 4.5.3 of the SNL/NM Program Implementation Plan (PIP) (SNL/NM February 1995). Specifically, this proposal "must contain information demonstrating that there are no releases of hazardous waste (including hazardous constituents) from solid waste management units (SWMU) at the facility that may pose a threat to human health or the environment" (as proposed in the code of Federal Regulations [CFR], Section 40 Part 264.514[a] [2]) (EPA July 1990). The HSWA Module IV contains the same requirements for an NFA demonstration:

Based on the results of the RFI [RCRA Facility Investigation] and other relevant information, the Permittee may submit an application to the Administrative Authority for a Class III permit modification under 40 CFR 270.42(c) to terminate the RFI/CMS [corrective measures study] process for a specific unit. This permit modification application must contain information demonstrating that there are no releases of hazardous waste including hazardous constituents from a particular SWMU at the facility that pose threats to human health and/or the environment, as well as additional information required in 40 CFR 270.42(c) (EPA August 1993).

If the available archival evidence is not considered convincing, SNL/NM performs confirmatory sampling to increase the weight of the evidence and allow an informed decision on whether to proceed with the administrative-type NFA or to return to the site characterization program for additional data collection (SNL/NM February 1995).

The Environmental Protection Agency (EPA) acknowledged that the extent of sampling required may vary greatly, stating that:

The agency does not intend this rule [the second codification of HSWA] to require extensive sampling and monitoring at every SWMU....Sampling is generally required only in situations where there is insufficient evidence on which to make an initial release determination....The actual extent of sampling will vary...depending on the amount and quality of existing information available (EPA December 1987).

This request for an NFA decision for ER Site 148, Building 9927 Septic System, is based primarily on results of a passive soil-gas survey (NERI 1994) and analytical results of confirmatory soil samples collected from immediately around the ER Site 148 septic system components. Concentrations of site-specific constituents of concern (COCs) were first compared to background upper tolerance limit (UTL) concentrations of COCs found in SNL/NM soils. If, however, no background data were available for a particular COC, concentrations of that constituent were then compared to proposed 40 CFR Part 264 Subpart S (Subpart S) soil action levels for the COC of interest (EPA July 1990). Concentrations of constituents at this site were found to be less than either or both background UTLs or proposed Subpart S action levels. This unit is therefore eligible for an NFA proposal based on one or more of the following criteria taken from the RCRA Facility Assessment (RFA) Guidance (EPA October 1986):

- Criterion A: The unit has never contained constituents of concern.
- Criterion B: The unit has design and/or operating characteristics that effectively prevent releases to the environment.
- Criterion C: The unit clearly has not released hazardous waste or constituents into the environment.

Specifically, ER Site 148 is being proposed for an NFA decision based on confirmatory sampling data demonstrating that hazardous waste or constituents have not been released from this SWMU into the environment (Criterion C).

1.3 Local Setting

SNL/NM occupies 2,829 acres of land owned by the Department of Energy (DOE), with an additional 14,920 acres of land provided by land-use permits with Kirtland Air Force Base (KAFB), the United States Forest Service, the State of New Mexico, and the Isleta Indian Reservation. SNL/NM has been involved in nuclear weapons research, component development, assembly, testing, and other research and development activities since 1945 (DOE September 1987).

ER Site 148 is located in the Coyote Test Field on KAFB approximately 0.5 mile east of the southeast corner of Technical Area III (TA-III) (Figure 1). Access to the site is provided by Magazine Road, which extends west from Lovelace Road. ER Site 148 is situated south of Building 9927, a small explosives testing facility (Figure 2). The site encompasses approximately 0.046 acre of flat-lying land at an average elevation of 5,473 feet above mean sea level (AMSL).

The surficial geology at ER Site 148 is characterized by a veneer of aeolian sediments that are underlain by alluvial fan or alluvial deposits. Based on drilling records of similar deposits at KAFB, the alluvial materials are highly heterogeneous, composed primarily of medium to fine silty sands with frequent coarse sand, gravel, and cobble lenses. The alluvial deposits probably extend to the water table. Vegetation consists predominantly of grasses,

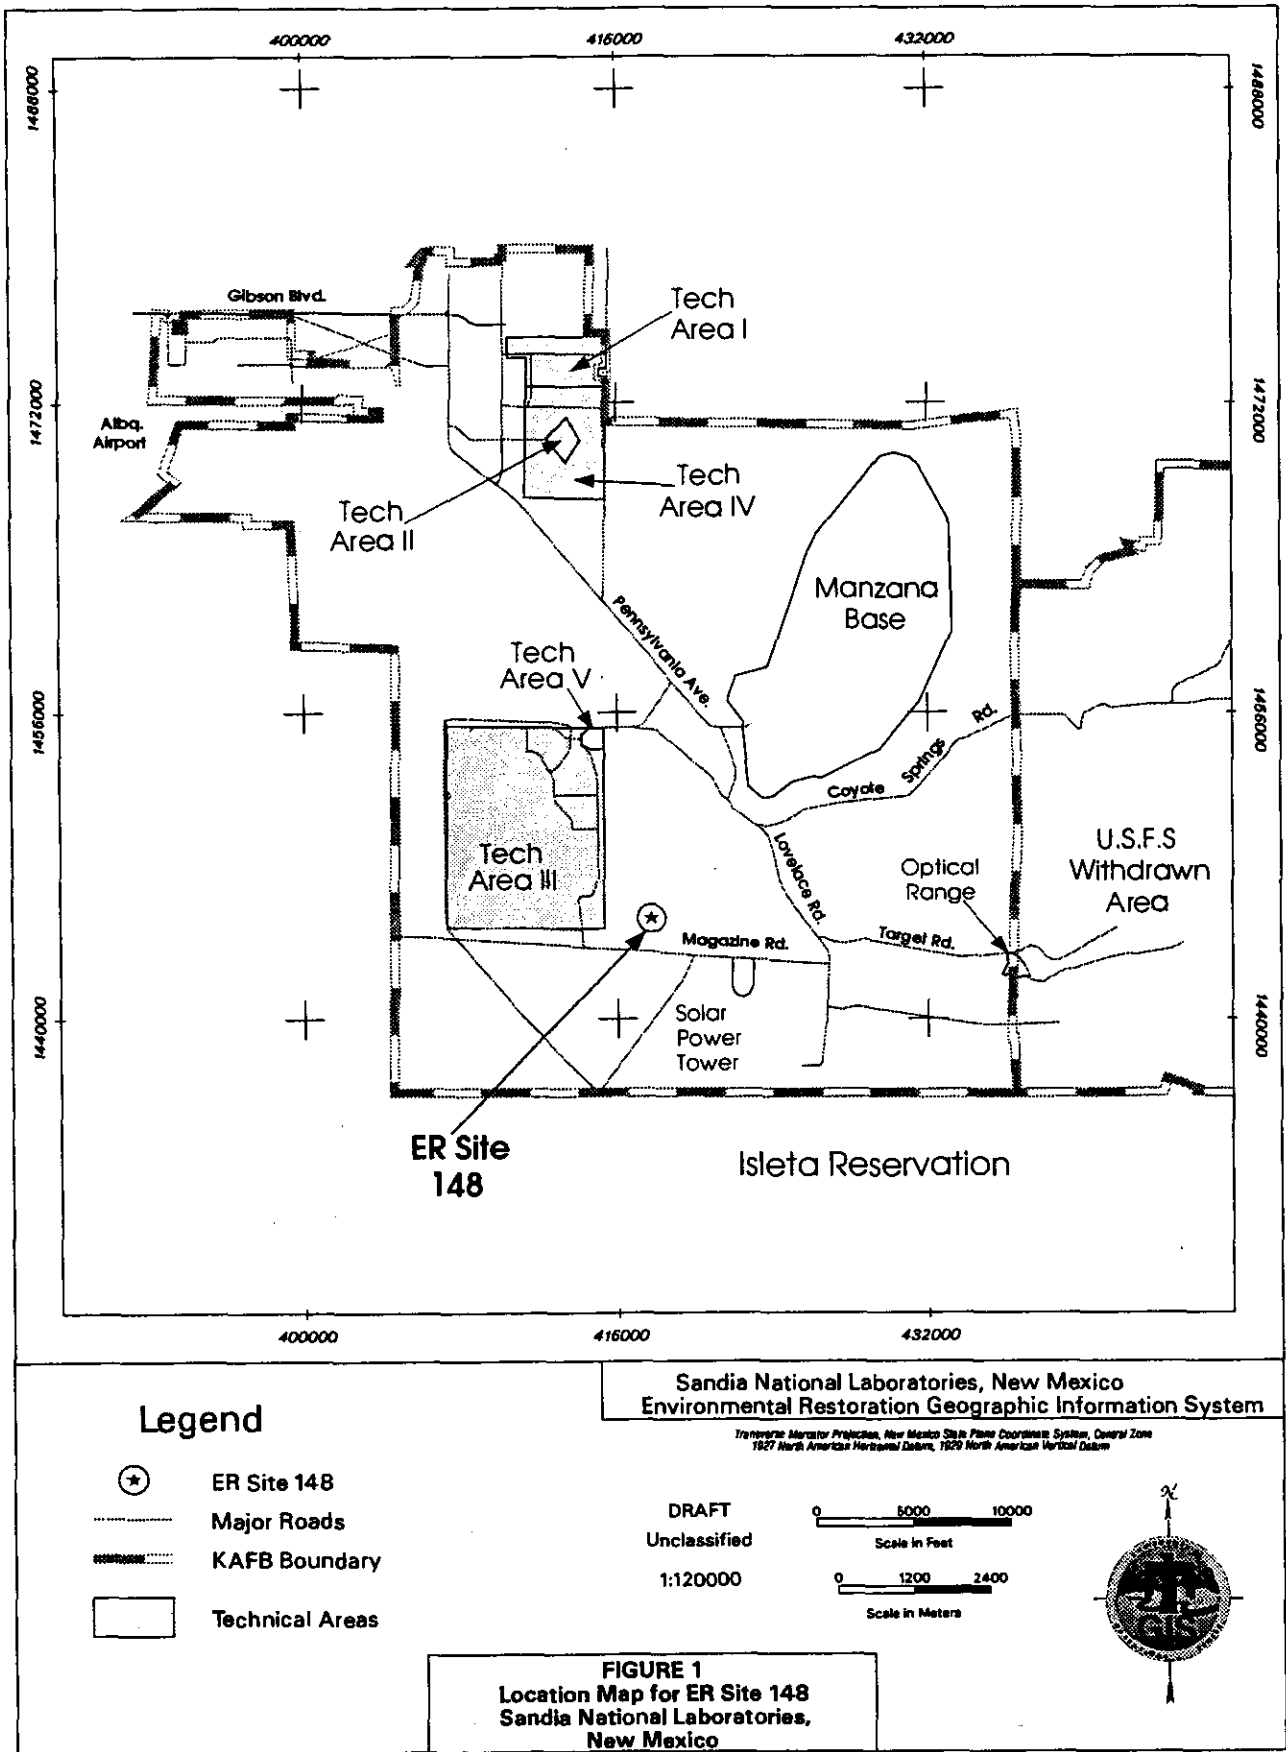


Figure 1. ER Site 148 Location Map

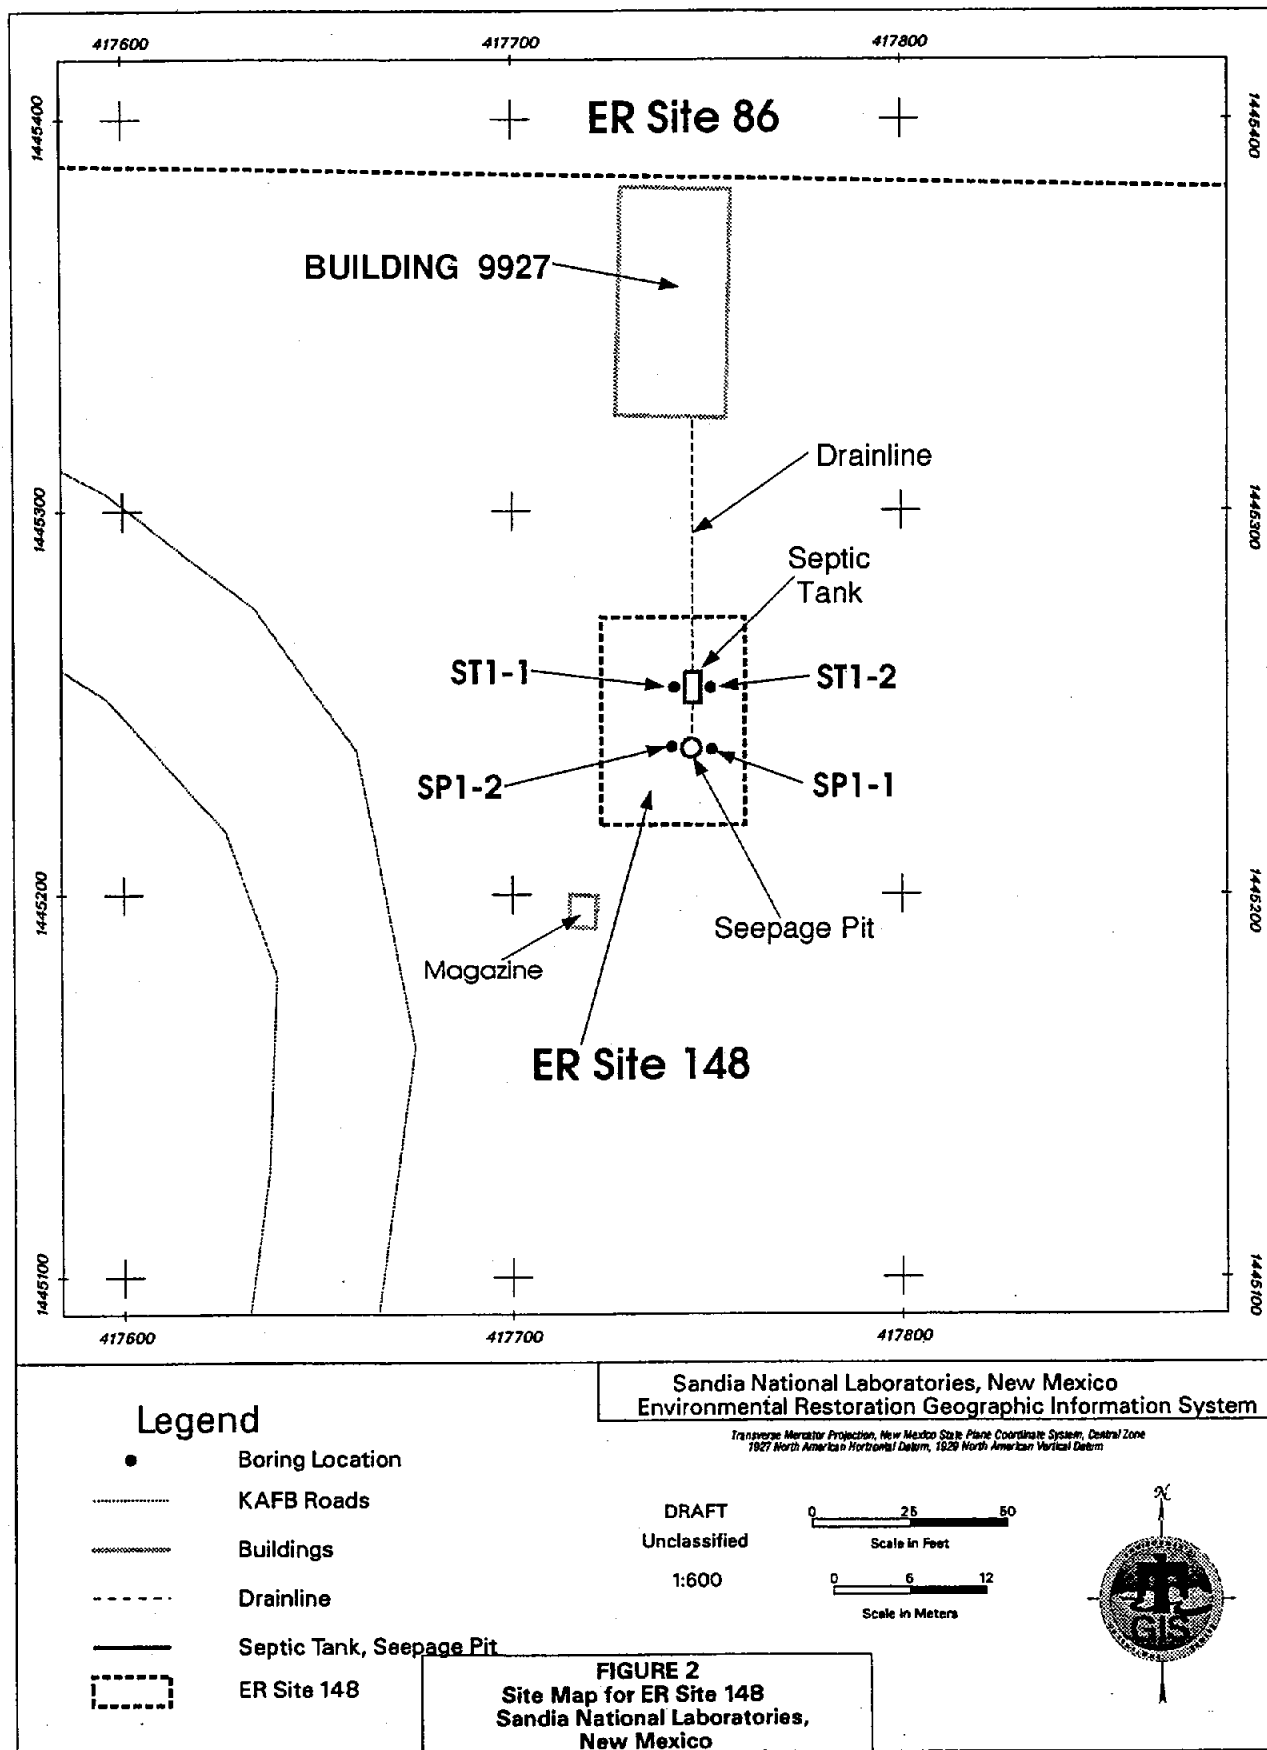


Figure 2. ER Site 148 Site Map

including grama, muhly, dropseed, and galleta. Shrubs commonly associated with the grasslands include sand sage, winter fat, saltbrush, and rabbitbush. Cacti are common and include cholla, pincushion, strawberry, and prickly pear (SNL/NM March 1993).

The water table elevation is approximately 5,150 feet AMSL at this location, so depth of water at this site is approximately 323 feet. No wells are located in the immediate vicinity of ER Site 148. The CWL-10 well is the nearest ground-water monitoring well and is located approximately 0.7 mile west of ER Site 148 in TA-III. Local ground water flow is believed to be in a generally northwest direction in the vicinity of this site (SNL/NM March 1995). The nearest production wells are northwest of the site and include KAFB-2, KAFB-4, KAFB-7, and KAFB-8 which are approximately 4.1 to 5.6 miles away (SNL/NM March 1995).

2. History of the SWMU

2.1 Sources of Supporting Information

In preparing the confirmatory sampling NFA proposal for ER Site 148, available background information was reviewed to quantify potential releases and to select analytes for the soil sampling. Background information was collected from SNL/NM facilities engineering drawings and interviews with employees familiar with site operational history.

The following sources of information, hierarchically listed with respect to assigned validity, were used to evaluate ER Site 148:

- Confirmatory shallow subsurface soil sampling conducted in October 1994
- Three survey reports, including data from a surface radiation survey (RUST December 1994), a geophysical survey (Lamb 1994), and a passive soil-gas survey (NERI 1994)
- Three sets of septic tank sludge and/or liquid samples collected in June 1992, May 1994, and January 1995
- RCRA Facilities Investigation Work Plan for OU 1295, Septic Tanks and Drainfields. This document contains information from interviews with employees who worked at the site in the past (SNL/NM March 1993)
- Photographs and field notes collected by SNL/NM ER staff at ER Site 148
- SNL/NM facilities engineering drawings
- SNL/NM Geographic Information System (GIS) data
- The RFA report (EPA April 1987)

2.2 Previous Audits, Inspections, and Findings

ER Site 148 was first listed as a potential release site in the RFA report (EPA April 1987), which noted that explosive residues and other COCs may have been discharged to the floor drains and sinks in Building 9927 during past operations. This SWMU was included in the RFA report as Site 79, along with several other septic and drain systems at SNL/NM. All the sites included in Site 79 are now designated by individual SWMU numbers.

2.3 Historical Operations


ER Site 148 consists of the septic system that served Building 9927. The center of the site is located 70 feet south of the building (Figure 2). A 750-gallon septic tank connected to a 5-foot diameter by 8-foot deep seepage pit handled effluent from a restroom, floor drains, and a darkroom sink. Both the septic tank and seepage pit are accessed by covered manholes, which are shown in the following photograph (Figure 3).

Building 9927, also referred to as the Drop Tower Facility, was constructed in 1962 and was used to support a variety of outdoor tests, including rocket motor armor penetration and simulated terrorist attacks. Beryllium, lead, lithium hydride, and depleted uranium (DU) were reportedly used in the above ground explosive tests. A darkroom inside the building was used to process black-and-white and x-ray film and it is estimated that approximately 20 gallons of developer and fixer solutions and an unknown volume of rinse water were discharged to the septic system every 10 months. Floor drains in a trough within the building were reportedly never used for washdown purposes. Explosives residue and organic solvents, including methanol, alcohol, toluene, and acetone, may have been discharged to the floor drains and sink. Effluent discharge rates (primarily from the restroom facilities) are estimated to have been between 20 and 1000 gallons per day, depending on building occupancy (SNL/NM March 1993).

Surface contamination is not included as part of OU 1295 assessment activities for ER Site 148. All potential surface contamination from the explosive testing is being investigated as part of the OU 1335 characterization program for ER Site 86.

Based on the activities performed at the facility, the primary COCs in the investigation were beryllium, lead, explosives, and DU residues from destructive testing, photoprocessing chemicals (e.g. cadmium, hexavalent chromium, cyanide, and silver), and volatile organic compounds such as methanol, toluene, and acetone.

The septic tank was reportedly pumped in 1989 (SNL/NM March 1993). Between 1990 and 1991 the sewage discharge line from the facility was connected to a new extension of the City of Albuquerque sanitary sewer system and the septic tank and seepage pit were abandoned. The residual tank contents were analyzed in 1994 for waste characterization purposes and were found not to contain any RCRA COCs. The remaining dry sludge in the septic tank will be removed for proper disposal and the system decommissioned per State of New Mexico, Bernalillo County, and City of Albuquerque wastewater control ordinances.

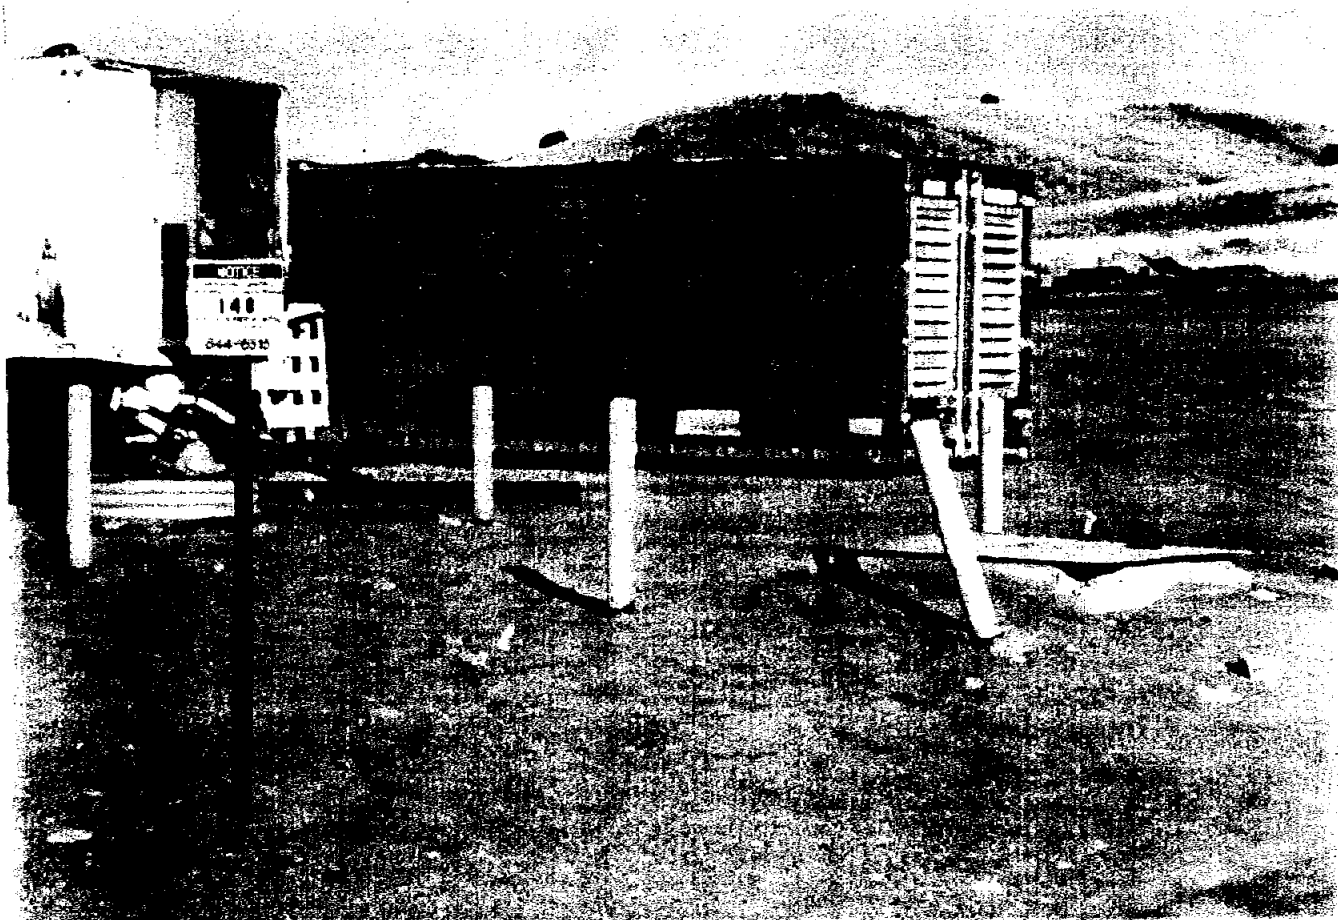

Septic Tank (left) and Seepage Pit (right) Covers (view looking east)

Figure 3. ER Site 148: Photograph

3. Evaluation of Relevant Evidence

3.1 Unit Characteristics

There are no safeguards inherent in the drain system from Building 9927 or in facility operations that could have prevented past releases to the environment.

3.2 Operating Practices

As discussed in Section 2.3, release of photoprocessing wastes to the septic system was standard procedure while the building was occupied. Hazardous wastes were not managed or contained at ER Site 148.

3.3 Presence or Absence of Visual Evidence

No visible evidence of soil discoloration, staining, or odors indicating residual contamination were observed when soil samples were collected adjacent to the septic tank and seepage pit in the fall of 1994 (SNL/NM October 1994).

3.4 Results of Previous Sampling/Surveys

The contents of the Building 9927 septic tank have been sampled on three separate occasions. Liquid and sludge samples were collected from the septic tank on June 21, 1992. These samples were analyzed for volatile organic compounds (VOCs), semivolatile organic compounds (SVOCs), pesticides, polychlorinated biphenyls (PCBs), metals, various radionuclide isotopes, and other miscellaneous compounds. The samples contained low concentrations of 3 VOC constituents, metals, and other miscellaneous constituents (IT June 1993). The radiological analyses conducted in 1992 had significant problems related to quality assurance/quality control (QA/QC) related problems and could not be used for waste characterization purposes. A summary of the constituents detected in the June 1992 samples is presented in Table A.1 of Appendix A.

A second set of sludge (dry at the time of sampling) samples were collected from the Building 9927 septic tank on May 9, 1994, and were analyzed for VOCs, SVOCs, metals using the Toxicity Characteristic Leaching Procedure (TCLP), and isotopic uranium. A screen was also completed for other radionuclides using SNL/NM in-house gamma spectroscopy to characterize the tank residue for waste disposal. No VOCs or SVOCs were detected in the dry sludge. Barium, cadmium, chromium, selenium, and silver were detected in the TCLP-derived leachate, but at concentrations well below the RCRA Toxicity Characteristic action levels. Very low concentrations of radionuclides were also detected in the material. A summary of the constituents detected in the May 1994 septic tank samples is presented in Table A.2 of Appendix A.

Additional dried sludge samples were collected from the septic tank on January 26, 1995, in order to complete additional analyses required for waste characterization. These samples were analyzed for isotopic uranium and tritium, and radionuclides using gamma spectroscopy, and were found to contain low concentrations of isotopic uranium, tritium, and other radionuclides detectable through gamma spectroscopy. A summary of the constituents detected in these January 1995 samples is included in Table A.2 of Appendix A.

The multiple rounds of ER Site 148 septic tank sampling described above were completed to characterize the current septic tank contents for waste disposal purposes. The dried residue in the tank is now adequately characterized and will be disposed as a separate removal action.

A surface radiological survey conducted by RUST Geotech Inc. around Building 9927 in March 1994 did not detect any point or aerial anomalies above background levels within ER Site 148 (RUST December 1994).

A geophysical survey performed at the site in March 1994 was intended to identify any subsurface areas with high moisture content, indicating a possible contaminant plume from past releases. The results of the geophysical survey were inconclusive, with no definitive indications of high moisture concentrations (Lamb 1994). Therefore, the geophysical survey results were not used as a guide in the soil sampling effort.

The passive soil-gas survey conducted at the site in June 1994 utilized PETREX sampling tubes to identify any releases of VOCs and SVOCs to the soil around the septic tank and seepage pit (SNL/NM June 1994). A PETREX tube soil-gas survey is a semiquantitative screening procedure that can be used to identify many VOCs and SVOCs, and can be used to guide VOC and SVOC site investigations. The advantages of this sampling methodology are that large areas can be surveyed at relatively low cost, the technique is highly sensitive to organic vapors, and the result produces a measure of soil-vapor chemistry integrated over a 2- to 3-week period rather than at one point in time. Each PETREX soil-gas sampler consists of 2 activated charcoal-coated wires housed in a reusable glass test tube container. At each sampling location, sample tubes are buried in an upside down position so that the mouth of the sampler is about 1 foot below grade. Samplers are left in place for a 2- to 3-week period, and are then removed from the ground and sent to the manufacturer, Northeast Research Institute (NERI), for analysis using Thermal Desorption-Gas Chromatography/Mass Spectrometry. The analytical laboratory reports all sample results in terms of "ion counts" instead of concentrations, and identifies those samples that contain compounds above the PETREX technique detection limits. NERI considers a "hit" for individual compounds (such as perchloroethene [PCE] or trichloroethene [TCE]) to be greater than 100,000 ion counts; and 200,000 ion counts for mixtures of compounds (benzene, toluene, ethylbenzene, xylene, [BTEX] or aliphatics, for example).

The soil-gas survey identified tetrachloroethene (also known as perchloroethene, or PCE) at a concentration just above the PETREX technique detection limit at one sampling location. Subsequent laboratory analysis of soil samples from this location did not detect PCE, nor was PCE detected in the septic tank contents sampled in 1994. No other VOCs or SVOCs were found in detectable quantities in PETREX tubes placed at this site (NERI 1994). The

analytical results of the passive soil-gas survey at ER Site 148 are included in Table A.3 of Appendix A.

3.5 Assessment of Gaps in Information

The material currently in the septic tank is not necessarily representative of all discharges to the unit that have occurred since it was put into service in 1962. The analytical results of the various rounds of septic tank sampling were used, along with process knowledge and other available information, to help identify the most likely COCs that might be found in soils surrounding the septic tank and seepage pit, and to help select the types of analyses to be performed on soil samples collected from the site. While the history of past releases at the site is incomplete, analytical data from confirmatory soil samples collected in October 1994 (discussed below) are sufficient to determine whether releases of COCs occurred at the site.

3.6 Confirmatory Sampling

Although the likelihood of hazardous waste releases at ER Site 148 was considered low, confirmatory soil sampling was conducted in October 1994 immediately adjacent to both the septic tank and seepage pit to determine whether COCs above background or detectable levels had been released via the septic system to the environment at this site. The confirmatory soil sampling program was performed in accordance with the rationale and procedures described in the Septic Tank and Drainfields (ADS-1295) RCRA Facility Investigation Work Plan (SNL/NM March 1993), and addenda to the Work Plan developed during the OU 1295 project approval process (IT March 1994 and SNL/NM November 1994).

A summary of the types of samples, number of sample locations, sample depths and analytical requirements for confirmatory soil samples collected at this site is presented in Table 1.

Soil samples were collected from one boring on either side of the seepage pit, and from one boring on either side of the septic tank. The soil sampling locations are shown in Figure 2. Figure 3 shows the covers to the septic tank (left) and seepage pit (right). Two depth intervals were sampled at each location around the seepage pit, the first starting at the outside bottom of the pit (14 feet below grade), and the second, 10 feet below the top of the first sampling interval (24 feet below grade). The sampling locations on either side of the septic tank, from one interval in each borehole, started at the outside bottom of the tank, 12 feet below grade (SNL/NM October 1994). The samples adjacent to the tank were collected to determine whether discharges of COCs had occurred due to failure of the tank integrity. Depths below grade to the outside bottoms of the septic tank and seepage pit were determined based on field measurements and SNL/NM facilities engineering drawings (SNL/NM April 1962).

The Geoprobe sampling system was used to collect subsurface soil samples at this site. The Geoprobe sampling tool was fitted with a butyl acetate (BA) sampling sleeve and was then

Table 1
ER Site 148: Confirmatory Sampling Summary Table

ER Site Number and Unit	Analytical Parameters	Number of Sample Locns.	Top of Splg. Interval(s) at Each Boring Location	Total Number of Invest. Samples	Total Number of Duplicate Samples	Date(s) Samples Collected
148 seepage pit (outside bottom of seepage pit is 14 feet deep, measured in field)	VOCs	2	14', 24'	4	1	10/11-12/94: 2 of 2 shallow, 2 of 2 deep intervals, 1 set duplicate samples
	SVOCs	2	14', 24'	4	1	
	RCRA metals	2	14', 24'	4	1	
	HE (TNT screen)	2	14', 24'	4	1	
	Cyanide	2	14', 24'	4	1	
	Isotopic uranium	2	14', 24'	4	1	
	Gamma spec. compos.	2	14', 24'	2		
	Tritium composite	2	14', 24'	2		
148 septic tank (outside bottom of tank is 12 feet deep, measured in field)	VOCs	2	12'	2		10/12/94: 2 of 2 shallow intervals
	SVOCs	2	12'	2		
	RCRA metals	2	12'	2		
	HE (TNT screen)	2	12'	2		
	Cyanide	2	12'	2		
	Isotopic uranium	2	12'	2		

Notes

- VOC = Volatile organic compounds
- SVOC = Semivolatile organic compounds
- RCRA = Resource Conservation and Recovery Act
- HE = High explosives
- TNT = Trinitrotoluene
- Cr = Chromium

hydraulically driven to the top of the designated sampling depth. The sampling tool was opened, and driven an additional 2 feet in order to fill the 2-foot long by approximately 1.25-inch diameter BA sleeve. The sampling tool and soil-filled sleeve were then retrieved from the borehole. In order to minimize the potential for loss of volatile compounds (if present), the soil to be analyzed for VOCs was not emptied from the BA sleeve into another sample container. The filled BA sleeve was removed from the sampling tool, and the top 7 inches were cut off. Both ends of the 7-inch section of filled sleeve were immediately capped with a teflon membrane and rubber end cap, sealed with tape, and placed in an ice-filled cooler at the site. The soil in this section of sleeve was submitted for a VOC analysis.

Soil from the remainder of the sleeve was then emptied into a decontaminated mixing bowl. Following this, one or two more 2-foot sampling runs were completed at each interval in order to recover enough soil to satisfy sample volume requirements for the interval. Soil

recovered from these additional runs was also emptied into the mixing bowl, and blended with soil from the first sampling run. The soil was then transferred from the bowl into sample containers using a decontaminated plastic spatula, and was analyzed for SVOCs, RCRA metals, hexavalent chromium, beryllium, and cyanide by laboratory analysis; and trinitrotoluene (TNT) compounds using a field screening immunoassay technique. Routine SNL/NM chain-of-custody and sample documentation procedures were employed, and samples were shipped to the laboratory by an overnight delivery service.

To determine if radionuclides were released from past activities at this site, soil samples were collected from each of the septic tank and seepage pit sampling intervals and were analyzed by a commercial laboratory for isotopic uranium. In addition, composite soil samples were collected from both the shallow and deep sampling intervals in the seepage pit borings and were analyzed by a commercial laboratory for tritium, and were also screened for other radionuclides using SNL/NM in-house gamma spectroscopy. Tritium and gamma spectroscopy composite screening samples were not collected from the septic tank borings because they were very close (approximately 15 feet) to the seepage pit borings.

QA/QC samples collected during this sampling effort consisted of one set of duplicate soil samples and one set of aqueous equipment rinsate samples that were analyzed for the same constituents as the field samples, except for tritium and the gamma spectroscopy radionuclides. Also, a soil trip blank sample was included with the shipment of ER Site 148 soil samples to the laboratory and was analyzed for VOCs only. Acetone, 1,1-dichloroethene, 2-butanone (MEK), methylene chloride, and toluene were detected in this soil trip blank by the laboratory. These common laboratory contaminants were either not detected or were found in generally lower concentrations in the site soil samples compared to the trip blank. Soil used for the trip blank was prepared by heating the material, and then transferring it immediately to the sample container. This heating process drives off any residual VOCs (if present) and soil moisture that may be contained in the material. Apparently when the soil trip blank container was opened at the laboratory, it immediately adsorbed both moisture and VOCs present in the laboratory atmosphere, and therefore became contaminated.

A summary of all constituents detected by commercial laboratory analyses in these confirmatory samples is presented in Tables 2, 3, and 4. Results of the SNL/NM in-house gamma spectroscopy composite soil sample screening for other radionuclides are presented in Tables A.4 and A.5 of Appendix A. Complete analytical data packages are archived in the Environmental Operations Records Center and are readily available for review and verification (SNL/NM October 1994).

3.7 Rationale for Pursuing a Confirmatory Sampling NFA Decision

Three rounds of samples were collected of the liquid and/or sludge in the septic tank for waste characterization purposes. Only low concentrations of a limited number of VOCs, SVOCs, metals, radionuclides, and other miscellaneous constituents were detected in the samples.

NOTE:
CYANIDE
CWIT'S STAIN
BE mg/kg, nd
mg/kg

Table 2

ER Site 148

Summary of Organic and Other Constituents Detected in Confirmatory S
Collected Around the Septic Tank and Seepage Pit

Sample Number	Sample Matrix	Sample Type	Sample Date	Sample Location (Figure 2)	Top of Sample Interval (fbgs)	VOCs Method 8240 (ug/kg)					SVOCS Method 8270 (ug/kg)	Cyanide Method 9010/9012 (ug/kg)	TNT Screen Immunoassay Method Based on EPA 8515 (mg/kg)
						Acetone	1,1-DCE	MEK	Chloride	Toluene			
018118-1,2	Soil	Field	10/11/94	S148-SPI-1	14	ND	ND	ND	ND	ND	ND	ND	ND
018119-1,2	Soil	Field	10/11/94	S148-SPI-1	24	ND	ND	ND	1.6 J	ND	ND	ND	ND
018120-1,2	Soil	Field	10/12/94	S148-SPI-2	14	ND	ND	ND	2.1 J	2.5 J	ND	ND	ND
018121-1,2	Soil	Dupl.	10/12/94	S148-SPI-2	14	ND	ND	ND	1.6 J	ND	ND	ND	ND
018122-1,2	Soil	Field	10/12/94	S148-SPI-2	24	ND	ND	ND	1.6 J	ND	ND	ND	ND
018123-1,2	Soil	Field	10/12/94	S148-ST1-1	12	ND	ND	ND	1.3 J	ND	ND	ND	ND
018124-1,2	Soil	Field	10/12/94	S148-ST1-2	12	ND	ND	ND	1.8 J	ND	ND	ND	ND
018125-1	Soil	TB	10/12/94	Site 148	NA	93	2.1 J	18	7.5 B	1.2 J	NS	NS	NS
Laboratory Detection Limit For Soil						10	5	10	5	5	330, 1,600	0.5	1
Proposed Subpart S Action Level For Soil (ug/kg)						8E+06	1E+04	5E+07	9E+04	2E+07	2E+06	4E+04	

Notes

- B = Compound also detected in an associated laboratory blank
- Dupl. = Duplicate soil sample
- fbgs = feet below ground surface
- J = Result is detected below the reporting limit or is an estimated concentration
- MEK = Methyl ethyl ketone
- Meth. Chloride = Methylene chloride
- NA = Not applicable
- ND = Not detected
- NS = No sample
- TB = Trip blank
- 1,1-DCE = 1,1-Dichloroethene
- ug/kg = Micrograms per kilogram
- mg/kg = Milligrams per kilogram
- VOC = Volatile organic compounds
- SVOC = Semivolatile organic compounds
- TNT = Trinitrotoluene

Table 3

ER Site 148

Summary of RCRA Metals, Beryllium, and Hexavalent Chromium Analytical Results for Confirmatory Soil Samples Collected Around the Septic Tank and Seepage Pit

Sample Number	Sample Matrix	Sample Type	Sample Date	Sample Location (Figure 2)	Top of Sample Interval (fbgs)	RCRA Metals, Methods 6010 and 7471 (mg/kg)								Other Metals Be-Method 6010 Cr ⁶⁺ -Method 7196 (mg/kg)	
						As	Ba	Cd	Cr, total	Pb	Hg	Se	Ag	Be	Cr ⁶⁺
018118-2	Soil	Field	10/11/94	S148-SP1-1	14	2.9	69.9	ND	5.2	ND	ND	ND	ND	0.31	ND
018119-2	Soil	Field	10/11/94	S148-SP1-1	24	3.1	67.3	ND	5.6	ND	ND	ND	ND	0.31	ND
018120-2	Soil	Field	10/12/94	S148-SP1-2	14	3.4	74.7	ND	5.3	9.7	ND	ND	0.78 J	0.35	ND
018121-2	Soil	Dupl.	10/12/94	S148-SP1-2	14	2.9	111	ND	5.5	4.1 J	ND	ND	ND	0.34	ND
018122-2	Soil	Field	10/12/94	S148-SP1-2	24	8.5	53.2	ND	5.4	8.4	ND	ND	ND	0.32	ND
018123-2	Soil	Field	10/12/94	S148-ST1-1	12	3.5	57.9	ND	4.9	3.4 J	ND	ND	ND	0.31	ND
018124-2	Soil	Field	10/12/94	S148-ST1-2	12	3.8	69.6	ND	4.4	ND	ND	ND	ND	0.25	ND
Laboratory Detection Limit For Soil (mg/kg)						1	1	0.5	1	5	0.1	0.5	1	0.2	0.05
SNL/NM Soil Background Range (mg/kg)*						U	0.13-730	0.1-8.5	0.01-58.1	1-110	U	U	0.05-10	0.1-1.1	ND
SNL/NM Soil Background UTL, 95th %tile (mg/kg)*						U	407.9	3.51	22.9	15	U	U	4	0.79	ND
Proposed Subpart S Action Level For Soil (mg/kg)						20	6,000	80	80,000**	400***	20	400	400	0.2	400**

Notes

As = Arsenic

Ba = Barium

Cd = Cadmium

Cr = Chromium

Pb = Lead

Hg = Mercury

Se = Selenium

Ag = Silver

Be = milligrams per kilogram

Dupl. = Duplicate soil sample

fbgs = Feet below ground surface

J = Result is detected below the reporting limit or is an estimated concentration

ND = Not detected

U = Undefined for SNL/NM soils

UTL = Upper tolerance limit

mg/kg = Milligrams per kilogram

* IT Corp., October 1994

** 80,000 mg/kg is for Cr3+ only. For Cr6+, proposed Subpart S action level is 400 mg/kg.

*** No proposed Subpart S action level for lead in soil; 400 ppm is EPA proposed action level (EPA, July 1994)

Table 4
ER Site 148
Summary of Isotopic Uranium and Tritium Analyses of Confirmatory Soil Samples
Collected From Adjacent to the Seepage Pit and Septic Tank

Sample Number	Sample Matrix	Sample Type	Sample Date	Sample Location (Figure 2)	Sample Interval (fbgs)	Analytical Method	Compound Name	Results	+ 2 Sigma Uncertainty	Detection Limit	Background UTL Activity**	Units	Top of
													Sample
018118-5	Soil	Field	10/11/94	S148-SP1-1	14	NAS-NS-3050	Uranium-238	0.41	0.1	0.01	1.1	pCi/g	
018118-5	Soil	Field	10/11/94	S148-SP1-1	14	NAS-NS-3050	Uranium-235/236	0.014	0.015	0.015	0.168	pCi/g	
018118-5	Soil	Field	10/11/94	S148-SP1-1	14	NAS-NS-3050	Uranium-234	0.52	0.12	0.01	1	pCi/g	
018119-5	Soil	Field	10/11/94	S148-SP1-1	24	NAS-NS-3050	Uranium-238	0.33	0.08	0.01	1.1	pCi/g	
018119-5	Soil	Field	10/11/94	S148-SP1-1	24	NAS-NS-3050	Uranium-235/236	0.012	0.012	0.008	0.168	pCi/g	
018119-5	Soil	Field	10/11/94	S148-SP1-1	24	NAS-NS-3050	Uranium-234	0.4	0.09	0.01	1	pCi/g	
018120-5	Soil	Field	10/12/94	S148-SP1-2	14	NAS-NS-3050	Uranium-238	0.34	0.08	0.01	1.1	pCi/g	
018120-5	Soil	Field	10/12/94	S148-SP1-2	14	NAS-NS-3050	Uranium-235/236	0.025	0.018	0.008	0.168	pCi/g	
018120-5	Soil	Field	10/12/94	S148-SP1-2	14	NAS-NS-3050	Uranium-234	0.38	0.09	0.01	1	pCi/g	
018121-5	Soil	Dupl.	10/12/94	S148-SP1-2	14	NAS-NS-3050	Uranium-238	0.29	0.08	0.01	1.1	pCi/g	
018121-5	Soil	Dupl.	10/12/94	S148-SP1-2	14	NAS-NS-3050	Uranium-235/236	0.02	0.018	0.019	0.168	pCi/g	
018121-5	Soil	Dupl.	10/12/94	S148-SP1-2	14	NAS-NS-3050	Uranium-234	0.4	0.1	0.02	1	pCi/g	
018122-5	Soil	Field	10/12/94	S148-SP1-2	24	NAS-NS-3050	Uranium-238	0.31	0.08	0.01	1.1	pCi/g	
018122-5	Soil	Field	10/12/94	S148-SP1-2	24	NAS-NS-3050	Uranium-235/236	0.014	0.013	0.008	0.168	pCi/g	
018122-5	Soil	Field	10/12/94	S148-SP1-2	24	NAS-NS-3050	Uranium-234	0.35	0.08	0.01	1	pCi/g	
018123-5	Soil	Field	10/12/94	S148-ST1-1	12	NAS-NS-3050	Uranium-238	0.41	0.1	0.01	1.1	pCi/g	
018123-5	Soil	Field	10/12/94	S148-ST1-1	12	NAS-NS-3050	Uranium-235/236	0.031	0.021	0.009	0.168	pCi/g	
018123-5	Soil	Field	10/12/94	S148-ST1-1	12	NAS-NS-3050	Uranium-234	0.48	0.11	0.01	1	pCi/g	
018124-5	Soil	Field	10/12/94	S148-ST1-2	12	NAS-NS-3050	Uranium-238	0.31	0.08	0.01	1.1	pCi/g	
018124-5	Soil	Field	10/12/94	S148-ST1-2	12	NAS-NS-3050	Uranium-235/236	0.032	0.022	0.01	0.168	pCi/g	
018124-5	Soil	Field	10/12/94	S148-ST1-2	12	NAS-NS-3050	Uranium-234	0.4	0.1	0.01	1	pCi/g	
018118-4	Soil	Compos.	10/12/94	S148-SP1-1/2	14	EERF H.01	Tritium *	ND	308	513.3	U	pCi/L	
018119-4	Soil	Compos.	10/12/94	S148-SP1-1/2	24	EERF H.01	Tritium *	ND	283.43	515.33	U	pCi/L	

Notes

- Compos. = Composite soil sample
- Dupl. = Duplicate sample
- fbgs = Feet below ground surface
- ND = Not detected
- pCi/g = PicoCuries per gram
- pCi/L = PicoCuries per liter
- U = Undefined for SNL/NM soils
- UTL = Upper Tolerance Limit
- * Net tritium value = gross result minus blank sample result.
- ** IT Corp., October 1994

Aside from the possible presence of PCE that was identified in a single PETREX tube (discussed above) but which was not found in follow-up soil samples from that location, the passive soil-gas survey did not indicate any anomalies or areas of VOC or SVOC contamination in soils at ER Site 148.

Confirmatory soil sampling at the point of discharge around the seepage pit did not identify any residual COCs that indicate past discharges from this unit that could pose a threat to human health or the environment. No evidence of leakage or discharge from the septic tank into surrounding soils was identified from the soil sampling. The 2 VOC compounds (methylene chloride and toluene) that were detected in septic tank or seepage pit soil samples were identified at below-reporting-limit concentrations, and are common laboratory contaminants (Table 2). As shown in Table 2, no SVOC constituents, cyanide, or trinitrotoluene (TNT) compounds were identified in these soil samples. Soil sample analytical results indicate that except for arsenic, the 10 metals that were targeted in the Site 148 investigation were either not detected, or were detected in concentrations below the background UTL concentrations of metals presented in the draft SNL/NM study of naturally-occurring constituents (IT October 1994). Low concentrations of arsenic were detected in the ER Site 148 soil samples, but background concentrations for this metal have not been determined in SNL/NM soils. Arsenic concentrations were therefore compared to, and were found to be much lower than, the Subpart S soil action level for that metal (Table 3). In addition, isotopic uranium activity levels detected in all soil samples were less than corresponding background UTL activity levels for those nuclides (Table 4). As shown in Table 4, tritium was not detected in sample soil moisture from this site. Finally, the gamma spectroscopy semiquantitative screening detected only very low activity levels of a few radionuclides, and did not indicate the presence of contamination from other radionuclides in soils at this site (Table A.2 of Appendix A).

4. Conclusion

Sample analytical results generated from this confirmatory sampling investigation show that detectable or significant concentrations of COCs are not present in soils at ER Site 148, and that additional investigations are unwarranted and unnecessary. SNL/NM will remove the remaining dried sludge from the septic tank, properly dispose of the material, and will decommission the septic system in accordance with local ordinances.

Based on archival information and chemical and radiological analytical results of soil samples collected at the likely points of release of effluent from the Building 9927 Septic System, SNL/NM has demonstrated that hazardous waste or COCs have not been released from this SWMU into the environment (Criterion C of Section 1.2), and the site does not pose a threat to human health or the environment. Therefore, ER Site 148 is recommended for an NFA determination.

5. References

5.1 ER Site 148 References

Sandia National Laboratories/New Mexico (SNL/NM), April 1962. SNL/NM Facilities Engineering Drawing Number 90597/M-1, Kirtland Air Force Base, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), June 1994. Field Log #0080, Page 32, 6/14/94, Field notes for ER Site 148 passive soil-gas survey, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), October 1994. Field Log #0096, Pages 67-71, 10/11/94 and 10/12/94, Field notes for ER Site 148 confirmatory soil sampling, OU 1295, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), October 1994. Environmental Operations Records Center, Record Number ER/1295-148/DAT, Albuquerque, New Mexico.

5.2 Other References

Department of Energy (DOE), September 1987, draft. "Comprehensive Environmental Assessment and Response Program (CEARP) Phase 1: Installation Assessment, Sandia National Laboratories, Albuquerque," Department of Energy, Albuquerque Operations Office, Environmental Safety and Health Division, Environmental Program Branch, Albuquerque, New Mexico.

IT Corporation (IT), June 1993, draft. "Sandia National Laboratories/New Mexico Septic Tank Monitoring Report, 1992 Report," IT Corporation, Albuquerque, New Mexico.

IT Corporation (IT), March 1994. "Sampling and Analysis Plan for Shallow Subsurface Soil Sampling, RCRA Facility Investigation of Septic Tanks and Drainfields (OU 1295)," IT Corporation, Albuquerque, New Mexico.

IT Corporation (IT), October 1994, draft. "Background Concentrations of Constituents of Concern to the Sandia National Laboratories/New Mexico Environmental Restoration Project," IT Corporation, Albuquerque, New Mexico.

Lamb Associates, Inc. (Lamb), 1994. "Geophysical Surveys at 23 Sites, Septic Tanks and Drainfields, ADS #1295," Lamb Associates, Inc., Albuquerque, New Mexico.

Northeast Research Institute (NERI), 1994. "PETREX Soil-Gas Survey Results Conducted at Various Sites of the Septic Tanks and Drainfields Operating Units, Sandia National Laboratories," Albuquerque, New Mexico, Northeast Research Institute, Lakewood, Colorado.

RUST Geotech, Inc. (RUST), December 1994. "Final Report, Surface Gamma Radiation Surveys for Sandia National Laboratories/New Mexico Environmental Restoration Project," RUST Geotech, Inc., Grand Junction, Colorado.

Sandia National Laboratories/New Mexico (SNL/NM), March 1993. "Septic Tanks and Drainfields (ADS-1295) RCRA Facility Investigation Work Plan," Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), October 1994. "1993 Site Environmental Report, Sandia National Laboratories, Albuquerque, New Mexico," Sandia Report SAND94-1293, Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), November 1994. "Comment Responses to U.S. Environmental Protection Agency Notice of Deficiency November 1994," Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), February 1995, draft. "Program Implementation Plan for Albuquerque Potential Release Sites," Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), March 1995. "Groundwater Protection Program Calendar Year 1994 Annual Groundwater Monitoring Report Sandia National Laboratories/New Mexico," Sandia National Laboratories, Groundwater Protection Program, Environmental Operations Center, Organization 7500, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), February 1995. "Program Implementation Plan for Albuquerque Potential Release Sites," Sandia National Laboratories Environmental Restoration Program, Albuquerque, New Mexico.

U.S. Environmental Protection Agency (EPA), October 1986. "RCRA Facility Assessment Guidance," EPA/530-86-053, PB87-107769, Washington, D.C.

U.S. Environmental Protection Agency (EPA), April 1987. "Final RCRA Facility Assessment Report of Solid Waste Management Units at Sandia National Laboratories, Albuquerque, New Mexico," Contract No. 68-01-7038, EPA Region VI.

U.S. Environmental Protection Agency (EPA), December 1987. "Hazardous Waste; Codification Rule for 1984 RCRA Amendments; Final Rule," *Federal Register*, Vol 52, Title 40, Parts 144, 264, 265, 270, and 27, Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), July 1990. "Corrective Action for Solid Waste Management Units (SWMU) at Hazardous Waste Management Facilities, Proposed Rule," *Federal Register*, Vol. 55, No. 145, July 27, 1990, Washington, D.C.

U.S. Environmental Protection Agency (EPA), August 1992. "Hazardous Waste Management Facility Permit No. NM5890110518," EPA Region VI, issued to Sandia National Laboratories, Albuquerque, New Mexico.

U.S. Environmental Protection Agency (EPA), August 1993. "Module IV of RCRA Permit No. NM 5890110518," EPA Region VI, issued to Sandia National Laboratories, Albuquerque, New Mexico.

U.S. Environmental Protection Agency (EPA), July 1994. "Guidance on Residential Lead-Based Paint, Lead-Contaminated Dust, and Lead-Contaminated Soil," Memorandum from Lynn R. Goldman, M.D., U.S. Environmental Protection Agency Assistant Administrator to EPA Regional Directors.

Appendix A

OU 1295, Site 148

Results of Previous Sampling and Surveys

Table A.1

ER Site 148

Summary of Constituents Detected in 1992 Septic Tank Samples

**Building 9927
Coyote Test Field
Sample ID No. SNLA008431
Tank ID No. AD89040R**

On July 21, 1992, aqueous and sludge samples were collected from the septic tank serving Building 9927. Analytical results of concern are noted below.

- Trichloroethene (TCE) was detected in the aqueous sample at a level of 4.0 mg/L, which exceeds the New Mexico Water Quality Control Commission (NMWQCCR) discharge limit (NMDL) of 0.1 mg/L and the Resource Conservation and Recovery Act (RCRA) toxicity characteristic (TC) limit of 0.5 mg/L.
- Tetrachloroethene (PERC, tetrachloroethylene) was detected in the aqueous sample at a level of 0.035 mg/L (an estimated value because the sample required dilution, resulting in a raised detection limit), which exceeds the NMDL of 0.02 mg/L.
- The following RCRA TC metals, which are also regulated under the City of Albuquerque (COA) wastewater ordinance and the NMWQCCR, were detected in the sludge sample at levels indicating that additional waste characterization may be required: barium (828 mg/kg), chromium (511 mg/kg), lead (394 mg/kg), mercury (7.1 mg/kg), and silver (1530 mg/kg).
- Copper and zinc, which are regulated under the COA wastewater ordinance and the NMWQCCR, were detected in the sludge sample at 3510 mg/kg and 3140 mg/kg, respectively.

No other parameters were detected above NMDLs, COA discharge limits, or RCRA TC limits that identify characteristic hazardous waste limits.

During review of the sludge radiochemistry data, the following item was noted:

- ^{226}Ra , measured at 0.724 pCi/mL, by gamma spectroscopy, does not exceed the investigation levels calculated during this monitoring effort. However, this finding exceeds the U.S. Department of Energy derived concentration guideline of 0.5 pCi/mL. ^{226}Ra was measured in the aqueous sample at 0.0009 pCi/mL. A more sensitive technique for assaying ^{226}Ra may be warranted.

Table A.1, continued

ER Site 148
Summary of Constituents Detected in 1992 Septic Tank Samples

Results of Septic Tank Analyses (LIQUID SAMPLES)				
Building No./Area:		9927 C1F		
Tank ID No.:		ADB9040R		
Date Sampled:		7/21/92		
Sample ID No.:		SNLA-008431		
Analytical Parameter	Measured Concentration	State Discharge Limit	COA Discharge Limit	Comments
<i>Volatile Organics (EPA 624)</i>				
	(mg/l)	(mg/l)	(mg/l)	
Methylene Chloride	0.05	0.1	(TTO=5.0)	Below reporting limits
Tetrachloroethene	0.035	0.02	(TTO=5.0)	Exceeds State Limit; below reporting limits
Trichloroethene	4.00	0.1	(TTO=5.0)	Exceeds State Limit
<i>Semivolatile Organics (EPA 625)</i>				
	(mg/l)	(mg/l)	(mg/l)	
None detected above laboratory reporting limits.		Parameter Specific	(TTO=5.0)	
<i>Pesticides (EPA 606)</i>				
	(mg/l)	(mg/l)	(mg/l)	
Dieldrin	0.00088	NR	(TTO=5.0)	
<i>PCBs (EPA 608)</i>				
	(mg/l)	(mg/l)	(mg/l)	
None detected above laboratory reporting limits.		0.001	(TTO=5.0)	
<i>Metals</i>				
	(mg/l)	(mg/l)	(mg/l)	
Arsenic	ND (0.005)	0.1	2.0	
Barium	0.19	1.0	20.0	
Cadmium	0.0032	0.01	2.8	
Chromium	0.12	0.05	20.0	Exceeds State Limit
Copper	0.38	1.0	16.5	
Lead	0.018	0.05	3.2	
Manganese	0.19	0.20	20.0	
Mercury	0.0012	0.002	0.1	
Nickel	—	NR	12.0	Not analyzed
Selenium	ND (0.01)	0.05	2.0	
Silver	1.2	0.05	5.0	Exceeds State Limit
Thallium	ND (0.01)	NR	NR	
Zinc	0.55	10.0	28.0	
Uranium	ND (0.007)	5.0	NR	
<i>Miscellaneous Analytes</i>				
	(mg/l)	(mg/l)	(mg/l)	
Phenolic Compounds	0.019	0.005	4.0	Exceeds State Limit
Nitrates/Nitrites	0.92	10.0	NR	
Formaldehyde	ND (0.25)	NR	260.0	
Fluoride	0.48	1.6	160.0	
Cyanide	0.038	0.2	8.0	
Oil and Grease	8.7	NR	150.0	
<i>Radiological Analyses</i>				
	(pCi/l)	(pCi/l)	(pCi/l)	
Radium 226	0.9 +/- 0.2	30.0	NR	
Radium 228	0 +/- 40	30.0	NR	
Gross Alpha	0 +/- 20	NR	NR	
Gross Beta	50 +/- 40	NR	NR	
Tritium	900 +/- 400	NR	NR	

NR = Not Regulated; ND (#.#) = Not detected (reporting limit)
 Note: City and State Discharge Limits are for comparison purposes only. City limits apply to discharge of sanitary effluent and not septic tank waste, state limits apply to effluent discharged into or below the surface of the ground.
 Reference: City of Albuquerque NM Sewer Use and Wastewater Control Ordinance (1990), Section 8-3-3, and New Mexico Water Quality Control Commission Regulations (1988), Section 3-100

Table A.1, concluded

ER Site 148
Summary of Constituents Detected in 1992 Septic Tank Samples

Results of Septic Tank Analyses (Sludge Sample)			
Building No./Area:	9927 CTF		
Tank ID No.:	AD89040R		
Date Sampled:	7/21/92		
Sample ID No.:	SNLA008431		
Analytical Parameter	Measured Concentration	+ 2 Sigma Uncertainty	Units
Water Content	91.1	NA	%
Arsenic	9.4	NA	mg/kg
Barium	828	NA	mg/kg
Cadmium	24.3	NA	mg/kg
Chromium	511	NA	mg/kg
Copper	3510	NA	mg/kg
Lead	394	NA	mg/kg
Manganese	182	NA	mg/kg
Mercury	7.1	NA	mg/kg
Nickel	---	NA	mg/kg
Selenium	ND (5.6)	NA	mg/kg
Silver	1530	NA	mg/kg
Thallium	ND (5.6)	NA	mg/kg
Zinc	3140	NA	mg/kg
Gross Alpha	19	18	pCi/g
Gross Beta	33	36	pCi/g
Gross Alpha	13	18	pCi/g
Gross Beta	20	42	pCi/g
Gross Alpha	24	19	pCi/g
Gross Beta	31	38	pCi/g
Gross Alpha	4	15	pCi/g
Gross Beta	32	35	pCi/g
Tritium	9E+02	4E+02	pCi/L
Bismuth-214	<0.0297	NA	pCi/mL
Cesium-137	0.0208	0.00500	pCi/mL
Potassium-40	1.83	0.129	pCi/mL
Lead-212	0.0792	0.00971	pCi/mL
Lead-214	0.100	0.00111	pCi/mL
Radium-226	0.724	0.104	pCi/mL
Thorium-234	<0.247	NA	pCi/mL
Thallium-208	0.0345	0.00489	pCi/mL

ND = Not Detected
NA = Not Applicable

Table A.2

ER Site 148
Summary of Constituents Detected in 1994 and 1995 Septic Tank Samples

Sample Number	Sample Matrix	Sample Type	Sample Date	Method	Compound Name	Result	Detection Limit	+ 2 Sigma Uncertainty	Units
May 1994 Samples:									
015456-1	Sludge	Field	5/9/94	8240	VOCs	ND	0.025,0.05	NA	mg/L
015456-2	Sludge	Field	5/9/94	8270	SVOCs	ND	0.05-0.25	NA	mg/L
015456-2	Sludge	Field	5/9/94	TCLP/6010	Arsenic	ND	0.2	NA	mg/L
015456-2	Sludge	Field	5/9/94	TCLP/6010	Barium	0.099 B	0.02	NA	mg/L
015456-2	Sludge	Field	5/9/94	TCLP/6010	Cadmium	0.39	0.01	NA	mg/L
015456-2	Sludge	Field	5/9/94	TCLP/6010	Chromium	1.3	0.02	NA	mg/L
015456-2	Sludge	Field	5/9/94	TCLP/6010	Lead	ND	0.1	NA	mg/L
015456-2	Sludge	Field	5/9/94	TCLP/6010	Selenium	0.22 J	0.4	NA	mg/L
015456-2	Sludge	Field	5/9/94	TCLP/6010	Silver	0.031	0.02	NA	mg/L
015456-2	Sludge	Field	5/9/94	TCLP/7470	Mercury	ND	0.0002	NA	mg/L
015456-5	Sludge	Field	5/9/94	HASL-300	Uranium 238	1.9	0.028	0.26	pCi/g
015456-5	Sludge	Field	5/9/94	HASL-300	Uranium 235	0.071	0.025	0.032	pCi/g
015456-5	Sludge	Field	5/9/94	HASL-300	Uranium 233/234	2.8	0.035	0.35	pCi/g
015456-3	Sludge	Field	5/9/94		Uranium Series:				
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	U-238	2.25	NG	0.577	pCi/g
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	Th-234	2.26	NG	0.578	pCi/g
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	Ra-226	3.00	NG	0.907	pCi/g
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	Pb-214	0.43	NG	0.077	pCi/g
015456-3	Sludge	Field	5/9/94		Thorium Series:				
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	Th-228	0.496	NG	0.064	pCi/g
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	Ra-224	1.09	NG	0.817	pCi/g
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	Pb-212	0.499	NG	0.064	pCi/g
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	Tl-208	0.182	NG	0.042	pCi/g
015456-3	Sludge	Field	5/9/94		Other Radionuclides:				
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	Cs-137	0.095	NG	0.049	pCi/g
015456-3	Sludge	Field	5/9/94	Gamma Spectroscopy	K-40	7.44	NG	0.769	pCi/g
January 1995 Samples:									
021477-1	Sludge	Field	1/26/95	HASL-300	Uranium 238	1.9	0.071	0.37	pCi/g
021477-1	Sludge	Field	1/26/95	HASL-300	Uranium 235	0.12	0.071	0.076	pCi/g
021477-1	Sludge	Field	1/26/95	HASL-300	Uranium 233/234	2.7	0.097	0.48	pCi/g
021477-1	Sludge	Field	1/26/95	600 906.0	Tritium *	7250	6200	3400	pCi/L

Table A.2, concluded

ER Site 148
Summary of Constituents Detected in 1994 and 1995 Septic Tank Samples

Sample Number	Sample Matrix	Sample Type	Sample Date	Method	Compound Name	Result	Detection Limit	+ 2 Sigma Uncertainty	Units
January 1995 Samples, continued:									
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Uranium Series:				
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	U-238	2.68	2.68	1.4	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Th-234	3.25	0.964	1.18	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Ra-226	2.32	0.91	0.837	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Pb-214	0.606	0.093	0.185	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Bi-214	0.545	0.119	0.139	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Thorium Series:				
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Th-232	0.664	0.262	0.272	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Ra-228	0.648	0.399	0.295	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Ra-224	1.31	0.783	0.606	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Pb-212	0.548	0.075	0.181	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Tl-208	0.652	0.156	0.178	pCi/g
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	Other Radionuclides:				
021477-2	Sludge	Field	1/26/95	Gamma Spectroscopy	K-40	12.9	0.839	2.3	pCi/g

B = Compound detected in the laboratory blank.

J = Result is detected below the reporting limit or is an estimated concentration.

mg/L = Milligrams per liter

NA = Not Applicable

ND = Not detected

NG = Not given

pCi/g = Picocuries per gram

pCi/L = Picocuries per liter

TCLP = Toxicity Characteristic Leaching Procedure

* Net tritium value = gross result minus blank sample result.

Table A.3

ER Site 148
 Summary of 1994 PETREX Passive Soil Gas Survey Results

PETREX Relative Soil Gas Response Values
 (in ion counts)
 STD SITE 148

Sample	PCE	TCE	BTEX	Aliphatics
156	22365	ND	9647	44728
157	ND	ND	1160	ND
158	35259	ND	63414	55499
159	82168	ND	14736	10757
160	118283	ND	38533	91262
161	24311	ND	17539	51744
D-1157	11902	ND	15910	4978
* 900	ND	ND	4553	6219
* 901	ND	ND	4732	ND

PCE - Tetrachloroethene

Indicator Mass Peak(s) 164

TCE - Trichloroethene

Indicator Mass Peak(s) 130

BTEX - Benzene, Toluene, Ethylbenzene/Xylene(s)

Indicator Mass Peak(s) 78, 92, 106

Aliphatics - C4-C11 Cycloalkanes/Alkenes

Indicator Mass Peak(s) 56, 70, 84, 98, 112,
 126, 140, 154

D - Duplicate Sample

Sample numbers in thousands duplicate of sample numbers in hundreds

* QA/QC Blank Sample - No Compounds Detected
 above the PETREX Normal reporting Limits

Table A.4

ER Site 148
 Gamma Spectroscopy Screening Results for Seepage Pit
 Shallow Interval Composite Soil Sample

 * SNL Radiation Sample Diagnostic Program (7715)/881 13-OCT-94 13:21:07 *

 B.GALLCWAY (7582) SNL/NM-018118-3

Operator: 10/12/94 Reviewed by 10/14/94

 *
 Data File : 94054201.DAT * Sample Quantity: 772.000 GRAM
 Acquire Date: 13-OCT-94 12:16:37 * Efficiency File: SMAR1.EFF
 Sample Date: 12-OCT-94 14:00:00 * Library File: RSDP.LIB
 Sample Type: SOLID *

 *
 Preset Live Time: 3600.0 sec * FWHM at 1332 KeV : 2.0 KeV
 Elapsed Live Time: 3600.0 sec * Peak Search Sensitivity: 4.0
 Elapsed Real Time: 3601.0 sec * Gaussian Assymetry : 10.0 %

 *
 Detector : DET1 * Fit Iterations : 20.
 Calib Date : 30-AUG-94 09:23:06 * Energy Tolerance: 1.5 KeV
 KeV/Channel: .36608 * Half Life Ratio : 8.0
 Offset : -.14939 * Abundance Limit : 50.00 %

[Summary Report -- SNL (7715) -- version 1.2]

Nuclide	Activity (PCI /GRAM)	2-sigma Error	MDA (PCI /GRAM)
U-238	9.08E-01	3.98E-01	-----
TH-234	9.10E-01	3.98E-01	-----
U-234	Not Detected	-----	9.54E+00
RA-226	1.81E+00	6.10E-01	-----
PB-214	6.60E-01	6.03E-02	-----
BI-214	6.80E-01	6.62E-02	-----
PB-210	Not Detected	-----	0.00E+00
TH-232	6.20E-01	1.03E-01	-----
RA-228	6.20E-01	1.03E-01	-----
AC-228	5.59E-01	9.33E-02	-----
TH-228	5.95E-01	4.25E-02	-----
RA-224	8.57E-01	6.22E-01	-----
PB-212	5.97E-01	4.27E-02	-----
BI-212	3.27E-01	1.80E-01	-----
TL-208	4.80E-01	6.97E-02	-----
U-235	Not Detected	-----	3.44E-02
TH-231	Not Detected	-----	3.02E-01
PA-231	Not Detected	-----	6.79E-01
AC-227	Not Detected	-----	9.80E-01
TH-227	Not Detected	-----	1.16E-01
AM-241	Not Detected	-----	1.17E-01
NP-237	Not Detected	-----	1.72E-01
PA-233	Not Detected	-----	3.12E-02
TH-229	Not Detected	-----	7.33E-02

Table A.4, concluded

ER Site 148
Gamma Spectroscopy Screening Results for Seepage Pit
Shallow Interval Composite Soil Sample

ID: B.GALLOWAY (7582) SNL/NM-018118-3

Nuclide	Activity (PCI /GRAM)	2-sigma Error	MDA (PCI /GRAM)
PU-239	Not Detected	-----	2.51E+02
AG-110	Not Detected	-----	1.41E-02
BB-7	Not Detected	-----	1.20E-01
AR-41	Short Half-Life	-----	-----
BA-133	Not Detected	-----	2.05E-02
BA-140	Not Detected	-----	5.28E-02
BI-207	Not Detected	-----	1.65E-02
CD-109	Not Detected	-----	6.66E-01
CE-139	Not Detected	-----	1.71E-02
CE-144	Not Detected	-----	1.32E-01
CO-56	Not Detected	-----	2.44E-02
CO-57	Not Detected	-----	1.66E-02
CO-58	Not Detected	-----	1.60E-02
CO-60	Not Detected	-----	2.24E-02
CR-51	Not Detected	-----	1.31E-01
CS-134	Not Detected	-----	1.33E-02
CS-137	Not Detected	-----	1.61E-02
CU-64	Not Detected	-----	1.90E+01
EU-152	Not Detected	-----	5.00E-02
EU-154	Not Detected	-----	6.48E-02
EU-155	Not Detected	-----	7.97E-02
FE-59	Not Detected	-----	3.87E-02
GD-153	Not Detected	-----	5.25E-02
HG-203	Not Detected	-----	1.75E-02
I-125	Not Detected	-----	0.00E+00
I-129	Not Detected	-----	0.00E+00
I-131	Not Detected	-----	1.50E-02
IN-115M	Not Detected	-----	1.07E+00
IR-192	Not Detected	-----	1.56E-02
K-40	1.52E+01	7.04E-01	-----
LA-140	Not Detected	-----	2.37E-02
MN-54	Not Detected	-----	1.98E-02
MN-55	Short Half-Life	-----	-----
NA-22	Not Detected	-----	2.43E-02
NA-24	Not Detected	-----	4.78E-02
NB-95	Not Detected	-----	6.60E-02
RU-103	Not Detected	-----	1.26E-02
RU-106	Not Detected	-----	1.11E-01
SB-124	Not Detected	-----	1.47E-02
SB-125	Not Detected	-----	4.23E-02
SB-126	Not Detected	-----	1.55E-02
SC-46	Not Detected	-----	1.61E-02
SN-113	Not Detected	-----	1.85E-02
SR-85	Not Detected	-----	1.41E-02
TA-182	Not Detected	-----	1.45E-01
TB-123M	Not Detected	-----	1.69E-02
TL-201	Not Detected	-----	1.65E-01
XE-133	Not Detected	-----	8.94E-02
Y-88	Not Detected	-----	2.12E-02
ZN-65	Not Detected	-----	3.60E-02
ZR-95	Not Detected	-----	3.23E-02

Table A.5

ER Site 148
Gamma Spectroscopy Screening Results for Seepage Pit
Deep Interval Composite Soil Sample

* SNL Radiation Sample Diagnostic Program (7715)/881 13-OCT-94 14:58:11 *

B.GALLOWAY/E.RANKIN (7582/SMO) SNL/NM#018119-3.

Operator: W 10/13/94 Reviewed by JRM 10/14/94

*
Data File : 94054202.DAT * Sample Quantity: 739.000 GRAM
Acquire Date: 13-OCT-94 13:21:18 * Efficiency File: SMAR1.EFF
Sample Date: 12-OCT-94 13:30:00 * Library File: RSDP.LIB
Sample Type: SOLID *

*
Preset Live Time: 3600.0 sec * FWHM at 1332 KeV : 2.0 KeV
Elapsed Live Time: 3600.0 sec * Peak Search Sensitivity: 4.0
Elapsed Real Time: 3601.0 sec * Gaussian Assymetry : 10.0 %

*
Detector : DET1 * Fit Iterations : 20.
Calib Date : 30-AUG-94 09:23:06 * Energy Tolerance: 1.5 KeV
KeV/Channel: .36608 * Half Life Ratio : 8.0
Offset : -.14939 * Abundance Limit : 50.00 %

[Summary Report -- SNL (7715) -- version 1.2]

Nuclide	Activity (PCI /GRAM)	2-sigma Error	MDA (PCI /GRAM)
U-238	Not Detected	-----	4.27E-01
TH-234	Not Detected	-----	4.28E-01
U-234	Not Detected	-----	1.02E+01
RA-226	9.38E-01	5.39E-01	-----
PB-214	6.89E-01	6.49E-02	-----
BI-214	6.86E-01	6.59E-02	-----
PB-210	Not Detected	-----	0.00E+00
TH-232	7.79E-01	1.68E-01	-----
RA-228	7.79E-01	1.68E-01	-----
AC-228	7.03E-01	1.52E-01	-----
TH-228	5.81E-01	4.35E-02	-----
RA-224	1.98E+00	5.53E-01	-----
PB-212	5.83E-01	4.37E-02	-----
BI-212	2.58E-01	2.27E-01	-----
TL-208	5.21E-01	9.35E-02	-----
U-235	Not Detected	-----	3.42E-02
TH-231	Not Detected	-----	3.02E-01
PA-231	Not Detected	-----	6.89E-01
AC-227	Not Detected	-----	1.02E+00
TH-227	Not Detected	-----	1.29E-01
AM-241	Not Detected	-----	1.24E-01
NP-237	Not Detected	-----	1.84E-01
PA-233	Not Detected	-----	3.71E-02
TH-229	Not Detected	-----	7.61E-02

Handwritten notes:
Cory
10/14/94

Table A.5, concluded

ER Site 148
 Gamma Spectroscopy Screening Results for Seepage Pit
 Deep Interval Composite Soil Sample

ID: B.GALLOWAY/E.RANKIN (7582/SMO) SNL/NM 018119-3

Nuclide	Activity (PCI /GRAM)	2-sigma Error	MDA (PCI /GRAM)
PU-239	Not Detected	-----	2.66E+02
AG-110	Not Detected	-----	1.38E-02
BE-7	Not Detected	-----	1.33E-01
AR-41	Short Half-Life	-----	-----
BA-133	Not Detected	-----	2.26E-02
BA-140	Not Detected	-----	5.49E-02
BI-207	Not Detected	-----	1.63E-02
CD-109	1.90E+00	5.70E-01	-----
CE-139	Not Detected	-----	1.79E-02
CE-144	Not Detected	-----	1.39E-01
CO-56	Not Detected	-----	2.21E-02
CO-57	Not Detected	-----	1.83E-02
CO-58	Not Detected	-----	1.86E-02
CO-60	Not Detected	-----	2.55E-02
CR-51	Not Detected	-----	1.30E-01
CS-134	Not Detected	-----	1.37E-02
CS-137	Not Detected	-----	1.71E-02
CU-64	Not Detected	-----	2.03E+01
EU-152	Not Detected	-----	5.49E-02
EU-154	Not Detected	-----	7.34E-02
EU-155	6.97E-02	7.12E-02	-----
FE-59	Not Detected	-----	3.94E-02
GD-153	Not Detected	-----	5.63E-02
HG-203	Not Detected	-----	1.78E-02
I-125	Not Detected	-----	0.00E+00
I-129	Not Detected	-----	0.00E+00
I-131	Not Detected	-----	1.77E-02
IN-115M	Not Detected	-----	1.43E+00
IR-192	Not Detected	-----	1.77E-02
K-40	1.61E+01	7.16E-01	-----
LA-140	Not Detected	-----	2.21E-02
MN-54	Not Detected	-----	2.02E-02
MN-56	Short Half-Life	-----	-----
NA-22	Not Detected	-----	2.60E-02
NA-24	Not Detected	-----	6.76E-02
NB-95	Not Detected	-----	7.29E-02
RU-103	Not Detected	-----	1.48E-02
RU-106	Not Detected	-----	1.20E-01
SB-124	Not Detected	-----	1.63E-02
SB-125	Not Detected	-----	4.09E-02
SB-126	Not Detected	-----	1.77E-02
SC-46	Not Detected	-----	1.91E-02
SN-113	Not Detected	-----	2.14E-02
SR-85	Not Detected	-----	1.31E-02
TA-182	Not Detected	-----	1.54E-01
TB-123M	Not Detected	-----	1.72E-02
TL-201	Not Detected	-----	1.82E-01
XB-133	Not Detected	-----	9.44E-02
Y-88	Not Detected	-----	2.15E-02
ZN-65	Not Detected	-----	4.39E-02
ZR-95	Not Detected	-----	3.29E-02

not detected *JC 9/12/54*

not detected *JC 9/12/54*

NOD

ER/REQ/1295
1332
1303



Department of Energy

Field Office, Albuquerque

Kirtland Area Office

P.O. Box 5400

Albuquerque New Mexico 87185-5400

JUN 21 1997

CERTIFIED MAIL - RETURN RECEIPT REQUESTED

Mr. Benito Garcia, Bureau Chief
New Mexico Environment Department
Hazardous and Radioactive Materials Bureau
2044 Galisteo Street
P.O. Box 26110
Santa Fe, NM 87505-2100

Dear Mr. Garcia:

Enclosed are two copies of the Department of Energy (DOE)/ Sandia National Laboratories/New Mexico (SNL/NM) response to the NMED Notice of Deficiency (NOD) for the third submission of No Further Action (NFA) proposals. NOD responses are provided for the following environmental restoration sites:

- OU 1295 - Septic Tanks and Drain Fields
 - Site 142 - Building 9970 Septic System
 - Site 143 - Building 9972 Septic System
 - Site 146 - Building 9920 Drain System
 - Site 148 - Building 9927 Septic System
- OU 1332 - Foothills Test Area
 - Site 15 - Trash Pits
 - Site 27 - Building 9820 Animal Disposal Pit
 - Site 28-2 - Mine Shaft
 - Site 28-10 - Mine Shaft
 - Site 67 - Frustration Site
- OU 1333 - Canyons Test Area
 - Site 59 - Pendulum Site
 - Site 63A - Balloon Test Area
 - Site 63B - Balloon Test Area
 - Site 64 - Gun Site
 - Site 92 - Pressure Vessel Test Site

If you have any questions, please contact John Gould at (505) 845-6089, or Mark Jackson at (505) 845-6288.

Sincerely,

George K. Jackson
Michael J. Zamorski
Acting Area Manager

Enclosures

27147

Benito Garcia

cc w/enclosure:

T. Trujillo, AL, ERD

W. Cox, SNL, MS 1147

J. Parker, NMED-OB

R. Kennett, NMED-OB

D. Neleigh, EPA, Region 6 (2 copies via certified mail)

cc w/o enclosure:

B. Oms, KAO-OB

B. Galloway, SNL, MS 1147

C. Byrd, SNL, MS 1148

S. Young, SNL, MS 1147

S. Dinwiddie, NMED

T. Davis, NMED

S. Kruse, NMED


**Sandia National Laboratories
Albuquerque, New Mexico
June 1997**

**Environmental Restoration Project
Responses to NMED Technical Comments
on No Further Action Proposals
Dated August 1995**

INTRODUCTION

This document responds to comments received in a letter from the State of New Mexico Environment Department to the U.S. Department of Energy (Zamorski, April 28, 1997) documenting the review of 14 No Further Action (NFA) Proposals submitted in August 1995.

This response document is organized in sections by operable unit (OU) and subdivided in numerical order by site number. Each OU section provides NMED comments repeated in **bold** by comment number and by site number in the same order as provided in the call for response to comments. The DOE/SNL response is written in normal font style on a separate line under "Response". Responses to general technical comments begin on page 3 and responses to site-specific technical comments begin on page 5. Additional supporting information for the general and site-specific comments is included as figures and tables within each comment and as attachments within each section, as appropriate. When referenced in the site-specific NOD responses, risk assessment analyses will be submitted to NMED at a later date.

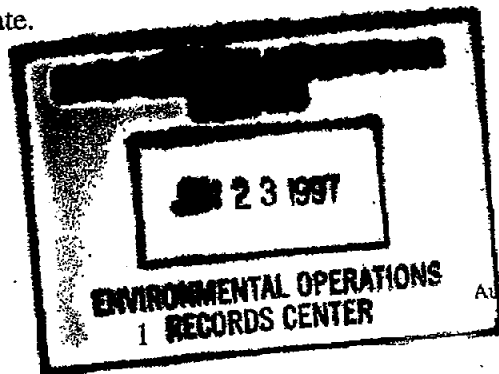

SNL/NM ER Project
June 1997

August 1995 NFA Proposals
Comment Responses

TABLE OF CONTENTS

	<u>Page</u>
GENERAL COMMENTS	3
Attachment A—Final Site Maps for OUs 1295, 1332, and 1333.....	Tab A
SITE-SPECIFIC COMMENTS	5
OU 1295	12
OU 1332	Tab A
Attachment A—Corrected Site Map.....	Tab B
Attachment B—Results of Radiation Surveys.....	Tab C
Attachment C—Original Field Reports	16
OU 1333	Tab A
Attachment A—Analytical Results for Soil Samples.....	Tab A

**RESPONSES TO NMED COMMENTS
ON NO FURTHER ACTION PROPOSALS
DATED AUGUST 1995**

GENERAL COMMENTS

1. **Final, rather than draft, site maps should be provided for each unit proposed for No Further Action (NFA). (Needed for adequate review)**

Response: Final site maps for OUs 1295, 1332, and 1333 are provided in Attachment A of this section. In addition, all future NFA submittals will be submitted with final rather than draft site maps.

2. **Interviews alone are not sufficient documentation to make an NFA determination. Site history and interviews can be used to guide an investigation or confirm other evidence, but are not sufficient by themselves. In the absence of any other supporting information, screening sampling should be conducted to further corroborate the interview and site history information. (Best Professional Judgment)**

In most cases, an NFA proposal is not likely to be approved unless it is based on some sampling and analysis of the medium/media of concern. (Best Professional Judgment)

Response: DOE/SNL believe that, where the actual persons involved with the operation, at the time of the suspected release, provide first-hand, eyewitness accounts, they are reliable sources of information. In most cases, a combination of information is used to determine whether a release has occurred, including sampling. In some cases the suspect media has been removed, and therefore can no longer be sampled. In summary, each case must be judged individually. Where additional sampling is appropriate for those sites reviewed in the third round of NFAs, it is so stated under the site-by-site responses given below.

3. **Analytical results obtained at Environmental Restoration (ER) sites should be compared with sitewide background concentrations, when approved by the New Mexico Environment Department, to determine whether contamination has occurred. (Best Professional Judgment)**

General Comments

Response: DOE/SNL are currently in the process of negotiating site-wide background concentrations with the New Mexico Environment Department (NMED), and expect that all values except those for OUs 1332, 1333, and 1334 to be approved. Upon final approval of the site-wide background study report, all OUs except for OUs 1332, 1333, and 1334 will compare analytical results to the background concentrations contained in the report. Additional background samples will be collected at OUs 1332, 1333, and 1334 upon mutual agreement with NMED of locations for such sampling.

4. **A sampling and analysis plan or RFI Work Plan should be submitted prior to the start of any sampling activities conducted as a result of this Notice of Deficiency. (Permit Condition J.1)**

Response: Where sampling is anticipated, a sampling and analysis plan is developed which is provided to the NMED. Meetings with the NMED Oversight Bureau are scheduled in order to review these sampling plans and make any changes in the technical approach that would benefit the investigation. These practices will continue. However, DOE/SNL may not have always provided the NMED Hazardous and Radioactive Material Bureau with such sampling plans, or an invitation to participate in pre-sampling discussions. If that has happened, it was an oversight for which DOE/SNL apologizes. DOE/SNL will make every effort in the future to be inclusive in the pre-sampling discussions with all appropriate elements of NMED.

5. **Any sources cited in NFA proposals should be documented and referenced. The source documents should be readily available to the public and to any reviewers. (Additional information needed for adequate review)**

Response: Sources cited in all current submissions of NFA proposals are documented and referenced. General ER Project documents (e.g., RFI Work Plans, RFI Reports, NFAs, the Program Implementation Plan, etc.) are available to the public and other reviewers at the DOE Public Reading Room located at the Library Building at Albuquerque Technical-Vocational Institute, Joseph M. Montoya Campus, at 4700 Morris Avenue, NE. DOE/KAO will continue its practice of simultaneously transmitting to NMED copies of all documents sent to the Public Reading Room. OU-specific archival references are located at the ER Project Records Center. The public and regulators can access information from the ER Project Records Center by verbal or written request to John Gould, DOE/KAO, at (505) 845-6089.

General Comments

ATTACHMENT A
FINAL SITE MAPS FOR
OUS 1295, 1332, AND 1333

SNL/NM ER Project
June 1997


August 1995 NFA Proposals
Comment Responses

General Comments





FINAL SITE MAPS FOR OU 1295

**SNL/NM ER Project
June 1997**

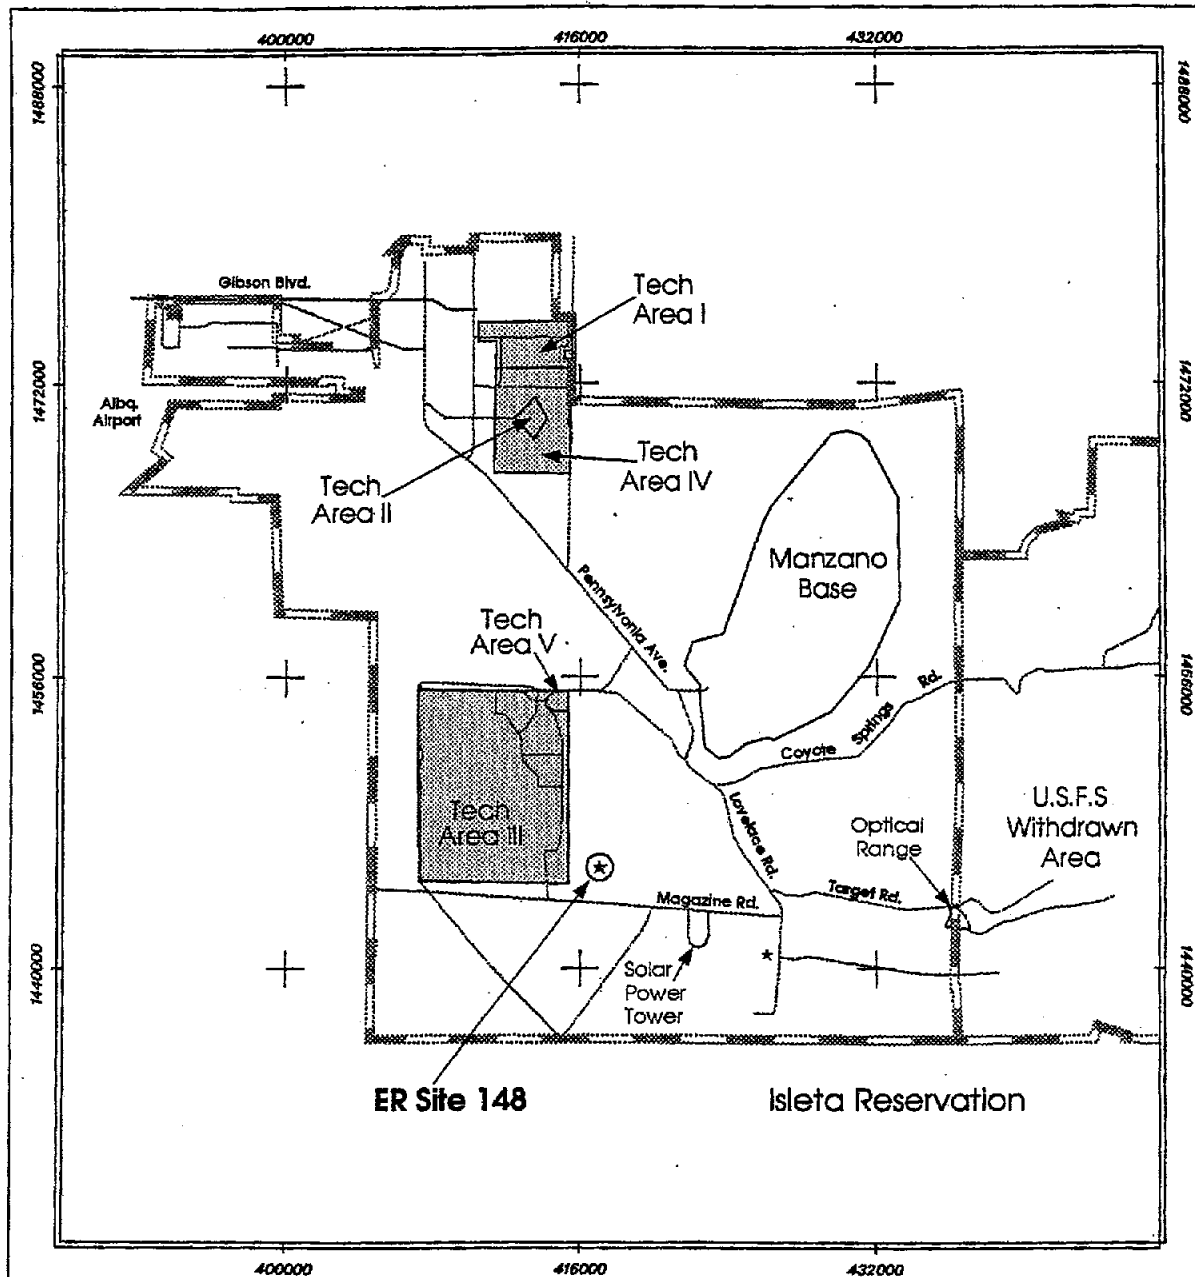**August 1995 NFA Proposals
Comment Responses**



Legend

-  ER Site 148
-  Major Roads
-  KAFB Boundary
-  Technical Areas

**Sandia National Laboratories, New Mexico
Environmental Restoration Geographic Information System**

Transverse Mercator Projection, New Mexico State Plane Coordinate System, Central Zone
1927 North American Horizontal Datum, 1929 North American Vertical Datum


Unclassified

0 5000 10000


Scale in Feet

0 1200 2400

Scale in Meters

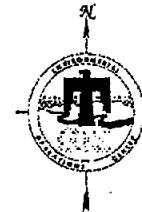

**FIGURE 1
Location Map for ER Site 148
Sandia National Laboratories,
New Mexico**

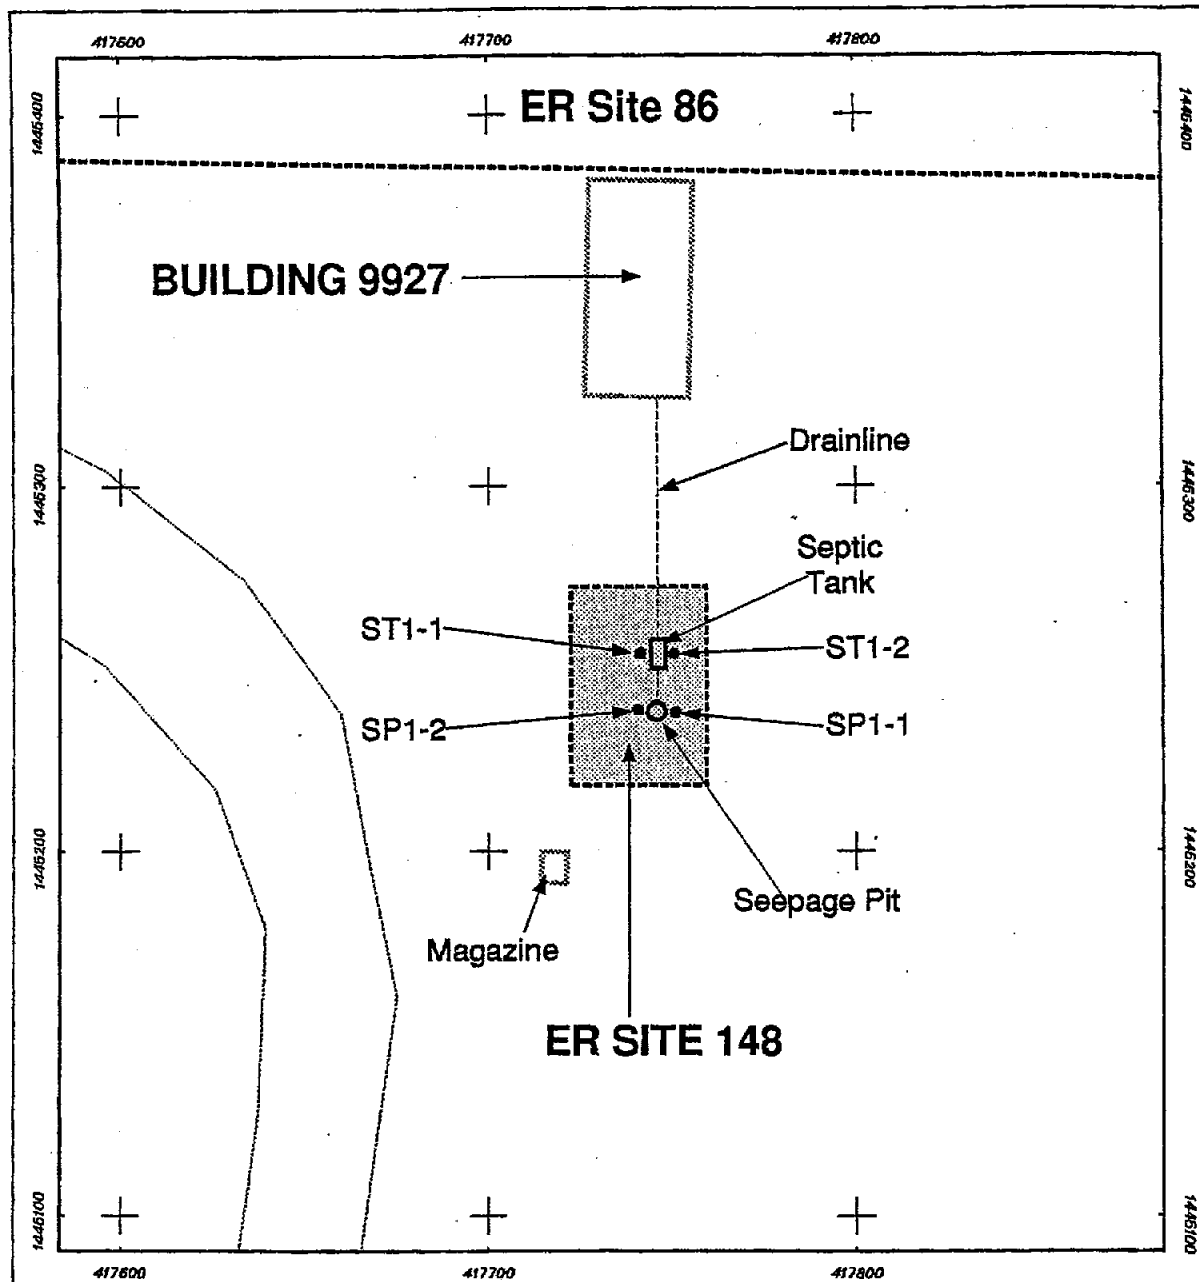

Legend

- Boring Location
- KAFB Roads
- Buildings
- - - - Drainline
- Septic Tank, Seepage Pit
- ▤ ER Site 148

Sandia National Laboratories, New Mexico
Environmental Geographic Information System

Tennessee Meridian Projection, New Mexico State Plane Coordinate System, Central Zone
NAD 83 North American Horizontal Datum, 1988 North American Vertical Datum

Unclassified



FIGURE 2
Site Map for ER Site 148
Sandia National Laboratories,
New Mexico

SITE -SPECIFIC COMMENTS**OU 1295, Septic Tanks and Drain Fields**

6. **Boreholes used to characterize ER sites consisting of septic tanks, drain fields, etc. must be located so as to intercept the mass of known or suspected contaminated matter in the Solid Waste Management Unit (SWMU). Boreholes must be drilled to allow sampling of waste matter and of environmental media beneath the SWMU to determine if a release has occurred. (Even then, contaminant concentrations may not reflect what lies at greater depth, due to percolation of waste.) (Best Professional Judgment)**

Response: The characterization approach for SNL/NM septic tanks, drainfields, seepage pits, drywells, and other effluent release points is described in the RCRA Facility Investigation Work Plan, with addenda, for Operable Unit (OU) 1295, Septic Tanks and Drainfields, approved by EPA and NMED on March 31, 1995 (SNL/NM March 1993, SNL/NM 1994, SNL/NM May 1995, and EPA March 1995). This NOD comment will not be addressed here. DOE/SNL believe that the response should be subject to a separate negotiating process.

Site 142, OU 1295, Building 9970 Septic System

7. **A schedule for the removal of the tank and sludges at this site must be provided. (Additional information needed for adequate review)**

Response: The top of the septic tank was excavated and opened, then the waste material was removed on December 14, 1995 (SNL/NM December 1995a). The tank was thoroughly steam-cleaned. Then on December 15, 1995, an inspector from NMED verified that the tank had been emptied in compliance with state guidelines (SNL/NM December 1995b). The tank was then backfilled with clean fill dirt and the site graded.

8. **Based on the detection of VOCs, SVOCs, metals and radionuclides in liquid and sludge from the septic tank, analysis of additional samples from below this structure is necessary. (Best Professional Judgment)**

Response: Refer to the response to Comment #6 concerning the sampling approach for the OU 1295 septic and drain system sites. This NFA proposal is based on the confirmatory soil samples connected at the site, not the concentrations of constituents in the septic tank.

9. **Based on the shallow depth of the saturated zone at this site, groundwater monitoring must be conducted, unless the results of sampling and analysis required in Comment No. 6 above indicate otherwise. (Best Professional Judgment)**

Response: Refer to the response to Comment #6 concerning the sampling approach for the OU 1295 septic and drain system sites. The intermittent occupancy of Building 9970 and the nature of the testing performed at this facility (SNL/NM March 1993) indicate that only low effluent rates were disposed to the system and do not suggest the use or release of significant volumes of constituents of concern (COCs). For these reasons, along with the lack of significant COC concentrations detected in the confirmatory soil samples collected around the release point, DOE/SNL do not believe that groundwater monitoring is necessary or justified at this site.

Site 143, OU 1295, Building 9972 Septic System

10. **Based on the detection of VOCs, SVOCs, barium, and tritium in liquid and sludge from the septic tank and organics in soil samples from the leachfield, analysis of additional samples from beneath these features is necessary. (Best Professional Judgment)**

Response: Refer to the response to Comment #6 concerning the sampling approach for the OU 1295 septic and drain system sites. In addition, referring to Figure 2 of the NFA proposal for Site 143, the sampling locations are almost directly on top of the drainlines in the leachfield. With the first sampling interval starting level with the bottom of the trenches excavated for the leachfield and the second interval starting 10 feet below the first, DOE/SNL believe that the sampling would have intercepted and identified any significant release of COCs from the septic system. The septic tank still contained liquid wastes when it was emptied, indicating that there were no leaks from the structure. If the tank had been leaking, the two sampling locations on either side of the tank would have intercepted any COCs released.

This NFA proposal is based on the confirmatory soil samples, not the concentrations of constituents in the septic tank. The organic constituents reported in the soil samples are clearly attributable to analytical laboratory contamination. Concerning the organic constituents found in the soil samples, EPA guidance (EPA 1988) specifically states that "No positive sample results should be reported unless the concentration of the compound in the sample exceeds 10 times the amount in any blank for the common contaminants listed below, or 5 times the amount for other compounds." The guidance also states that if positive

concentrations are reported and are below the Contract Required Quantitation Limit, the data should be qualified as non-detects. The list of five common laboratory contaminants listed by the EPA include MEK, acetone, and methylene chloride, which are the three compounds detected in Site 143 soil analyses. The soil trip blank shipped to the CLP laboratory with the site samples contains the highest concentrations of all the compounds reported, and all are common laboratory contaminants. All the concentrations of organics in site samples are below the laboratory quantitation limits for soil except for two samples with acetone, one at the reporting limit of 10 mg/kg, and the other at 11 mg/kg. In comparison, the trip blank contained acetone at 18 times the laboratory reporting limit (Table 2 of the NFA proposal for Site 143). DOE/SNL believe that the site was sufficiently characterized and that additional sampling is not justified. DOE/SNL will perform a risk assessment analysis to show that the COCs detected at the site do not pose any significant risk to human health or the environment.

11. **Based on the shallow depth of the saturated zone at this site, groundwater monitoring must be conducted unless the results of sampling and analysis recommended in Comment No. 8 above indicate otherwise. (Best Professional Judgment)**

Response: Refer to the response to Comment #6 concerning the sampling approach for the OU 1295 septic and drain system sites. The nature of the testing performed at this facility (SNL/NM March 1993) does not suggest the use or release of significant volumes of the COCs found in the septic tank. For this reason, along with the analytical results of confirmatory soil samples collected in the leachfield and next to the septic tank, DOE/SNL do not believe that groundwater monitoring is necessary or justified at this site.

Site 146, OU 1295, Building 9920 Drain System

12. **The only analyses available come from soil/sediment samples collected outside the 6-foot square area used for liquid waste disposal. Because VOCs, RCRA metals, and tritium were detected in these samples, analysis of additional samples from below the disposal area is necessary. (Best Professional Judgment)**

Response: Refer to the response to Comment #6 concerning the sampling approach for the OU 1295 septic and drain system sites. DOE/SNL believe that soil samples were collected from below the disposal area.

As stated in Section 3.7 of the NFA proposal for Site 146, DOE/SNL believe that the organic constituents detected in the soil samples collected are due to

laboratory contamination rather than residual concentrations from a significant release at the site. Refer to the response to Comment #10 for EPA guidance on evaluating data to identify laboratory-introduced contamination. The volatile organic compounds (VOCs) detected in the soil trip blank (Table 2 of the NFA proposal) are an indicator of contamination introduced during transit or most likely in the analytical laboratory. The trip blank exhibits the highest concentrations and the largest number of VOCs found in the site soil samples.

The RCRA metals detected in the soil samples (Table 3 of the NFA proposal) were all less than the 95th percentile for background metals concentrations in soil at SNL/NM (TT March 1996). The highest concentration of each metal constituent detected at the site is compared to the latest available maximum background values in Table III-1 below. In addition, the lowest sampling interval started at 14 feet below ground surface (bgs); samples from this deep interval contained metals concentrations that did not vary significantly from those collected in the interval starting at 4 feet bgs, indicating that even if metal COCs were released from the facility, their downward migration in the soil column was insignificant during the approximately 22 years of facility operation.

Table III-1. Comparison of Soil Concentrations and Background Values for Site 146.

Constituent	Highest Concentration	SNL/NM Background
As	2.8 ppm	7 ppm
Ba	185 ppm	214 ppm
Cr	6.8 ppm	15.9 ppm
Pb	4.8 ppm	11.8 ppm

The highest tritium activity detected was 250 picocuries per liter (pCi/L) in soil moisture, which is at the method detection limit for the analytical laboratory. While no background activity has been estimated for tritium in soil at SNL/NM, the activity of tritium in soil moisture can be approximated by samples taken by the EPA of rainwater throughout the United States (EPA 1993). Assuming that the atmospheric tritium concentration in rainwater is in equilibrium with tritium in soil moisture, the background range for soil is 100 to 400 pCi/L, which brackets the highest tritium concentration detected at Site 146. DOE/SNL believe that the site was sufficiently characterized and that additional sampling is not justified. SNL/NM will perform a risk assessment analysis to show that the COCs detected at the site do not pose any significant risk to human health or the environment.

Site 148, OU 1295, Building 9927 Septic System

13. **The only analyses available come from soil/sediment samples outside the area used for liquid waste disposal here. Because VOCs and potentially elevated levels of RCRA metals were detected in these samples, analysis of additional samples from directly below the disposal area is necessary. (Best Professional Judgment)**

Response: Refer to the response to Comment #6 concerning the sampling approach for the OU 1295 septic and drain system sites.

From Table 2 in the NFA proposal for Site 148, organic compounds detected in the soil samples are again clearly the result of laboratory contamination. Refer to the response to Comment #10 for EPA guidance on evaluating data to identify laboratory-introduced contamination. The two VOC compounds detected above the laboratory reporting limit in the soil trip blank were not detected in the site samples. This strongly suggests that they were introduced in transit, or more likely in the laboratory once the trip blank container was opened. The concentrations reported in the site samples for toluene and methylene chloride were all below the laboratory reporting limit, and these compounds were also present in the trip blank.

From Table 3 in the NFA proposal for Site 148, the concentrations of RCRA metals reported in the site samples were all below the SNL/NM 95th percentile for soils except for arsenic from one sampling interval (IT March 1996). The highest concentration of each metal constituent is compared to the latest available maximum background values in Table IV-1 below. One arsenic value is slightly above the maximum background value for SNL/NM. However, the concentration is still within the range of background values for arsenic in subsurface SNL/NM soils of 0.033 to 17.0 milligrams per kilogram (mg/kg) (IT March 1996). The concentration is also well below the proposed Subpart S Action Level for soil of 20 mg/kg. DOE/SNL believe that the site was sufficiently characterized and that additional sampling is not justified. DOE/SNL will perform a risk assessment analysis to show that the COCs detected at the site do not pose any significant risk to human health or the environment.

Table IV-1. Comparison of Soil Concentrations and Background Values for Site 148.

Constituent	Highest Concentration	SNL/NM Background
As	8.5 ppm	7 ppm
Ba	111 ppm	214 ppm
Cr	5.6 ppm	12.8 ppm
Pb	9.7 ppm	11.8 ppm
Ag	0.78 ppm	<1 ppm

References (for OU 1295)

IT Corporation (IT), March 1996, "Background Concentrations of Constituents of Concern to the Sandia National Laboratories/New Mexico Environmental Restoration Project and the Kirtland Air Force Base Installation Restoration Program," IT Corporation, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), March 1993, "Septic Tanks and Drainfields (ADS-1295) RCRA Facility Investigation Work Plan", Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), 1994, "Comment Responses to USEPA Notice of Deficiency November 1994", Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), May 1995, Letter with attachments dated May 11, 1995 from SNL/NM (Bob Galloway) to EPA (Nancy Morlock) describing number of and spacing between boreholes used to characterize each of the OU 1295 drainfields in late 1994 and early 1995. Maps showing borehole locations in each OU 1295 drainfield were also included with the transmittal.

Sandia National Laboratories/New Mexico (SNL/NM), December 1995a, Field Log #0147, Pages 87 through 91, 12/14/95, Field notes for the ER Site 142 septage waste removal and tank cleaning operation.

Sandia National Laboratories/New Mexico (SNL/NM), December 1995b, Field Log #0147, Book #2, Pages 93 through 97, 12/15/95, Field notes for the ER Site 142 empty septic tank inspection by NMED.

U.S. Environmental Protection Agency (EPA), February 1988, "Laboratory Data Validation Functional Guidelines for Evaluating Organics Analyses", prepared for the Hazardous Site Evaluation Division U.S. Environmental Protection Agency, February 1, 1988.

U.S. Environmental Protection Agency (EPA), October 1993, "Environmental Radiation Data Report 73, January-March 1993", Report Number EPA 402-R-93-092, National Air and Radiation Environmental Laboratory, Montgomery, Alabama.

U.S. Environmental Protection Agency (EPA), March 1995, Letter dated March 31, 1995 from EPA (Allyn M. Davis) to DOE/AL (Kathleen A. Carlson) approving the March 1993 OU 1295 RFI Work Plan and follow-up addenda, and specifying a few additional conditions and requirements.

NOD



National Nuclear Security Administration
 Sandia Site Office
 P.O. Box 5400
 Albuquerque, New Mexico 87185-5400

ESFISFC



MAR 23 2005

cc: D. H. ...
 Carolyn D.
 MS

CERTIFIED MAIL – RETURN RECEIPT REQUESTED

Mr. James Bearzi, Chief
 Hazardous Waste Bureau
 New Mexico Environment Department
 2905 Rodeo Park Road East, Building 1
 Santa Fe, NM 87505

Dear Mr. Bearzi:

On behalf of the Department of Energy (DOE) and Sandia Corporation, DOE is submitting the enclosed Solid Waste Management Unit (SWMU) Assessment Reports and Proposals for Corrective Action Complete (CAC) for Drain and Septic Systems (DSS) Sites 1081 and 1092. DOE is also submitting responses to the Request for Supplemental Information (RSI) for SWMUs 137, 146, 148, 152, and 153 at Sandia National Laboratories, New Mexico, EPA ID No. NM5890110518. These documents are compiled as DSS Round 8 and CAC (formerly No further Action [NFA]) Batch 26.

This submittal includes descriptions of the site characterization work and risk assessments for DSS Area of Concern (AOC) Sites 1081 and 1092, and SWMUs 137, 146, 148, 152, and 153. The risk assessments conclude that for these seven sites: (1) there is no significant risk to human health under both the industrial and residential land-use scenarios; and (2) that there are no ecological risks associated with these sites.

Based on the information provided, DOE and Sandia are requesting a determination of Corrective Action Complete without controls for these DSS sites.

If you have any questions, please contact John Gould at (505) 845-6089.

Sincerely,

INFORMATION COPY

SHEARS #340823

Patty Wagner
 Manager

Enclosure

MAR 23 2005

Mr. J. Bearzi


(2)

cc w/ enclosure:

L. King, EPA, Region 6 (Via Certified Mail)
W. Moats, NMED-HWB (Via Certified Mail)
M. Gardipe, NNSA/SC/ERD
D. Pepe, NMED-OB (Santa Fe)
J. Volkerding, NMED-OB

cc w/o enclosure.:

F. Nimick, SNL, MS 1089
D. Stockham, SNL, MS 1087
B. Langkopf, SNL, MS 1087
M. Sanders, SNL, MS 1087
R. Methvin, SNL MS 1087
J. Pavletich, SNL MS 1087
A. Villareal, SNL, MS 1035
A. Blumberg, SNL, MS 0141
M. J. Davis, SNL, MS 1089
ESHSEC Records Center, MS 1087

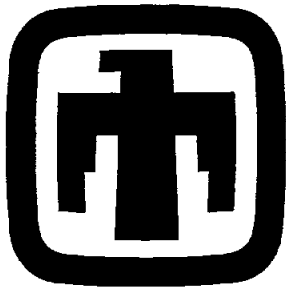

Sandia National Laboratories/New Mexico
Environmental Restoration Project

**NOTICE OF DEFICIENCY
RESPONSE AND PROPOSAL FOR
CORRECTIVE ACTION COMPLETE FOR
DRAIN AND SEPTIC SYSTEMS SWMU 148,
BUILDING 9927 SEPTIC SYSTEM,
COYOTE TEST FIELD**

March 2005



United States Department of Energy
Sandia Site Office

TABLE OF CONTENTS

LIST OF FIGURES	iii
LIST OF TABLES.....	v
LIST OF ANNEXES	vii
ACRONYMS AND ABBREVIATIONS	ix
1.0 INTRODUCTION.....	1-1
1.1 Investigation History.....	1-1
1.2 Remaining Requirements for DSS SWMU 148	1-2
2.0 RISK ASSESSMENT REPORT FOR DSS SWMU 148	2-1
2.1 Site Description and History	2-1
2.2 Data Quality Objectives.....	2-2
2.3 Determination of Nature, Rate, and Extent of Contamination	2-3
2.3.1 Introduction	2-3
2.3.2 Nature of Contamination.....	2-5
2.3.3 Rate of Contaminant Migration	2-6
2.3.4 Extent of Contamination	2-6
2.4 Comparison of COCs to Background Levels	2-6
2.5 Fate and Transport	2-9
2.6 Human Health Risk Assessment.....	2-10
2.6.1 Introduction	2-10
2.6.2 Step 1. Site Data	2-11
2.6.3 Step 2. Pathway Identification	2-11
2.6.4 Step 3. Background Screening Procedure.....	2-11
2.6.5 Step 4. Identification of Toxicological Parameters	2-15
2.6.6 Step 5. Exposure Assessment and Risk Characterization	2-17
2.6.7 Step 6. Comparison of Risk Values to Numerical Guidelines.....	2-19
2.6.8 Step 7. Uncertainty Discussion.....	2-20
2.6.9 Summary.....	2-21
2.7 Ecological Risk Assessment	2-23
2.7.1 Introduction	2-23
2.7.2 Scoping Assessment.....	2-23
3.0 RECOMMENDATION FOR CORRECTIVE ACTION COMPLETE WITHOUT CONTROLS DETERMINATION.....	3-1
3.1 Rationale	3-1
3.2 Criterion	3-1
4.0 REFERENCES.....	4-1

This page intentionally left blank.

LIST OF FIGURES

Figure

1.2-1	Location Map of Drain and Septic Systems (DSS) SWMU 148, Bldg. 9927 Septic System, Coyote Test Field	1-3
1.2-2	Site Map of Drain and Septic Systems (DSS) SWMU 148, Bldg. 9927 Septic System, Coyote Test Field	1-5
2.6.3-1	Conceptual Site Model Flow Diagram for DSS SWMU 148, Building 9927 Septic System.....	2-13

This page intentionally left blank.

LIST OF TABLES

Table

2.2-1	Summary of Sampling Performed to Meet DQOs.....	2-2
2.2-2	Number of Confirmatory Soil and QA/QC Samples Collected from DSS SWMU 148	2-4
2.2-3	Summary of Data Quality Requirements for DSS SWMU 148.....	2-5
2.4-1	Nonradiological COCs for Human Health Risk Assessment at DSS SWMU 148 with Comparison to the Associated SNL/NM Background Screening Value, BCF, and Log K_{ow}	2-7
2.4-2	Radiological COCs for Human Health Risk Assessment at DSS SWMU 148 with Comparison to the Associated SNL/NM Background Screening Value and BCF.....	2-8
2.5-1	Summary of Fate and Transport at DSS SWMU 148	2-10
2.6.5-1	Toxicological Parameter Values for DSS SWMU 148 Nonradiological COCs.....	2-16
2.6.5-2	Radiological Toxicological Parameter Values for DSS SWMU 148 COCs Obtained from RESRAD Risk Coefficients	2-17
2.6.6-1	Risk Assessment Values for DSS SWMU 148 Nonradiological COCs	2-18
2.6.6-2	Risk Assessment Values for DSS SWMU 148 Nonradiological Background Constituents	2-18
2.6.9-1	Summation of Incremental Nonradiological and Radiological Risks from DSS SWMU 148, Building 9927 Septic System Carcinogens.....	2-22

This page intentionally left blank.

LIST OF ANNEXES

Annex

- A DSS SWMU 148 Exposure Pathway Discussion for Chemical and Radionuclide Contamination

This page intentionally left blank.

ACRONYMS AND ABBREVIATIONS

AOC	Area of Concern
AOP	Administrative Operating Procedure
bgs	below ground surface
CAC	Corrective Action Complete
COC	constituent of concern
COPEC	constituent of potential ecological concern
CTF	Coyote Test Field
DCF	dose conversion factor
DOE	U.S. Department of Energy
DQO	data quality objective
DSS	Drain and Septic Systems
EPA	U.S. Environmental Protection Agency
ER	Environmental Restoration
HEAST	Health Effects Assessment Summary Tables
HI	hazard index
HRMB	Hazardous and Radioactive Materials Bureau
IRIS	Integrated Risk Information System
KAFB	Kirtland Air Force Base
kg	kilogram(s)
MDA	minimum detectable activity
mg	milligram(s)
mrem	millirem
NFA	no further action
NMED	New Mexico Environment Department
NOD	Notice of Deficiency
OSWER	Office of Solid Waste and Emergency Response
OU	Operable Unit
QA	quality assurance
QC	quality control
QES	Quanterra Environmental Services
RAGS	Risk Assessment Guidance for Superfund
RCRA	Resource Conservation and Recovery Act
RFI	RCRA Facility Investigation
RME	reasonable maximum exposure
RPSD	Radiation Protection Sample Diagnostics
SAP	Sampling and Analysis Plan
SNL/NM	Sandia National Laboratories/New Mexico
SVOC	semivolatile organic compound
SWMU	Solid Waste Management Unit
TEDE	total effective dose equivalent
TNT	trinitrotoluene
TOP	Technical Operating Procedure
VOC	volatile organic compound
yr	year

This page intentionally left blank.

1.0 INTRODUCTION

1.1 Investigation History

Solid Waste Management Unit (SWMU) 148 was originally one of 23 SWMUs designated as Operable Unit (OU) 1295 at Sandia National Laboratories/New Mexico (SNL/NM). This number was reduced to 22 when a petition for Administrative No Further Action (NFA) was approved by the New Mexico Environment Department (NMED) for SWMU 139 in 1995.

In August 1995, an NFA proposal was submitted to the NMED for SWMU 148 (SNL/NM August 1995). In April 1997, the NMED Hazardous and Radioactive Materials Bureau (HRMB) responded with a Notice of Deficiency (NOD) stating that because volatile organic compounds (VOCs) and potentially elevated levels of Resource Conservation and Recovery Act (RCRA) metals were detected in the site soil samples, additional samples from directly beneath the disposal area would be necessary (NMED April 1997).

SNL/NM responded to the NOD in June 1997 stating that SNL/NM believed the soil samples were collected from beneath the disposal area, that the VOC detections were the result of laboratory contamination and, with the exception of one arsenic value, the RCRA metal concentrations were all below the SNL/NM 95th percentile for soils. SNL/NM stated that the site was sufficiently characterized and further agreed to perform a risk assessment to show that the constituents of concern (COCs) do not pose any significant risk to human health or the environment (SNL/NM June 1997).

At that time, negotiations were being conducted to define a technical and decision-making approach to complete environmental assessment and characterization work at the 22 SWMUs and at 61 other Drain and Septic Systems (DSS) Area of Concern (AOC) sites at SNL/NM. A Sampling and Analysis Plan (SAP) (SNL/NM October 1999) was written that documented investigations planned for completion at all OU 1295 SWMUs and AOC sites. The plan was approved by the NMED in January 2000 (Bearzi January 2000). Technical details for soil sampling procedures, soil sample locations, laboratory analytical methods, and passive soil-vapor sampling requirements at these sites were specified in a follow-up Field Implementation Plan (SNL/NM November 2001), which was also approved by the NMED in February 2002 (Moats February 2002).


Because of the physical similarity of the SWMUs and the AOC sites, and because the same characterization procedures were used for both, the 22 SWMUs were combined into the AOC site investigation procedures outlined in the SAP (SNL/NM October 1999). Shallow subsurface soil and soil-vapor sampling investigations were completed at the SWMUs and AOC sites by November 2002. The data were evaluated and the candidate SWMUs and AOC sites were ranked in order to select sites for deep soil-vapor well installation and sampling. DSS SWMU 148 was not selected for deep soil-vapor well sampling or any other additional work. No additional soil sampling was performed at SWMU 148 after 1994.

1.2 Remaining Requirements for DSS SWMU 148

The following remaining requirement from the April 1997 NOD for DSS SWMU 148 is addressed in this NOD response:

- Submit a revised risk assessment incorporating all available soil data


An updated general location map (Figure 1.2-1), and an updated site location map showing the soil sampling locations at this site (Figure 1.2-2) are also provided. Because the detailed site description and operational history were provided in the initial NFA proposal (SNL/NM August 1995), the information is only summarized in the risk assessment presented in Chapter 2.0.

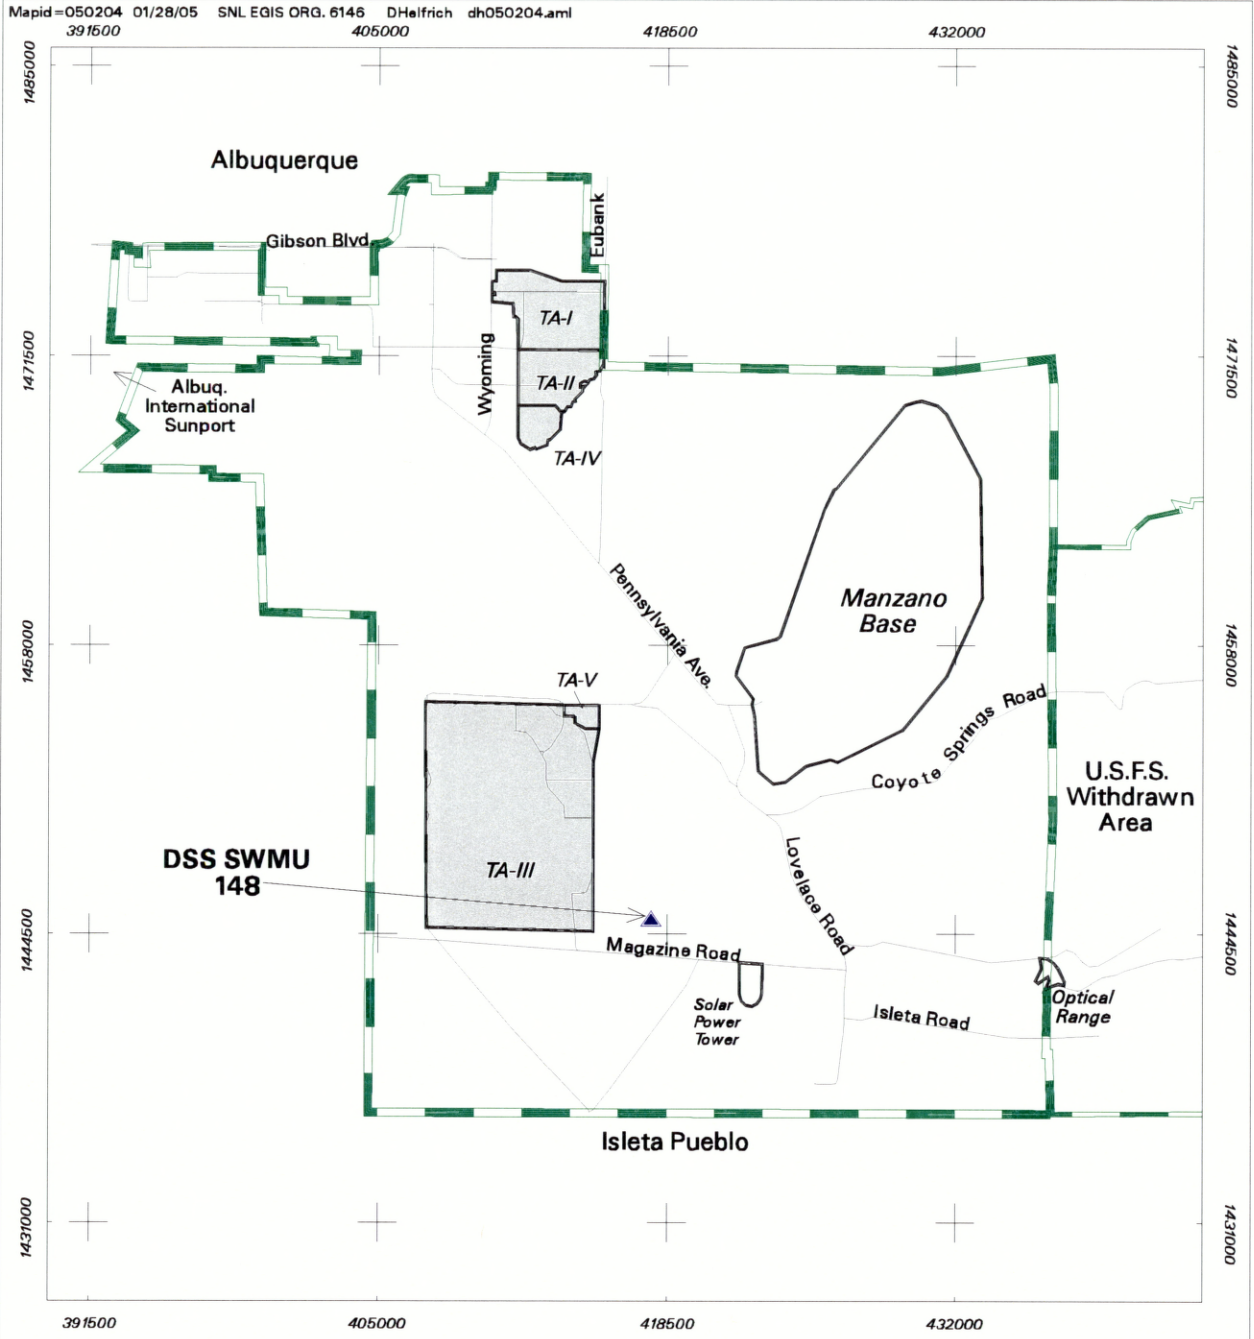


Legend

-  DSS SWMU 148
-  Major Road
-  KAFB Boundary
-  USFS Withdrawn Area Boundary
-  SNL Technical Area

Figure 1.2-1
Location Map of Drain and Septic
Systems (DSS) SWMU 148,
Bldg. 9927 Septic System,
Coyote Test Field

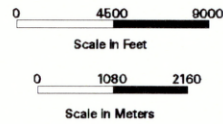


Sandia National Laboratories, New Mexico
 Environmental Geographic Information System

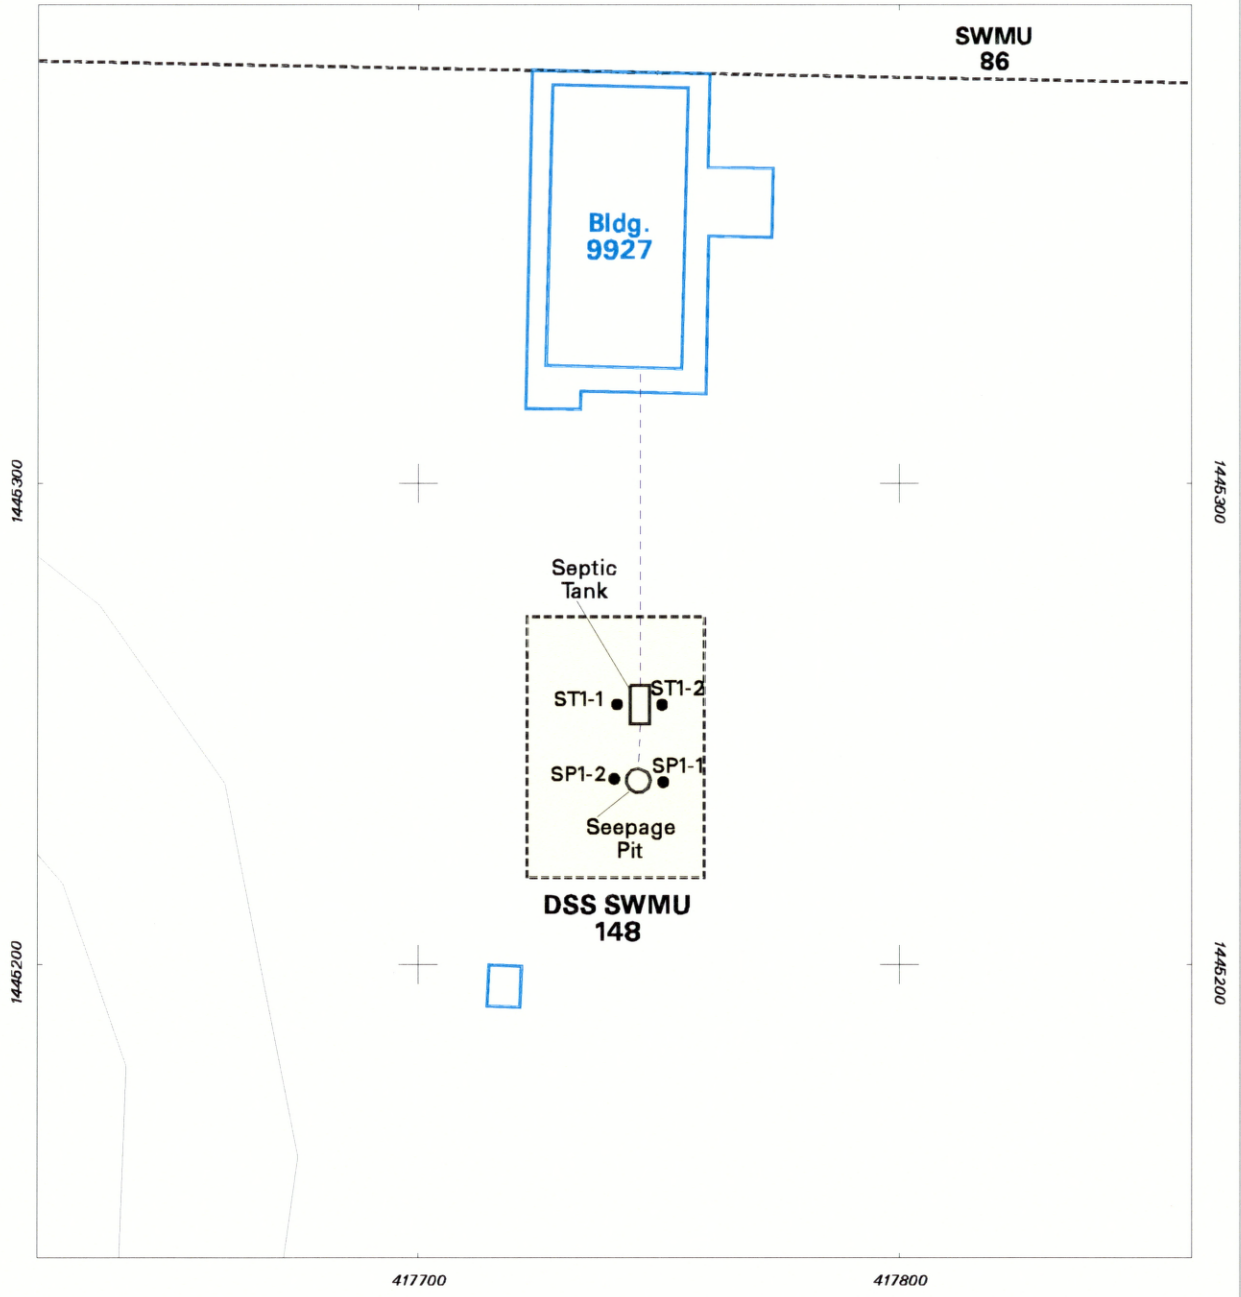

Legend

- Soil Boring Location
- Unpaved Road
- Septic Tank, Seepage Pit
- - - Drain line
- - - Other SWMU Boundary
- Building / Structure
- - - DSS SWMU 148

Figure 1.2-2
Site Map of Drain and Septic Systems (DSS) SWMU 148,
Bldg. 9927 Septic System,
Coyote Test Field

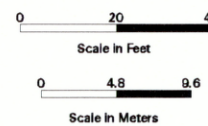

Sandia National Laboratories, New Mexico
Environmental Geographic Information System

2.0 RISK ASSESSMENT REPORT FOR DSS SWMU 148

2.1 Site Description and History

DSS SWMU 148, the Building 9927 Septic System at SNL/NM, is located in the Coyote Test Field (CTF) area east of SNL/NM Technical Area III on federally owned land controlled by Kirtland Air Force Base (KAFB) and permitted to the U.S. Department of Energy (DOE). The abandoned septic system consisted of a 750-gallon septic tank connected to a single seepage pit. Available information indicates that Building 9927 was constructed in 1962 (SNL/NM August 1995), and it is assumed that the septic system was also constructed at that time. By 1991, the septic system discharges were routed to the City of Albuquerque sanitary sewer system (Jones June 1991). The old septic system line was disconnected and capped, and the system was abandoned in place concurrent with this change (Romero September 2003). The empty and decontaminated septic tank was inspected by the NMED on December 15, 1995, and a closure form was signed (SNL/NM January 1996). The septic tank was then backfilled with clean, native soil from the area in late 1995 or early 1996. Building 9927 was demolished in Fiscal Year 2002. A site visit on July 22, 2004, confirmed that the seepage pit was still intact. It is anticipated that the seepage pit will be demolished and backfilled in place with clean soil in mid-2005.

Environmental concern about DSS SWMU 148 is based upon the potential for the release of COCs in effluent discharged to the environment via the septic system seepage pit at this site. Because operational records were not available, the investigation was planned to be consistent with other DSS site investigations and to sample for possible COCs that may have been released during facility operations.

The ground surface in the vicinity of the site is flat or slopes slightly to the west. The closest drainage lies approximately 600 feet south of the site and terminates in the playa just west of KAFB. No springs or perennial surface-water bodies are located within approximately 2 miles of the site. Average annual rainfall in the SNL/NM and KAFB area, as measured at Albuquerque International Sunport, is 8.1 inches (NOAA 1990). Surface-water runoff in the vicinity of the site is minor because the surface is nearly flat. Infiltration of precipitation is almost nonexistent as virtually all of the moisture subsequently undergoes evapotranspiration. The estimates of evapotranspiration for the KAFB area range from 95 to 99 percent of the annual rainfall (SNL/NM March 1996). Most of the area immediately surrounding DSS SWMU 148 is unpaved with some native vegetation, and no storm sewers are used to direct surface water away from the site.

DSS SWMU 148 lies at an average elevation of approximately 5,473 feet above mean sea level. The groundwater beneath the site occurs in unconfined conditions in essentially unconsolidated silts, sands, and gravels. Groundwater is approximately 355 feet below ground surface (bgs). Groundwater flow is thought to be to the northwest in this area (SNL/NM April 2004). The nearest groundwater monitoring well (CTF-MW3) is approximately 0.4 miles northeast of the site in the central part of the CTF. The nearest production wells are KAFB-4 and KAFB-11, which are both located approximately 4.8 miles northwest and north of the site, respectively.

2.2 Data Quality Objectives

Soil sampling was conducted in 1994 in accordance with the rationale and procedures described in the approved "Septic Tanks and Drainfields (ADS [Activity Data Sheet]-1295) RCRA Facility Investigation [RFI] Work Plan" (SNL/NM March 1993), the SAP for the RFI of the septic tanks and drainfields (IT March 1994), and subsequent site-specific addenda to the Work Plan and SAP based upon discussions with the NMED/HRMB.

The sampling conducted at this site was designed to:

- Determine whether hazardous waste or hazardous constituents were released at the site.
- Characterize the nature and extent of any releases.
- Provide analytical data of sufficient quality to support risk assessments.

Table 2.2-1 summarizes the rationale for determining the sampling locations at this site. The source of potential COCs at DSS SWMU 148 was effluent discharged to the environment from the seepage pit at this site.

Table 2.2-1
Summary of Sampling Performed to Meet DQOs

DSS SWMU 148 Sampling Area(s)	Potential COC Source	Number of Sampling Locations	Sample Density (samples/acre)	Sampling Location Rationale
Soil adjacent to, and beneath, the septic tank	Effluent discharged to the environment from the septic tank	2	NA	Evaluate potential COC releases to the environment from effluent discharged from septic tank
Soil adjacent to, and beneath, the seepage pit	Effluent discharged to the environment from the seepage pit	2	NA	Evaluate potential COC releases to the environment from effluent discharged from the seepage pit

COC = Constituent of concern.
DQO = Data Quality Objective.
DSS = Drain and Septic Systems.
NA = Not applicable.
SWMU = Solid Waste Management Unit.

In 1994, soil samples were collected using a Geoprobe™ at DSS SWMU 148 from boreholes drilled adjacent to the septic tank and seepage pit. The septic tank borehole sampling intervals started at 12 feet bgs, a depth equal to the base of the septic tank. The seepage pit borehole sampling intervals started at 14 feet bgs, a depth equal to the base of the seepage pit, and at 24 feet bgs. Soil samples were collected using procedures described in the RFI Work Plan

(SNL/NM March 1993) and the RFI SAP (IT March 1994). Table 2.2-2 summarizes the types of confirmatory and quality assurance (QA)/quality control (QC) samples collected at the site to meet the data quality objectives (DQOs) and the laboratories that performed the analyses.

The DSS SWMU 148 soil samples were analyzed for VOCs, semivolatile organic compounds (SVOCs), RCRA metals plus beryllium, hexavalent chromium, cyanide, isotopic uranium, tritium, and radionuclides by gamma spectroscopy. The samples were analyzed by an off-site laboratory (Quanterra Environmental Services [QES]) and the on-site Radiation Protection Sample Diagnostics (RPSD) Laboratory. Samples were also screened for trinitrotoluene (TNT) at the on-site SNL/NM Environmental Restoration Chemistry Laboratory. No TNT was detected and these TNT samples are not used in the risk assessment analysis. Table 2.2-3 summarizes the analytical methods and the data quality requirements.

QA/QC samples were collected during the sampling effort according to the Environmental Restoration (ER) Project Quality Assurance Project Plan. The QA/QC samples consisted of one trip blank (for VOCs only) and one set of field duplicate samples (for VOCs, SVOCs, RCRA metals plus beryllium, hexavalent chromium, cyanide, and isotopic uranium). No significant QA/QC problems were identified in the QA/QC samples.

All of the DSS SWMU 148 soil sample results were verified/validated by SNL/NM. The off-site laboratory results from QES were reviewed according to "Verification and Validation of Chemical and Radiochemical Data," Technical Operating Procedure (TOP) 94-03, Rev. 0 (SNL/NM July 1994) or earlier ER Project Administrative Operating Procedures (AOPs). The gamma spectroscopy data from the RPSD Laboratory were reviewed according to "Laboratory Data Review Guidelines," Procedure No. RPSD-02-11, Issue No. 2 (SNL/NM July 1996) or an earlier procedure. The reviews confirmed that the analytical data are defensible and therefore acceptable for use in the NOD response. Therefore, the DQOs have been fulfilled.

2.3 Determination of Nature, Rate, and Extent of Contamination

2.3.1 Introduction

The determination of the nature, migration rate, and extent of contamination at DSS SWMU 148 is based upon an initial conceptual model validated with confirmatory sampling at the site. The initial conceptual model was developed from archival site research, site inspections, soil sampling, and passive soil-vapor sampling. The DQOs contained in the RFI Work Plan (SNL/NM March 1993), the RFI SAP (IT March 1994), and subsequent negotiations with the NMED/HRMB identified the sample locations, sample density, sample depth, and analytical requirements. The sample data were subsequently used to develop the final conceptual site model for DSS SWMU 148, which is presented in Section 2.6. The quality of the data specifically used to determine the nature, migration rate, and extent of contamination is described in the following sections.

Table 2.2-2
 Number of Confirmatory Soil and QA/QC Samples Collected from DSS SWMU 148

Sample Type	VOCs	SVOCs	RCRA Metals plus Beryllium	Hexavalent Chromium	Total Cyanide	Isotopic Uranium	Tritium	Gamma Spectroscopy Radionuclides
Confirmatory	6	6	6	6	6	6	2	2
Duplicates	1	1	1	1	1	1	0	0
EBs and TBs ^a	1	0	0	0	0	0	0	0
Total Samples	8	7	7	7	7	7	2	2
Analytical Laboratory	QES	QES	QES	QES	QES	QES	QES	RPSD

^aTBs for VOCs only.

DSS = Drain and Septic Systems.

EB = Equipment blank.

QA/QC = Quality assurance/quality control.

QES = Quanterra Environmental Services.

RCRA = Resource Conservation and Recovery Act.

RPSD = Radiation Protection Sample Diagnostics Laboratory.

SVOC = Semivolatile organic compound.

SWMU = Solid Waste Management Unit.

TB = Trip blank.

VOC = Volatile organic compound.

Table 2.2-3
Summary of Data Quality Requirements for DSS SWMU 148

Analytical Method ^a	Data Quality Level	QES	RPSD
VOCs EPA Method 8260	Defensible	6	None
SVOCs EPA Method 8270	Defensible	6	None
RCRA Metals plus Beryllium EPA Method 6000/7000	Defensible	6	None
Hexavalent Chromium EPA Method 7196A	Defensible	6	None
Total Cyanide EPA Method 9012A	Defensible	6	None
Isotopic Uranium HASL-300	Defensible	6	None
Tritium EPA Method 906.0 or equivalent	Defensible	2	None
Gamma Spectroscopy Radionuclides EPA Method 901.1	Defensible	None	2

Note: The number of samples does not include composite samples or QA/QC samples such as duplicates, trip blanks, and equipment blanks.

^aEPA November 1986.

- DSS = Drain and Septic Systems.
- EPA = U.S. Environmental Protection Agency.
- HASL = Health and Safety Laboratory.
- QA/QC = Quality assurance/quality control.
- QES = Quanterra Environmental Services.
- RCRA = Resource Conservation and Recovery Act.
- RPSD = Radiation Protection Sample Diagnostics Laboratory.
- SVOC = Semivolatile organic compound.
- SWMU = Solid Waste Management Unit.
- VOC = Volatile organic compound.

2.3.2 Nature of Contamination

Both the nature of contamination and the potential for the degradation of COCs at DSS SWMU 148 were evaluated using laboratory analyses of the soil samples. The analytical requirements included analyses for VOCs, SVOCs, RCRA metals plus beryllium, hexavalent chromium, cyanide, isotopic uranium, tritium, and radionuclides by gamma spectroscopy. The analytes and methods listed in Tables 2.2-2 and 2.2-3 are appropriate to characterize the COCs and any potential degradation products at DSS SWMU 148.

2.3.3 Rate of Contaminant Migration

The septic system at DSS SWMU 148 was deactivated by 1991 when Building 9927 was connected to an extension of the City of Albuquerque sanitary sewer system. The migration rate of COCs that may have been introduced into the subsurface via the septic system at this site was therefore dependent upon the volume of aqueous effluent discharged to the environment from this system when it was operational. Any migration of COCs from this site after use of the septic system was discontinued has been predominantly dependent upon precipitation. However, it is highly unlikely that sufficient precipitation has fallen on the site to reach the depth at which COCs may have been discharged to the subsurface from this system. Analytical data generated from the soil sampling conducted at the site are adequate to characterize the rate of COC migration at DSS SWMU 148.

2.3.4 Extent of Contamination

Subsurface soil samples were collected at DSS SWMU 148 from boreholes drilled at four locations beneath the effluent release points and areas (septic tank and seepage pit) at the site to assess whether releases of effluent from the septic system caused any environmental contamination.

The soil samples were collected at sampling depths starting at 12 feet bgs adjacent to the septic tank and at 14 and 24 feet bgs adjacent to the seepage pit. Sampling intervals started at the depths at which effluent discharged from the septic tank and seepage pit would have entered the subsurface environment at the site. This sampling procedure was required by NMED regulators and has been used at numerous DSS-type sites at SNL/NM. The soil samples are considered to be representative of the soil potentially contaminated with the COCs at this site and are sufficient to determine the vertical extent, if any, of COCs.

2.4 Comparison of COCs to Background Levels

Site history and characterization activities are used to identify potential COCs. This DSS SWMU 148 NOD response and request for a determination of Corrective Action Complete (CAC) without controls describes the identification of COCs and the sampling that was conducted in order to determine the concentration levels of those COCs across the site. Generally, COCs evaluated in this risk assessment include all detected organic and all inorganic and radiological COCs for which samples were analyzed. When the detection limit of an organic compound is too high (i.e., could possibly cause an adverse effect to human health or the environment), the compound is retained. Nondetected organic compounds not included in this assessment were determined to have detection limits low enough to ensure protection of human health and the environment. In order to provide conservatism in this risk assessment, the calculation uses only the maximum concentration value of each COC found for the entire site. The SNL/NM maximum background concentration (Dinwiddie September 1997) was selected to provide the background screen listed in Tables 2.4-1 and 2.4-2.

Nonradiological inorganic constituents that are essential nutrients, such as iron, magnesium, calcium, potassium, and sodium, are not included in this risk assessment (EPA 1989). Both radiological and nonradiological COCs are evaluated. The nonradiological COCs included in this risk assessment consist of both inorganic and organic compounds.

Table 2.4-1
 Nonradiological COCs for Human Health Risk Assessment at DSS SWMU 148 with
 Comparison to the Associated SNL/NM Background Screening Value, BCF, and Log K_{ow}

COC	Maximum Concentration (All Samples) (mg/kg)	SNL/NM Background Concentration (mg/kg) ^a	Is Maximum COC Concentration Less Than or Equal to the Applicable SNL/NM Background Screening Value?	BCF (maximum aquatic)	Log K _{ow} (for organic COCs)	Bioaccumulator? ^b (BCF>40, Log K _{ow} >4)
Inorganic						
Arsenic	8.5	4.4	No	44 ^c	--	Yes
Barium	111	214	Yes	170 ^d	--	Yes
Beryllium	0.35	0.65	Yes	19 ^c	--	No
Cadmium	0.25 ^e	0.9	Yes	64 ^c	--	Yes
Chromium, total	5.6	15.9	Yes	16 ^c	--	No
Chromium VI	0.025 ^e	1	Yes	16 ^c	--	No
Cyanide	0.25 ^e	NC	Unknown	NC	--	Unknown
Lead	9.7	11.8	Yes	49 ^c	--	Yes
Mercury	0.05 ^e	<0.1	Yes	5,500 ^c	--	Yes
Selenium	0.25 ^e	<1	Yes	800 ^f	--	Yes
Silver	0.78 J	<1	Yes	0.5 ^c	--	No
Organic						
Methylene Chloride	0.0025 ^e	NA	NA	5 ^g	1.25 ^g	No
Toluene	0.0025 J	NA	NA	10.7 ^c	2.69 ^c	No

Note: **Bold** indicates the COCs that exceed the background screening values and/or are bioaccumulators.

^aDinwiddie September 1997, Southwest Area Supergroup.

^bNMED March 1998.

^cYanicak March 1997.

^dNeumann 1976.

^eNondetected concentration (i.e., one-half the maximum detected limit is greater than the maximum detected concentration).

^fCallahan et al. 1979.

^gHoward 1990.

BCF = Bioconcentration factor.

COC = Constituent of concern.

DSS = Drain and Septic Systems.

J = Estimated concentration.

K_{ow} = Octanol-water partition coefficient.

Log = Logarithm (base 10).

mg/kg = Milligram(s) per kilogram.

NA = Not applicable.

NC = Not calculated.

NMED = New Mexico Environment Department.

SNL/NM = Sandia National Laboratories/New Mexico.

SWMU = Solid Waste Management Unit.

-- = Information not available.

Table 2.4-2
Radiological COCs for Human Health Risk Assessment at DSS SWMU 148 with
Comparison to the Associated SNL/NM Background Screening Value and BCF

COC	Maximum Activity (All Samples) (pCi/g) ^a	SNL/NM Background Activity (pCi/g) ^b	Is Maximum COC Activity Less Than or Equal to the Applicable SNL/NM Background Screening Value?	BCF (maximum aquatic)	Is COC a Bioaccumulator? ^c (BCF >40)
Cesium-137	ND (0.0171)	0.079	Yes	3,000 ^d	Yes
Thorium-232	0.779	1.01	Yes	3,000 ^d	Yes
Tritium	ND (0.026)	0.021 ^e	No	NA	No
Uranium-235	ND (0.0344)	0.16	Yes	900 ^d	Yes
Uranium-238	0.908	1.4	Yes	900 ^d	Yes

Note: **Bold** indicates COCs that exceed the background screening values and/or are bioaccumulators.

^aValue listed is the greater of either the maximum detection or the highest MDA.

^bDinwiddie September 1997, Southwest Area Supergroup.

^cNMED March 1998.

^dBaker and Soldat 1992.

^eTharp February 1999. 420 pCi/L = 0.021 pCi/g assuming a soil density of 1 gram/cubic centimeter and 5 percent soil moisture.

BCF = Bioconcentration factor.

COC = Constituent of concern.

DSS = Drain and Septic Systems.

MDA = Minimum detectable activity.

NA = Not applicable.

ND () = Not detected above the MDA, shown in parentheses.

ND () = Not detected, but the MDA (shown in parentheses) exceeds background activity.

NMIED = New Mexico Environment Department.

pCi/g = Picocurie(s) per gram.

SNL/NM = Sandia National Laboratories/New Mexico.

SWMU = Solid Waste Management Unit.

Table 2.4-1 lists the nonradiological COCs and Table 2.4-2 lists the radiological COCs for the human health risk assessment at DSS SWMU 148. All samples were collected from depths greater than 5 feet bgs; therefore, evaluation of ecological risk was not performed. Both tables show the associated SNL/NM maximum background concentration values (Dinwiddie September 1997). Section 2.6.4.2 discusses the results presented in Tables 2.4-1 and 2.4-2.

2.5 Fate and Transport

The primary releases of COCs at DSS SWMU 148 were to the subsurface soil resulting from the discharge of effluents from Building 9927 to the septic tank and seepage pit. Wind, water, and biota are natural mechanisms of COC transport from the primary release point; however, because the discharge was to subsurface soil, none of these mechanisms are considered to be of potential significance as transport mechanisms at this site. Because the septic system is no longer active, additional infiltration of water is not expected. Infiltration of precipitation is essentially nonexistent at DSS SWMU 148, as virtually all of the moisture either drains away from the site or evaporates. Because groundwater at this site is approximately 355 feet bgs, the potential for COCs to reach groundwater through the unsaturated zone above the water table is extremely low.

COCs at DSS SWMU 148 include both inorganic and organic constituents. The inorganic COCs are nonradiological analytes only (radiological analytes were all below background). With the exception of cyanide, the inorganic COCs are elemental in form and are not considered to be degradable. Transformations of these inorganic constituents could include changes in valence (oxidation/reduction reactions) or incorporation into organic forms (e.g., the conversion of selenite or selenate from soil to seleno-amino acids in plants). Cyanide can be metabolized by soil biota.

The organic COCs at DSS SWMU 148 are limited to VOCs. Organic COCs may be degraded through photolysis, hydrolysis, and biotransformation. Photolysis requires light and therefore takes place in the air, at the ground surface, or in surface water. Hydrolysis includes chemical transformations in water and may occur in the soil solution. Biotransformation (i.e., transformation caused by plants, animals, and microorganisms) may occur; however, biological activity may be limited by the arid environment at this site. Because of the depth of the COCs in the soil, the loss of methylene chloride and toluene through volatilization is expected to be minimal.

Table 2.5-1 summarizes the fate and transport processes that can occur at DSS SWMU 148. The COCs at this site include nonradiological inorganic analytes and organic analytes. Wind, surface water, and biota are considered to be of low significance as potential transport mechanisms at this site. Significant leaching into the subsurface soil is unlikely, and leaching into the groundwater at this site is highly unlikely. The potential for transformation of COCs is low.

Table 2.5-1
Summary of Fate and Transport at DSS SWMU 148

Transport and Fate Mechanism	Existence at Site	Significance
Wind	Yes	Low
Surface runoff	Yes	Low
Migration to groundwater	No	None
Food chain uptake	Yes	Low
Transformation/degradation	Yes	Low

DSS = Drain and Septic Systems.
SWMU = Solid Waste Management Unit.

2.6 Human Health Risk Assessment

2.6.1 Introduction

The human health risk assessment of this site includes a number of steps that culminate in a quantitative evaluation of the potential adverse human health effects caused by constituents located at the site. The steps to be discussed include the following:

Step 1.	Site data are described that provide information on the potential COCs, as well as the relevant physical characteristics and properties of the site.
Step 2.	Potential pathways are identified by which a representative population might be exposed to the COCs.
Step 3.	The potential intake of these COCs by the representative population is calculated using a tiered approach. The first component of the tiered approach is a screening procedure that compares the maximum concentration of the COC to an SNL/NM maximum background screening value. COCs that are not eliminated during the first screening procedure are carried forward in the risk assessment process.
Step 4.	Toxicological parameters are identified and referenced for COCs that were not eliminated during the screening procedure.
Step 5.	Potential toxicity effects (specified as a hazard index [HI]) and estimated excess cancer risks are calculated for nonradiological COCs and background. For radiological COCs, the incremental total effective dose equivalent (TEDE) and incremental estimated cancer risk are calculated by subtracting applicable background concentrations directly from maximum on-site contaminant values. This background subtraction applies only when a radiological COC occurs as contamination and exists as a natural background radionuclide.
Step 6.	These values are compared with guidelines established by the U.S. Environmental Protection Agency (EPA), NMED, and DOE to determine whether further evaluation and potential site cleanup are required. Nonradiological COC risk values also are compared to background risk so that an incremental risk can be calculated.
Step 7.	Uncertainties of the above steps are addressed.

2.6.2 Step 1. Site Data

Section 2.1 of this risk assessment provides the site description and history for DSS SWMU 148. Section 2.2 presents a comparison of results to DQOs. Section 2.3 discusses the nature, rate, and extent of contamination.

2.6.3 Step 2. Pathway Identification

DSS SWMU 148 has been designated with a future land-use scenario of industrial (DOE et al. September 1995) (see Annex A for default exposure pathways and parameters). However, the residential land-use scenario is also considered in the pathway analysis. Because of the location and characteristics of the potential contaminants, the primary pathway for human exposure is considered to be soil ingestion for the nonradiological COCs and direct gamma exposure for the radiological COCs. The inhalation pathway for both nonradiological and radiological COCs is included because the potential exists to inhale dust and volatiles. Soil ingestion is included for the radiological COCs as well. The dermal pathway is included for the nonradiological COCs because of the potential for the receptor to be exposed to contaminated soil. No water pathways to the groundwater are considered. Depth to groundwater at DSS SWMU 148 is approximately 355 feet bgs. No intake routes through plant, meat, or milk ingestion are considered appropriate for either the industrial or residential land-use scenarios. Figure 2.6.3-1 shows the conceptual site model flow diagram for DSS SWMU 148.

Pathway Identification

Nonradiological Constituents	Radiological Constituents
Soil ingestion	Soil ingestion
Inhalation (dust and volatiles)	Inhalation (dust and volatiles)
Dermal contact	Direct gamma

2.6.4 Step 3. Background Screening Procedure

This section discusses Step 3, the background screening procedure, which compares the maximum COC concentration to the background screening level. The methodology and results are described in the following sections.

2.6.4.1 Methodology

Maximum concentrations of the nonradiological COCs are compared to the approved SNL/NM maximum screening levels for this area (Dinwiddie September 1997). The SNL/NM maximum background concentration was selected to provide the background screen in Table 2.4-1 and used to calculate risk attributable to background in Section 2.6.6.2. Only the COCs that were detected above the corresponding SNL/NM maximum background screening levels or that do not have either a quantifiable or calculated background screening level are considered in further risk assessment analyses.

For radiological COCs that exceed the SNL/NM background screening levels, background values are subtracted from the individual maximum radionuclide concentrations. Those that do not exceed these background levels are not carried any further in the risk assessment. This

This page intentionally left blank.

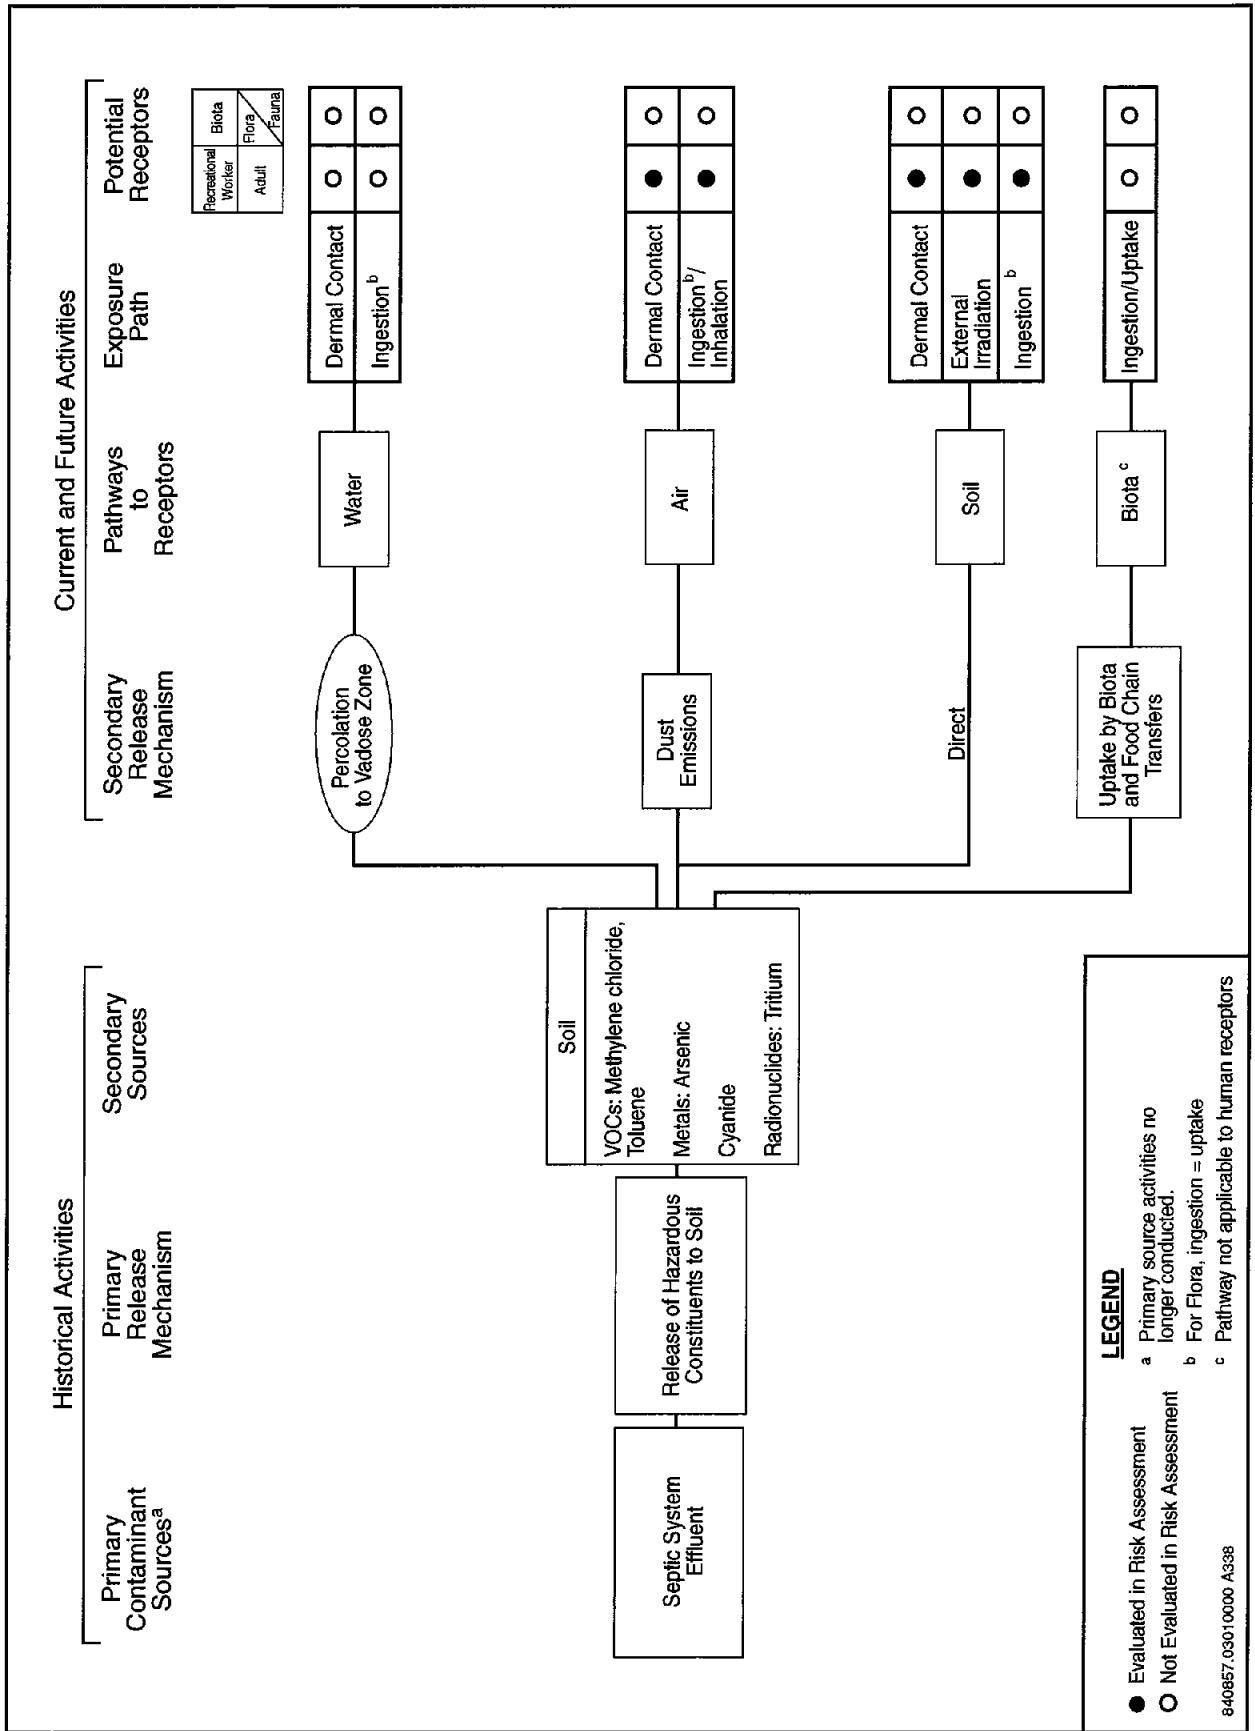


Figure 2.6.3-1
Conceptual Site Model Flow Diagram for DSS SWMU 148, Building 9927 Septic System

approach is consistent with DOE Order 5400.5, "Radiation Protection of the Public and the Environment" (DOE 1993). Radiological COCs that do not have a background value and were detected above the analytical minimum detectable activity (MDA) are carried through the risk assessment at the maximum activity levels. The resultant radiological COCs remaining after this step are referred to as background-adjusted radiological COCs.

2.6.4.2 Results

Tables 2.4-1 and 2.4-2 show DSS SWMU 148 maximum COC concentrations that were compared to the SNL/NM maximum background values (Dinwiddie September 1997) for the human health risk assessment. For the nonradiological COCs, one constituent, arsenic, was measured at a concentration greater than its background screening value. One constituent (cyanide) does not have a quantified background screening concentration; therefore it is unknown whether this COC exceeds background. Two constituents are organic compounds that do not have corresponding background screening values.

For the radiological COCs, one constituent (tritium) exhibited an MDA greater than the background screening level.

2.6.5 Step 4. Identification of Toxicological Parameters

Tables 2.6.5-1 (nonradiological) and 2.6.5-2 (radiological) list the COCs retained in the risk assessment and the values for the available toxicological information. The toxicological values for the nonradiological COCs presented in Table 2.6.5-1 were obtained from the Integrated Risk Information System (IRIS) (EPA 2004a), the Technical Background Document for Development of Soil Screening Levels (NMED February 2004), and the Health Effects Assessment Summary Tables (HEAST) (EPA 1997a). Dose conversion factors (DCFs) used in determining the excess TEDE values for radiological COCs for the individual pathways were the default values provided in the RESRAD computer code (Yu et al. 1993a) as developed in the following documents:

- DCFs for ingestion and inhalation were taken from "Federal Guidance Report No. 11, Limiting Values of Radionuclide Intake and Air Concentration and Dose Conversion Factors for Inhalation, Submersion, and Ingestion" (EPA 1988).
- DCFs for surface contamination (contamination on the surface of the site) were taken from DOE/EH-0070, "External Dose-Rate Conversion Factors for Calculation of Dose to the Public" (DOE 1988).
- DCFs for volume contamination (exposure to contamination deeper than the immediate surface of the site) were calculated using the methods discussed in "Dose-Rate Conversion Factors for External Exposure to Photon Emitters in Soil" (Kocher 1983) and in ANL/EAIS-8, "Data Collection Handbook to Support Modeling the Impacts of Radioactive Material in Soil" (Yu et al. 1993b).

Table 2.6.5-1
Toxicological Parameter Values for DSS SWMU 148 Nonradiological COCs

COC	RfD _o (mg/kg-d)	Confidence ^a	RfD _{inh} (mg/kg-d)	Confidence ^a	SF _o (mg/kg-d) ^{*4}	SF _{inh} (mg/kg-d) ^{*4}	Cancer Class ^b	ABS
Inorganic								
Arsenic	3E-4 ^c	M	--	--	1.5E+0 ^c	1.5E+1 ^c	A	0.03 ^d
Cyanide	2E-2 ^c	M	--	--	--	--	D	0.1 ^d
Organic								
Methylene chloride	6E-2 ^c	M	8.6E-1 ^e	--	7.5E-3 ^c	1.6E-3 ^c	B2	0.1 ^d
Toluene	2E-1 ^c	M	1.1E-1 ^c	M	--	--	D	0.1 ^d

^aConfidence associated with IRIS (EPA 2004a) database values. Confidence: M = medium.

^bEPA weight-of-evidence classification system for carcinogenicity (EPA 1989) taken from IRIS (EPA 2004a):

A = Human carcinogen.

B2 = Probable human carcinogen. Sufficient evidence in animals and inadequate or no evidence in humans.

D = Not classifiable as to human carcinogenicity.

^cToxicological parameter values from IRIS electronic database (EPA 2004a).

^dToxicological parameter values from NMED (February 2004).

^eToxicological parameter values from HEAST (EPA 1997a).

ABS = Gastrointestinal absorption coefficient.

COC = Constituent of concern.

DSS = Drain and Septic Systems.

EPA = U.S. Environmental Protection Agency.

HEAST = Health Effects Assessment Summary Tables.

IRIS = Integrated Risk Information System.

mg/kg-d = Milligram(s) per kilogram-day.

(mg/kg-d)⁻¹ = Per milligram per kilogram-day.

NMED = New Mexico Environment Department.

RfD_{inh} = Inhalation chronic reference dose.

RfD_o = Oral chronic reference dose.

SF_{inh} = Inhalation slope factor.

SF_o = Oral slope factor.

SWMU = Solid Waste Management Unit.

-- = Information not available.

Table 2.6.5-2
Radiological Toxicological Parameter Values for DSS SWMU 148 COCs
Obtained from RESRAD Risk Coefficients^a

COC	SF _o (1/pCi)	SF _{inh} (1/pCi)	SF _{ev} (g/pCi-yr)	Cancer Class ^b
Tritium	7.20E-14	9.60E-14	0	A

^aYu et al. 1993a.

^bEPA weight-of-evidence classification system for carcinogenicity (EPA 1989): A = Human carcinogen for high dose and high dose rate (i.e., greater than 50 rem per year). For low-level environmental exposures, the carcinogenic effect has not been observed and documented.

1/pCi = One per picocurie.

COC = Constituent of concern.

DSS = Drain and Septic Systems.

EPA = U.S. Environmental Protection Agency.

g/pCi-yr = Gram(s) per picocurie-year.

SF_{ev} = External volume exposure slope factor.

SF_{inh} = Inhalation slope factor.

SF_o = Oral (ingestion) slope factor.

SWMU = Solid Waste Management Unit.

2.6.6 Step 5. Exposure Assessment and Risk Characterization

Section 2.6.6.1 describes the exposure assessment for this risk assessment. Section 2.6.6.2 provides the risk characterization, including the HI and excess cancer risk for both the potential nonradiological COCs and associated background for industrial and residential land-use scenarios.

2.6.6.1 Exposure Assessment

Annex A provides the equations and parameter input values used in calculating intake values and subsequent HI and excess cancer risk values for the individual exposure pathways. The annex shows parameters for both industrial and residential land-use scenarios. The equations for nonradiological COCs are based upon the Risk Assessment Guidance for Superfund (RAGS) (EPA 1989). Parameters are based upon information from the RAGS (EPA 1989), the Technical Background Document for Development of Soil Screening Levels (NMED February 2004), as well as other EPA and NMED guidance documents, and reflect the reasonable maximum exposure (RME) approach advocated by the RAGS (EPA 1989). Although the designated land-use scenario is industrial for this site, risk values for a residential land-use scenario are also presented.

2.6.6.2 Risk Characterization

Table 2.6.6-1 shows an HI of 0.03 for the DSS SWMU 148 nonradiological COCs and an estimated excess cancer risk of 5E-6 for the designated industrial land-use scenario. The numbers presented include exposure from soil ingestion, dermal contact, and dust and volatile inhalation for nonradiological COCs. Table 2.6.6-2 shows an HI of 0.02 and an estimated

Table 2.6.6-1
Risk Assessment Values for DSS SWMU 148 Nonradiological COCs

COC	Maximum Concentration (All Samples) (mg/kg)	Industrial Land-Use Scenario ^a		Residential Land-Use Scenario ^a	
		Hazard Index	Cancer Risk	Hazard Index	Cancer Risk
Inorganic					
Arsenic	8.5	0.03	5E-6	0.39	2E-5
Cyanide	0.25 ^b	0.00	--	0.00	--
Organic					
Methylene chloride	0.0025 ^b	0.00	2E-8	0.00	3E-8
Toluene	0.0025 J	0.00	--	0.00	--
Total		0.03	5E-6	0.39	2E-5

^aEPA 1989.

^bNondetected concentration (i.e., one-half the maximum detection limit is greater than the maximum detected concentration).

COC = Constituent of concern.

DSS = Drain and Septic Systems.

EPA = U.S. Environmental Protection Agency.

J = Estimated concentration.

mg/kg = Milligram(s) per kilogram.

SWMU = Solid Waste Management Unit.

-- = Information not available.

Table 2.6.6-2
Risk Assessment Values for DSS SWMU 148 Nonradiological Background Constituents

COC	Background Concentration ^a (mg/kg)	Industrial Land-Use Scenario ^b		Residential Land-Use Scenario ^b	
		Hazard Index	Cancer Risk	Hazard Index	Cancer Risk
Arsenic	4.4	0.02	3E-6	0.20	1E-5
Cyanide	NC	--	--	--	--
Total		0.02	3E-6	0.20	1E-5

^aDinwiddie September 1997, Southwest Area Supergroup.

^bEPA 1989.

COC = Constituent of concern.

DSS = Drain and Septic Systems.

EPA = U.S. Environmental Protection Agency.

mg/kg = Milligram(s) per kilogram.

NC = Not calculated.

SWMU = Solid Waste Management Unit.

-- = Information not quantified.

excess cancer risk of $3E-6$ for the DSS SWMU 148 associated background constituents under the designated industrial land-use scenario.

For the radiological COC, contribution from the direct gamma exposure pathway is included. For the industrial land-use scenario, a TEDE was calculated that results in an incremental TEDE of $2.9E-8$ millirem (mrem)/year (yr). In accordance with EPA guidance found in Office of Solid Waste and Emergency Response (OSWER) Directive No. 9200.4-18 (EPA 1997b), an incremental TEDE of 15 mrem/yr is used for the probable land-use scenario (industrial in this case); the calculated dose value for DSS SWMU 148 for the industrial land-use scenario is well below this guideline. The estimated incremental excess cancer risk is $4.1E-14$.

For the nonradiological COCs under the residential land-use scenario, the HI is 0.39 with an estimated excess cancer risk of $2E-5$ (Table 2.6.6-1). The numbers in the table include exposure from soil ingestion, dermal contact, and dust and volatile inhalation. Although the EPA (1991) guidelines generally recommend that inhalation not be included in a residential land-use scenario, this pathway is included because of the potential for soil in Albuquerque, New Mexico, to be eroded and for dust to be present in predominantly residential areas. Because of the nature of the local soil, other exposure pathways are not considered (see Annex A). Table 2.6.6-2 shows an HI of 0.20 and an estimated excess cancer risk of $1E-5$ for the DSS SWMU 148 associated background constituents under the residential land-use scenario.

For the radiological COC, the incremental TEDE for the residential land-use scenario is $1.9E-5$ mrem/yr. The guideline being used is an excess TEDE of 75 mrem/yr (SNL/NM February 1998) for a complete loss of institutional controls (residential land use in this case); the calculated dose value for DSS SWMU 148 for the residential land-use scenario is well below this guideline. Consequently, DSS SWMU 148 is eligible for unrestricted radiological release as the residential land-use scenario results in an incremental TEDE of less than 75 mrem/yr to the on-site receptor. The estimated incremental excess cancer risk is $2.2E-11$. The excess cancer risk from the nonradiological and radiological COCs should be summed to provide risk estimates for persons exposed to both types of carcinogenic contaminants, as noted in OSWER Directive No. 9200.4-18 "Establishment of Cleanup Levels for CERCLA [Comprehensive Environmental Response, Compensation, and Liability Act] Sites with Radioactive Contamination," (EPA 1997b). This summation is tabulated in Section 2.6.9.

2.6.7 Step 6. Comparison of Risk Values to Numerical Guidelines

The human health risk assessment analysis evaluates the potential for adverse health effects for both the industrial (the designated land-use scenario for this site) and residential land-use scenarios.

For the nonradiological COCs under the industrial land-use scenario, the HI is 0.03 (less than the numerical guideline of 1 suggested in the RAGS [EPA 1989]). The estimated excess cancer risk is $5E-6$. NMED guidance states that cumulative excess lifetime cancer risk must be less than $1E-5$ (Bearzi January 2001); thus the excess cancer risk for this site is below the suggested acceptable risk value. This assessment also determines risks considering background concentrations of the potential nonradiological COCs for both the industrial and residential land-use scenarios. The incremental risk is determined by subtracting risk associated with background from potential COC risk. These numbers are not rounded before the difference is determined and therefore may appear to be inconsistent with numbers

presented in tables and within the text. For conservatism, the background constituents that do not have quantified background screening concentrations are assumed to have a hazard quotient of 0.00. The incremental HI is 0.02 and the estimated incremental excess cancer risk is $2.59\text{E-}6$ for the industrial land-use scenario. These incremental risk calculations indicate insignificant risk to human health from nonradiological COCs under an industrial land-use scenario.

For the radiological COC under the industrial land-use scenario, the incremental TEDE is $2.9\text{E-}8$ mrem/yr, which is significantly lower than the EPA's numerical guideline of 15 mrem/yr (EPA 1997b). The estimated incremental excess cancer risk is $4.1\text{E-}14$.

The calculated HI for the nonradiological COCs under the residential land-use scenario is 0.39, which is below numerical guidance. The estimated excess cancer risk is $2\text{E-}5$. NMED guidance states that cumulative excess lifetime cancer risk must be less than $1\text{E-}5$ (Bearzi January 2001); thus the excess cancer risk for this site is slightly above the suggested acceptable risk value. The incremental HI is 0.19 and the estimated incremental cancer risk is $1.06\text{E-}5$ for the residential land-use scenario. The incremental HI risk calculations indicate insignificant risk to human health from nonradiological COCs under the residential land-use scenario.

The incremental TEDE for a residential land-use scenario from the radiological component is $1.9\text{E-}5$ mrem/yr, which is significantly lower than the numerical guideline of 75 mrem/yr suggested in the SNL/NM "RESRAD Input Parameter Assumptions and Justification" (SNL/NM February 1998). The estimated incremental excess cancer risk is $2.2\text{E-}11$.

2.6.8 Step 7. Uncertainty Discussion

The determination of the nature, rate, and extent of contamination at DSS SWMU 148 is based upon an initial conceptual model that was validated with sampling conducted at the site. The sampling was implemented in accordance with procedures and DQOs in the RFI Work Plan (SNL/NM March 1993), the RFI SAP (IT March 1994), and subsequent negotiations with the NMED/HRMB. The data from soil samples collected at effluent release points are representative of potential COC releases to the site. The analytical requirements and results satisfy the DQOs, and data quality was verified/validated in accordance with SNL/NM procedures. Therefore, there is no uncertainty associated with the data quality used to perform the risk assessment at DSS SWMU 148.

Because of the location, history of the site, and future land use, there is low uncertainty in the land-use scenario and the potentially affected populations that were considered in performing the risk assessment analysis. Based upon the COCs found in the near-surface soil and the location and physical characteristics of the site, there is little uncertainty in the exposure pathways relevant to the analysis.

An RME approach is used to calculate the risk assessment values. Specifically, the parameter values in the calculations are conservative and calculated intakes are probably overestimated. Maximum measured values of COC concentrations are used to provide conservative results.

Table 2.6.5-1 shows the uncertainties (confidence levels) in nonradiological toxicological parameter values. There is a combination of estimated values and values from the IRIS (EPA 2004a), HEAST (EPA 1997a), and Technical Background Document for Development of Soil

Screening Levels (NMED February 2004). Where values are not provided, information is not available from the HEAST (EPA 1997a), IRIS (EPA 2004a), Technical Background Document for Development of Soil Screening Levels (NMED February 2004), Risk Assessment Information System (ORNL 2003), or EPA regions (EPA 2004b, EPA 2002a, EPA 2002b). Because of the conservative nature of the RME approach, uncertainties in toxicological values are not expected to change the conclusion from the risk assessment analysis.

Although the estimated excess cancer risk is slightly above the NMED guideline for the residential land-use scenario, maximum concentrations were used in the risk calculation. Because the site has been adequately characterized, average concentrations are more representative of actual site conditions. The average concentration for arsenic, the main contributor to excess cancer risk, is 4.0 milligrams (mg)/kilogram (kg), which is below background and therefore eliminates arsenic from further evaluation. With the removal of arsenic, the total and estimated incremental excess cancer risk values are reduced to $3E-8$ and $3.45E-8$, respectively. Thus, by using realistic concentrations in the risk calculations that more accurately depict actual site conditions, both the total and estimated incremental excess cancer risk values are below NMED guidelines.

Risk assessment values for the nonradiological COCs are within the acceptable range for human health under the industrial and residential land-use scenarios compared to established numerical guidance.

For the radiological COCs, the conclusion of the risk assessment is that potential effects on human health for both the industrial and residential land-use scenarios are below background and represent only a small fraction of the estimated 360 mrem/yr received by the average U.S. population (NCRP 1987).

The overall uncertainty in all of the steps in the risk assessment process is not considered to be significant with respect to the conclusion reached.

2.6.9 Summary

DSS SWMU 148 contains identified COCs consisting of some inorganic and organic compounds. Because of the location of the site, the designated industrial land-use scenario, and the nature of contamination, potential exposure pathways identified for this site include soil ingestion, dermal contact, and dust and volatile inhalation for chemical COCs, and soil ingestion, dust inhalation, and direct gamma exposure for radionuclides. The same exposure pathways are applied to the residential land-use scenario.

Using conservative assumptions and an RME approach to risk assessment, calculations for the nonradiological COCs show that for the industrial land-use scenario the HI (0.03) is significantly lower than the accepted numerical guidance from the EPA. The estimated excess cancer risk is $5E-6$; thus, excess cancer risk is also below the acceptable risk value provided by the NMED for an industrial land-use scenario (Bearzi January 2001). The incremental HI is 0.02 and the incremental estimated excess cancer risk is $2.59E-6$ for the industrial land-use scenario. The incremental risk calculations indicate insignificant risk to human health for the industrial land-use scenario.

Using conservative assumptions and an RME approach to risk assessment, calculations for the nonradiological COCs show that for the residential land-use scenario the HI (0.39) is below

the accepted numerical guidance from the EPA. The estimated excess cancer risk is $2E-5$. Thus, excess cancer risk is slightly above the acceptable risk value provided by the NMED for a residential land-use scenario (Bearzi January 2001). The incremental HI is 0.19 and the incremental estimated excess cancer risk is $1.06E-5$ for the residential land-use scenario. The incremental HI risk calculation indicates insignificant risk to human health for the residential land-use scenario.

Although the estimated excess cancer risk is above the NMED guideline for the residential land-use scenario, maximum concentrations were used in the risk calculation. Because the site has been adequately characterized, average concentrations are more representative of actual site conditions. The average concentration for arsenic, the main contributor to excess cancer risk, is 4.0 mg/kg, which is below background and therefore eliminates arsenic from further evaluation. Using the average concentration for arsenic in the risk analysis reduces the total and estimated incremental excess cancer risk values to $3E-8$ and $3.45E-8$, respectively. Thus, by using realistic concentrations in the risk calculations that more accurately depict actual site conditions, both the total and incremental estimated excess cancer risks are below NMED guidelines.

The incremental TEDE and corresponding estimated cancer risk from the radiological COC are much less than EPA guidance values. The estimated TEDE is $2.9E-8$ mrem/yr for the industrial land-use scenario, which is much lower than the EPA's numerical guidance of 15 mrem/yr (EPA 1997b). The corresponding estimated incremental cancer risk value is $4.1E-14$ for the industrial land-use scenario. Furthermore, the incremental TEDE for the residential land-use scenario that results from a complete loss of institutional control is $1.9E-5$ mrem/yr with an associated risk of $2.2E-11$. The guideline for this scenario is 75 mrem/yr (SNL/NM February 1998). Therefore, DSS SWMU 148 is eligible for unrestricted radiological release.

The excess cancer risk from the nonradiological and radiological COCs should be summed to provide risk estimates for persons exposed to both types of carcinogenic contaminants, as noted in OSWER Directive No. 9200.4-18 (EPA 1997b). The summation of the nonradiological and radiological carcinogenic risks is tabulated in Table 2.6.9-1

Table 2.6.9-1
Summation of Incremental Nonradiological and Radiological Risks from
DSS SWMU 148, Building 9927 Septic System Carcinogens

Scenario	Nonradiological Risk	Radiological Risk	Total Risk
Industrial	$2.59E-6$	$4.1E-14$	$2.59E-6$
Residential	$3.45E-8^a$	$2.2E-11$	$3.45E-8$

^aRisks calculated with the removal of arsenic due to the below background average concentration.

DSS = Drain and Septic Systems.

SWMU = Solid Waste Management Unit.

Uncertainties associated with the calculations are considered small relative to the conservatism of the risk assessment analysis. Therefore, it is concluded that this site poses insignificant risk to human health under both the industrial and residential land-use scenarios.

2.7 Ecological Risk Assessment

2.7.1 Introduction

This section addresses the ecological risks associated with exposure to constituents of potential ecological concern (COPECs) in the soil at DSS SWMU 148. A component of the NMED Risk-Based Decision Tree in the "RPMP [RCRA Permits Management Program] Document Requirement Guide" (NMED March 1998) is to conduct an ecological risk assessment that corresponds with that presented in EPA's Ecological RAGS (EPA 1997c). The current methodology is tiered and contains an initial scoping assessment followed by a more detailed risk assessment if warranted by the results of the scoping assessment. Initial components of NMED's decision tree (a discussion of DQOs, data assessment, and evaluations of bioaccumulation as well as fate and transport potential) are addressed in previous sections of this report. At the end of the scoping assessment, a determination is made as to whether a more detailed examination of potential ecological risk is necessary.

2.7.2 Scoping Assessment

The scoping assessment focuses primarily on the likelihood of exposure of biota at, or adjacent to, the site to constituents associated with site activities. Included in this section are an evaluation of existing data with respect to the existence of complete ecological exposure pathways, an evaluation of bioaccumulation potential, and a summary of fate and transport potential. A scoping risk-management decision (Section 2.7.2.4) summarizes the scoping results and assesses the need for further examination of potential ecological impacts.

2.7.2.1 *Data Assessment*

As indicated in Section 2.4, all COCs at DSS SWMU 148 are at depths of 5 feet bgs or greater. Therefore, no complete ecological exposure pathways exist at this site and no COCs are considered to be COPECs.

2.7.2.2 *Bioaccumulation*

Because no COPECs are associated with this site, bioaccumulation potential is not evaluated.

2.7.2.3 *Fate and Transport Potential*

The potential for the COCs to migrate from the source of contamination to other media or biota is discussed in Section 2.5. As noted in Table 2.5-1, wind, surface water, and biota (food chain uptake) are expected to be of low significance as transport mechanisms for COCs at this site. Degradation, transformation, and decay of the radiological COC also are expected to be of low significance.

2.7.2.4 *Scoping Risk-Management Decision*

Based upon information gathered through the scoping assessment, it is concluded that complete ecological pathways are not associated with COCs at DSS SWMU 148; therefore, no COPECs exist at the site, and a more detailed risk assessment is not deemed necessary to predict the potential level of ecological risk associated with the site.

3.0 RECOMMENDATION FOR CORRECTIVE ACTION COMPLETE WITHOUT CONTROLS DETERMINATION

3.1 Rationale

Based upon field investigation data and the human health and ecological risk assessment analyses, a determination of CAC without controls (NMED April 2004) is recommended for DSS SWMU 148 for the following reasons:

- The soil has been sampled for all potential COCs.
- No COCs are present in the soil at levels considered hazardous to human health for either an industrial or residential land-use scenario.
- None of the COCs warrant ecological concern because no complete pathways exist at the site.

3.2 Criterion

Based upon the evidence provided in Chapter 2.0, a determination of CAC without controls (NMED April 2004) is recommended for DSS SWMU 148. This is consistent with the NMED's NFA Criterion 5, which states, "the SWMU/AOC [Area of Concern] has been characterized or remediated in accordance with current applicable state or federal regulations, and the available data indicate that contaminants pose an acceptable level of risk under current and projected future land use" (NMED March 1998).

This page intentionally left blank.

4.0 REFERENCES

Baker, D.A., and J.K. Soldat, 1992. "Methods for Estimating Doses to Organisms from Radioactive Materials Released into the Aquatic Environment," PNL-8150, Pacific Northwest Laboratory, Richland, Washington.

Bearzi, J. (New Mexico Environment Department/Hazardous Waste Bureau), January 2000. Letter to M.J. Zamorski (U.S. Department of Energy) and L. Shephard (Sandia National Laboratories/New Mexico) approving the "Sampling and Analysis Plan for Characterizing and Assessing Potential Releases to the Environment for Septic and Other Miscellaneous Drain System at Sandia National Laboratories/New Mexico." January 28, 2000.

Bearzi, J.P. (New Mexico Environment Department), January 2001. Memorandum to RCRA-Regulated Facilities, "Risk-Based Screening Levels for RCRA Corrective Action Sites in New Mexico," Hazardous Waste Bureau, New Mexico Environment Department, Santa Fe, New Mexico. January 23, 2001.

Callahan, M.A., M.W. Slimak, N.W. Gabel, I.P. May, C.F. Fowler, J.R. Freed, P. Jennings, R.L. Durfee, F.C. Whitmore, B. Maestri, W.R. Mabey, B.R. Holt, and C. Gould, 1979. "Water-Related Environmental Fate of 129 Priority Pollutants," EPA-440/4-79-029, Office of Water and Waste Management, Office of Water Planning and Standards, U.S. Environmental Protection Agency, Washington, D.C.

Dinwiddie, R.S. (New Mexico Environment Department), September 1997. Letter to M.J. Zamorski (U.S. Department of Energy), "Request for Supplemental Information: Background Concentrations Report, SNL/KAFB." September 24, 1997.

DOE, see U.S. Department of Energy.

EPA, see U.S. Environmental Protection Agency.

Howard, P.H., 1990. Volume II: "Solvents," *Handbook of Environmental Fate and Exposure Data for Organic Chemicals*, Lewis Publishers, Inc. Chelsea, Michigan.

IT Corporation (IT), March 1994. "Sampling and Analysis Plan for Shallow Subsurface Soil Sampling, RCRA Facility Investigation of Septic Tanks and Drainfields (OU 1295)," IT Corporation, Albuquerque, New Mexico.

Jones, J. (Sandia National Laboratories/New Mexico), June 1991. Internal memorandum to D. Dionne listing the septic tanks that were removed from service with the construction of the Area III sanitary sewer system. June 21, 1991.

Kocher, D.C. 1983. "Dose-Rate Conversion Factors for External Exposure to Photon Emitters in Soil," *Health Physics*, Vol. 28, pp. 193-205.

Moats, W. (New Mexico Environment Department/Hazardous Waste Bureau), February 2002. Letter to M.J. Zamorski (U.S. Department of Energy) and P. Davies (Sandia National Laboratories/New Mexico) approving the "Field Implementation Plan, Characterization of Non-Environmental Restoration Drain and Septic Systems." February 21, 2002.

National Council on Radiation Protection and Measurements (NCRP), 1987. "Exposure of the Population in the United States and Canada from Natural Background Radiation," *NCRP Report No. 94*, National Council on Radiation Protection and Measurements, Bethesda, Maryland.

National Oceanic and Atmospheric Administration (NOAA), 1990. *Local Climatological Data, Annual Summary with Comparative Data*, Albuquerque, New Mexico.

NCRP, see National Council on Radiation Protection and Measurements.

Neumann, G., 1976. "Concentration Factors for Stable Metals and Radionuclides in Fish, Mussels and Crustaceans—A Literature Survey," Report 85-04-24, National Swedish Environmental Protection Board.

New Mexico Environment Department (NMED), April 1997. "Notice of Deficiency; Proposal to Approve: Proposals for No Further Action, Environmental Restoration Project (Third Round)." Hazardous and Radioactive Materials Bureau, New Mexico Environment Department, Santa Fe, New Mexico. April 28, 1997.

New Mexico Environment Department (NMED), March 1998. "RPMP Document Requirement Guide," RCRA Permits Management Program, Hazardous and Radioactive Materials Bureau, New Mexico Environment Department, Santa Fe, New Mexico.

New Mexico Environment Department (NMED), February 2004. "Technical Background Document for Development of Soil Screening Levels, Revision 2," Hazardous Waste Bureau and Ground Water Quality Bureau Voluntary Remediation Program, New Mexico Environment Department, Santa Fe, New Mexico.

New Mexico Environment Department (NMED), April 2004. "Compliance Order on Consent Pursuant to New Mexico Hazardous Waste Act § 74-4-10," New Mexico Environment Department, Santa Fe, New Mexico. April 29, 2004.

NMED, see New Mexico Environment Department.

NOAA, see National Oceanographic and Atmospheric Administration.

Oak Ridge National Laboratory (ORNL), 2003. "Risk Assessment Information System," electronic database maintained by Oak Ridge National Laboratory, Oak Ridge, Tennessee.

ORNL, see Oak Ridge National Laboratory.

Romero, T. (Sandia National Laboratories/New Mexico), September 2003. Internal communication to M. Sanders stating that during the connection of septic systems to the new City of Albuquerque sewer system, the old systems were disconnected and the lines capped. September 16, 2003.

Sandia National Laboratories/New Mexico (SNL/NM) March 1993. "Septic Tanks and Drainfields (ADS-1295) RCRA Facility Investigation Work Plan," Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), July 1994. "Verification and Validation of Chemical and Radiochemical Data," Technical Operating Procedure (TOP) 94-03, Rev. 0, Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), August 1995. "Proposal for No Further Action, Environmental Restoration Project Site 148, Building 9927 Septic System, Operable Unit 1295," Environmental Restoration Project, Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), January 1996. "Septic Tank Closure Book III: Logbook #0147, November 8, 1995 to January 26, 1996," Environmental Restoration Project, Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), March 1996. "Site-Wide Hydrogeologic Characterization Project, Calendar Year 1995 Annual Report," Environmental Restoration Project, Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), July 1996. "Laboratory Data Review Guidelines," Radiation Protection Diagnostics Procedure No. RPSD-02-11, Issue No. 2, Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), June 1997. "Environmental Restoration Project Responses to NMED Technical Comments on No Further Action Proposals Dated August 1995." Environmental Restoration Project, Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), February 1998. "RESRAD Input Parameter Assumptions and Justification," Environmental Restoration Project, Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), October 1999. "Sampling and Analysis Plan for Characterizing and Assessing Potential Releases to the Environment From Septic and Other Miscellaneous Drain Systems at Sandia National Laboratories/New Mexico," Sandia National Laboratories, Albuquerque, New Mexico. October 19, 1999.

Sandia National Laboratories/New Mexico (SNL/NM), November 2001. "Field Implementation Plan, Characterization of Non-Environmental Restoration Drain and Septic Systems," Sandia National Laboratories, Albuquerque, New Mexico.

Sandia National Laboratories/New Mexico (SNL/NM), April 2004. "Fiscal Year 2003 Annual Groundwater Monitoring Report," Report #75-10077-6, Sandia National Laboratories, Albuquerque, New Mexico.

SNL/NM, see Sandia National Laboratories/New Mexico.

Tharp, T.L. (Sandia National Laboratories/New Mexico), February 1999. Memorandum to F.B. Nimick (Sandia National Laboratories/New Mexico), regarding Tritium Background Data Statistical Analysis for Site-Wide Surface Soils. February 25, 1999.

U.S. Department of Energy (DOE), 1988. "External Dose-Rate Conversion Factors for Calculation of Dose to the Public," DOE/EH-0070, Assistant Secretary for Environment, Safety and Health, U.S. Department of Energy, Washington, D.C.

U.S. Department of Energy (DOE), 1993. "Radiation Protection of the Public and the Environment," DOE Order 5400.5, U.S. Department of Energy, Washington, D.C.

U.S. Department of Energy (DOE), U.S. Air Force, and U.S. Forest Service, September 1995. "Workbook: Future Use Management Area 2," prepared by the Future Use Logistics and Support Working Group in cooperation with U.S. Department of Energy Affiliates, the U.S. Air Force, and the U.S. Forest Service.

U.S. Environmental Protection Agency (EPA), November 1986. "Test Methods for Evaluating Solid Waste," 3rd ed., Update 3, SW-846, Office of Solid Waste and Emergency Response, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1988. "Federal Guidance Report No. 11, Limiting Values of Radionuclide Intake and Air Concentration and Dose Conversion Factors for Inhalation, Submersion, and Ingestion," Office of Radiation Programs, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1989. "Risk Assessment Guidance for Superfund, Vol. I: Human Health Evaluation Manual," EPA/540-1089/002, Office of Emergency and Remedial Response, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1991. "Risk Assessment Guidance for Superfund, Volume I: Human Health Evaluation Manual (Part B)," Office of Emergency and Remedial Response, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1997a. "Health Effects Assessment Summary Tables (HEAST), FY 1997 Update," EPA-540-R-97-036, Office of Research and Development and Office of Solid Waste and Emergency Response, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1997b. "Establishment of Cleanup Levels for CERCLA Sites with Radioactive Contamination," OSWER Directive No. 9200.4-18, Office of Solid Waste and Emergency Response, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1997c. "Ecological Risk Assessment Guidance for Superfund: Process for Designing and Conducting Ecological Risks," Interim Final, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 2002a. "Region 9 Preliminary Remediation Goals (PRGs) 2002," electronic database maintained by Region 9, U.S. Environmental Protection Agency, San Francisco, California.

U.S. Environmental Protection Agency (EPA), 2002b. "Risk-Based Concentration Table," electronic database maintained by Region 3, U.S. Environmental Protection Agency, Philadelphia, Pennsylvania.

U.S. Environmental Protection Agency (EPA), 2004a. Integrated Risk Information System (IRIS) electronic database, maintained by the U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 2004b. "Region 6 Preliminary Remediation Goals (PRGs) 2004," electronic database maintained by Region 6, U.S. Environmental Protection Agency, Dallas, Texas.

Yanicak, S. (Oversight Bureau, Department of Energy, New Mexico Environment Department), March 1997. Letter to M. Johansen (DOE/AIP/POC Los Alamos National Laboratory), "(Tentative) list of constituents of potential ecological concern (COPECs) which are considered to be bioconcentrators and/or biomagnifiers." March 3, 1997.

Yu, C., A.J. Zielen, J.-J. Cheng, Y.C. Yuan, L.G. Jones, D.J. LePoire, Y.Y. Wang, C.O. Loureiro, E. Gnanapragasam, E. Faillace, A. Wallo III, W.A. Williams, and H. Peterson, 1993a. "Manual for Implementing Residual Radioactive Material Guidelines Using RESRAD," Version 5.0. Environmental Assessment Division, Argonne National Laboratory, Argonne, Illinois.

Yu, C., C. Loureiro, J.-J. Cheng, L.G. Jones, Y.Y. Wang, Y.P. Chia, and E. Faillace, 1993b. "Data Collection Handbook to Support Modeling the Impacts of Radioactive Material in Soil," ANL/EAIS-8, Argonne National Laboratory, Argonne, Illinois.

This page intentionally left blank.

ANNEX A
DSS SWMU 148
Exposure Pathway Discussion for
Chemical and Radionuclide Contamination

ANNEX A EXPOSURE PATHWAY DISCUSSION FOR CHEMICAL AND RADIONUCLIDE CONTAMINATION

Introduction

Sandia National Laboratories/New Mexico (SNL/NM) uses a default set of exposure routes and associated default parameter values developed for each future land-use designation being considered for SNL/NM Environmental Restoration (ER) Project sites. This default set of exposure scenarios and parameter values are invoked for risk assessments unless site-specific information suggests other parameter values. Because many SNL/NM solid waste management units (SWMUs) have similar types of contamination and physical settings, SNL/NM believes that the risk assessment analyses at these sites can be similar. A default set of exposure scenarios and parameter values facilitates the risk assessments and subsequent review.

The default exposure routes and parameter values used are those that SNL/NM views as resulting in a Reasonable Maximum Exposure (RME) value. Subject to comments and recommendations by the U.S. Environmental Protection Agency (EPA) Region VI and New Mexico Environment Department (NMED), SNL/NM will use these default exposure routes and parameter values in future risk assessments.

At SNL/NM, all SWMUs exist within the boundaries of the Kirtland Air Force Base. Approximately 240 potential waste and release sites have been identified where hazardous, radiological, or mixed materials may have been released to the environment. Evaluation and characterization activities have occurred at all of these sites to varying degrees. Among other documents, the SNL/NM ER draft Environmental Assessment (DOE 1996) presents a summary of the hydrogeology of the sites and the biological resources present. When evaluating potential human health risk the current or reasonably foreseeable land use negotiated and approved for the specific SWMU/AOC, aggregate, or watershed will be used. The following references generally document these land uses: *Workbook: Future Use Management Area 2 (DOE et al. September 1995)*; *Workbook: Future Use Management Area 1 (DOE et al. October 1995)*; *Workbook: Future Use Management Areas 3, 4, 5, and 6 (DOE and USAF January 1996)*; *Workbook: Future Use Management Area 7 (DOE and USAF March 1996)*. At this time, all SNL/NM SWMUs have been tentatively designated for either industrial or recreational future land use. The NMED has also requested that risk calculations be performed based upon a residential land-use scenario. Therefore, all three land-use scenarios will be addressed in this document.

The SNL/NM ER Project has screened the potential exposure routes and identified default parameter values to be used for calculating potential intake and subsequent hazard index (HI), excess cancer risk and dose values. The EPA (EPA 1989) provides a summary of exposure routes that could potentially be of significance at a specific waste site. These potential exposure routes consist of:

- Ingestion of contaminated drinking water
- Ingestion of contaminated soil

- Ingestion of contaminated fish and shellfish
- Ingestion of contaminated fruits and vegetables
- Ingestion of contaminated meat, eggs, and dairy products
- Ingestion of contaminated surface water while swimming
- Dermal contact with chemicals in water
- Dermal contact with chemicals in soil
- Inhalation of airborne compounds (vapor phase or particulate)
- External exposure to penetrating radiation (immersion in contaminated air; immersion in contaminated water; and exposure from ground surfaces with photon-emitting radionuclides)

Based upon the location of the SNL/NM SWMUs and the characteristics of the surface and subsurface at the sites, we have evaluated these potential exposure routes for different land-use scenarios to determine which should be considered in risk assessment analyses (the last exposure route is pertinent to radionuclides only). At SNL/NM SWMUs, there is currently no consumption of fish, shellfish, fruits, vegetables, meat, eggs, or dairy products that originate on site. Additionally, no potential for swimming in surface water is present due to the high-desert environmental conditions. As documented in the RESRAD computer code manual (ANL 1993), risks resulting from immersion in contaminated air or water are not significant compared to risks from other radiation exposure routes.

For the industrial and recreational land-use scenarios, SNL/NM ER has, therefore, excluded the following five potential exposure routes from further risk assessment evaluations at any SNL/NM SWMU:

- Ingestion of contaminated fish and shellfish
- Ingestion of contaminated fruits and vegetables
- Ingestion of contaminated meat, eggs, and dairy products
- Ingestion of contaminated surface water while swimming
- Dermal contact with chemicals in water

That part of the exposure pathway for radionuclides related to immersion in contaminated air or water is also eliminated.

Based upon this evaluation, for future risk assessments the exposure routes that will be considered are shown in Table 1.

Table 1
Exposure Pathways Considered for Various Land-Use Scenarios

Industrial	Recreational	Residential
Ingestion of contaminated drinking water	Ingestion of contaminated drinking water	Ingestion of contaminated drinking water
Ingestion of contaminated soil	Ingestion of contaminated soil	Ingestion of contaminated soil
Inhalation of airborne compounds (vapor phase or particulate)	Inhalation of airborne compounds (vapor phase or particulate)	Inhalation of airborne compounds (vapor phase or particulate)
Dermal contact (nonradiological constituents only) soil only	Dermal contact (nonradiological constituents only) soil only	Dermal contact (nonradiological constituents only) soil only
External exposure to penetrating radiation from ground surfaces	External exposure to penetrating radiation from ground surfaces	External exposure to penetrating radiation from ground surfaces

Equations and Default Parameter Values for Identified Exposure Routes

In general, SNL/NM expects that ingestion of compounds in drinking water and soil will be the more significant exposure routes for chemicals; external exposure to radiation may also be significant for radionuclides. All of the above routes will, however, be considered for their appropriate land-use scenarios. The general equation for calculating potential intakes via these routes is shown below. The equations are taken from "Assessing Human Health Risks Posed by Chemicals: Screening-Level Risk Assessment" (NMED March 2000) and "Technical Background Document for Development of Soil Screening Levels" (NMED December 2000). Equations from both documents are based upon the "Risk Assessment Guidance for Superfund" (RAGS): Volume 1 (EPA 1989, 1991). These general equations also apply to calculating potential intakes for radionuclides. A more in-depth discussion of the equations used in performing radiological pathway analyses with the RESRAD code may be found in the RESRAD Manual (ANL 1993). RESRAD is the only code designated by the U.S. Department of Energy (DOE) in DOE Order 5400.5 for the evaluation of radioactively contaminated sites (DOE 1993). The Nuclear Regulatory Commission (NRC) has approved the use of RESRAD for dose evaluation by licensees involved in decommissioning, NRC staff evaluation of waste disposal requests, and dose evaluation of sites being reviewed by NRC staff. EPA Science Advisory Board reviewed the RESRAD model. EPA used RESRAD in their rulemaking on radiation site cleanup regulations. RESRAD code has been verified, undergone several benchmarking analyses, and been included in the International Atomic Energy Agency's VAMP and BIOMOV5 II projects to compare environmental transport models.

Also shown are the default values SNL/NM ER will use in RME risk assessment calculations for industrial, recreational, and residential land-use scenarios, based upon EPA and other governmental agency guidance. The pathways and values for chemical contaminants are discussed first, followed by those for radionuclide contaminants. RESRAD input parameters that are left as the default values provided with the code are not discussed. Further information relating to these parameters may be found in the RESRAD Manual (ANL 1993) or by directly accessing the RESRAD websites at: <http://web.ead.anl.gov/resrad/home2/> or <http://web.ead.anl.gov/resrad/documents/>.

Generic Equation for Calculation of Risk Parameter Values

The equation used to calculate the risk parameter values (i.e., hazard quotients/HI, excess cancer risk, or radiation total effective dose equivalent [TEDE] [dose]) is similar for all exposure pathways and is given by:

$$\begin{aligned} \text{Risk (or Dose)} &= \text{Intake} \times \text{Toxicity Effect (either carcinogenic, noncarcinogenic, or radiological)} \\ &= C \times (\text{CR} \times \text{EFD}/\text{BW}/\text{AT}) \times \text{Toxicity Effect} \end{aligned} \quad (1)$$

where;

C	= contaminant concentration (site specific)
CR	= contact rate for the exposure pathway
EFD	= exposure frequency and duration
BW	= body weight of average exposure individual
AT	= time over which exposure is averaged.

For nonradiological constituents of concern (COCs), the total risk/dose (either cancer risk or HI) is the sum of the risks/doses for all of the site-specific exposure pathways and contaminants. For radionuclides, the calculated radiation exposure, expressed as TEDE is compared directly to the exposure guidelines of 15 millirem per year (mrem/year) for industrial and recreational future use and 75 mrem/year for the unlikely event that institutional control of the site is lost and the site is used for residential purposes (EPA 1997).

The evaluation of the carcinogenic health hazard produces a quantitative estimate for excess cancer risk resulting from the COCs present at the site. This estimate is evaluated for determination of further action by comparison of the quantitative estimate with the potentially acceptable risk of 1E-5 for nonradiological carcinogens. The evaluation of the noncarcinogenic health hazard produces a quantitative estimate (i.e., the HI) for the toxicity resulting from the COCs present at the site. This estimate is evaluated for determination of further action by comparison of this quantitative estimate with the EPA standard HI of unity (1). The evaluation of the health hazard from radioactive compounds produces a quantitative estimate of doses resulting from the COCs present at the site. This estimated dose is used to calculate an assumed risk. However, this calculated risk is presented for illustration purposes only, not to determine compliance with regulations.

The specific equations used for the individual exposure pathways can be found in RAGS (EPA 1989) and are outlined below. The RESRAD Manual (ANL 1993) describes similar equations for the calculation of radiological exposures.

Soil Ingestion

A receptor can ingest soil or dust directly by working in the contaminated soil. Indirect ingestion can occur from sources such as unwashed hands introducing contaminated soil to food that is then eaten. An estimate of intake from ingesting soil will be calculated as follows:

$$I_s = \frac{C_s * IR * CF * EF * ED}{BW * AT}$$

where:

- I_s = Intake of contaminant from soil ingestion (milligrams [mg]/kilogram [kg]-day)
- C_s = Chemical concentration in soil (mg/kg)
- IR = Ingestion rate (mg soil/day)
- CF = Conversion factor (1E-6 kg/mg)
- EF = Exposure frequency (days/year)
- ED = Exposure duration (years)
- BW = Body weight (kg)
- AT = Averaging time (period over which exposure is averaged) (days)

It should be noted that it is conservatively assumed that the receptor only ingests soil from the contaminated source.

Soil Inhalation

A receptor can inhale soil or dust directly by working in the contaminated soil. An estimate of intake from inhaling soil will be calculated as follows (EPA August 1997):

$$I_s = \frac{C_s * IR * EF * ED * \left(\frac{1}{VF} \text{ or } \frac{1}{PEF} \right)}{BW * AT}$$

where:

- I_s = Intake of contaminant from soil inhalation (mg/kg-day)
- C_s = Chemical concentration in soil (mg/kg)
- IR = Inhalation rate (cubic meters [m³]/day)
- EF = Exposure frequency (days/year)
- ED = Exposure duration (years)
- VF = soil-to-air volatilization factor (m³/kg)
- PEF = particulate emission factor (m³/kg)
- BW = Body weight (kg)
- AT = Averaging time (period over which exposure is averaged) (days)

Soil Dermal Contact

$$D_a = \frac{C_s * CF * SA * AF * ABS * EF * ED}{BW * AT}$$

where:

- D_a = Absorbed dose (mg/kg-day)
- C_s = Chemical concentration in soil (mg/kg)
- CF = Conversion factor (1E-6 kg/mg)
- SA = Skin surface area available for contact (cm²/event)
- AF = Soil to skin adherence factor (mg/cm²)
- ABS = Absorption factor (unitless)
- EF = Exposure frequency (events/year)

- ED = Exposure duration (years)
- BW = Body weight (kg)
- AT = Averaging time (period over which exposure is averaged) (days)

Groundwater Ingestion

A receptor can ingest water by drinking it or through using household water for cooking. An estimate of intake from ingesting water will be calculated as follows (EPA August 1997):

$$I_w = \frac{C_w * IR * EF * ED}{BW * AT}$$

where:

- I_w = Intake of contaminant from water ingestion (mg/kg/day)
- C_w = Chemical concentration in water (mg/liter [L])
- IR = Ingestion rate (L/day)
- EF = Exposure frequency (days/year)
- ED = Exposure duration (years)
- BW = Body weight (kg)
- AT = Averaging time (period over which exposure is averaged) (days)

Groundwater Inhalation

The amount of a constituent taken into the body via exposure to volatilization from showering or other household water uses will be evaluated using the concentration of the constituent in the water source (EPA 1991 and 1992). An estimate of intake from volatile inhalation from groundwater will be calculated as follows (EPA 1991):

$$I_w = \frac{C_w * K * IR_i * EF * ED}{BW * AT}$$

where:

- I_w = Intake of volatile in water from inhalation (mg/kg/day)
- C_w = Chemical concentration in water (mg/L)
- K = volatilization factor (0.5 L/m³)
- IR_i = Inhalation rate (m³/day)
- EF = Exposure frequency (days/year)
- ED = Exposure duration (years)
- BW = Body weight (kg)
- AT = Averaging time (period over which exposure is averaged—days)

For volatile compounds, volatilization from groundwater can be an important exposure pathway from showering and other household uses of groundwater. This exposure pathway will only be evaluated for organic chemicals with a Henry's Law constant greater than 1×10^{-5} and with a molecular weight of 200 grams/mole or less (EPA 1991).

Tables 2 and 3 show the default parameter values suggested for use by SNL/NM at SWMUs, based upon the selected land-use scenarios for nonradiological and radiological COCs,

respectively. References are given at the end of the table indicating the source for the chosen parameter values. SNL/NM uses default values that are consistent with both regulatory guidance and the RME approach. Therefore, the values chosen will, in general, provide a conservative estimate of the actual risk parameter. These parameter values are suggested for use for the various exposure pathways, based upon the assumption that a particular site has no unusual characteristics that contradict the default assumptions. For sites for which the assumptions are not valid, the parameter values will be modified and documented.

Summary

SNL/NM will use the described default exposure routes and parameter values in risk assessments at sites that have an industrial, recreational, or residential future land-use scenario. There are no current residential land-use designations at SNL/NM ER sites, but NMED has requested this scenario to be considered to provide perspective of the risk under the more restrictive land-use scenario. For sites designated as industrial or recreational land use, SNL/NM will provide risk parameter values based upon a residential land-use scenario to indicate the effects of data uncertainty on risk value calculations or in order to potentially mitigate the need for institutional controls or restrictions on SNL/NM ER sites. The parameter values are based upon EPA guidance and supplemented by information from other government sources. If these exposure routes and parameters are acceptable, SNL/NM will use them in risk assessments for all sites where the assumptions are consistent with site-specific conditions. All deviations will be documented.

Table 2
Default Nonradiological Exposure Parameter Values for Various Land-Use Scenarios

Parameter	Industrial	Recreational	Residential
General Exposure Parameters			
Exposure Frequency (day/yr)	250 ^{a,b}	8.7 (4 hr/wk for 52 wk/yr) ^{a,b}	350 ^{a,b}
Exposure Duration (yr)	25 ^{a,b,c}	30 ^{a,b,c}	30 ^{a,b,c}
Body Weight (kg)	70 ^{a,b,c}	70 Adult ^{a,b,c} 15 Child ^{a,b,c}	70 Adult ^{a,b,c} 15 Child ^{a,b,c}
Averaging Time (days) for Carcinogenic Compounds (= 70 yr x 365 day/yr)	25,550 ^{a,b}	25,550 ^{a,b}	25,550 ^{a,b}
for Noncarcinogenic Compounds (= ED x 365 day/yr)	9,125 ^{a,b}	10,950 ^{a,b}	10,950 ^{a,b}
Soil Ingestion Pathway			
Ingestion Rate (mg/day)	100 ^{a,b}	200 Child ^{a,b} 100 Adult ^{a,b}	200 Child ^{a,b} 100 Adult ^{a,b}
Inhalation Pathway			
Inhalation Rate (m ³ /day)	20 ^{a,b}	15 Child ^a 30 Adult ^a	10 Child ^a 20 Adult ^a
Volatilization Factor (m ³ /kg)	Chemical Specific	Chemical Specific	Chemical Specific
Particulate Emission Factor (m ³ /kg)	1.36E9 ^a	1.36E9 ^a	1.36E9 ^a
Water Ingestion Pathway			
Ingestion Rate (liter/day)	2.4 ^a	2.4 ^a	2.4 ^a
Dermal Pathway			
Skin Adherence Factor (mg/cm ²)	0.2 ^a	0.2 Child ^a 0.07 Adult ^a	0.2 Child ^a 0.07 Adult ^a
Exposed Surface Area for Soil/Dust (cm ² /day)	3,300 ^a	2,800 Child ^a 5,700 Adult ^a	2,800 Child ^a 5,700 Adult ^a
Skin Adsorption Factor	Chemical Specific	Chemical Specific	Chemical Specific

^aTechnical Background Document for Development of Soil Screening Levels (NMED December 2000).

^bRisk Assessment Guidance for Superfund, Vol. 1, Part B (EPA 1991).

^cExposure Factors Handbook (EPA August 1997).

ED = Exposure duration.

EPA = U.S. Environmental Protection Agency.

hr = Hour(s).

kg = Kilogram(s).

m = Meter(s).

mg = Milligram(s).

NA = Not available.

wk = Week(s).

yr = Year(s).

Table 3
Default Radiological Exposure Parameter Values for Various Land-Use Scenarios

Parameter	Industrial	Recreational	Residential
General Exposure Parameters			
Exposure Frequency	8 hr/day for 250 day/yr	4 hr/wk for 52 wk/yr	365 day/yr
Exposure Duration (yr)	25 ^{a,b}	30 ^{a,b}	30 ^{a,b}
Body Weight (kg)	70 Adult ^{a,b}	70 Adult ^{a,b}	70 Adult ^{a,b}
Soil Ingestion Pathway			
Ingestion Rate	100 mg/day ^c	100 mg/day ^c	100 mg/day ^c
Averaging Time (days) (= 30 yr x 365 day/yr)	10,950 ^d	10,950 ^d	10,950 ^d
Inhalation Pathway			
Inhalation Rate (m ³ /yr)	7,300 ^{d,e}	10,950 ^e	7,300 ^{d,e}
Mass Loading for Inhalation g/m ³	1.36 E-5 ^d	1.36 E-5 ^d	1.36 E-5 ^d
Food Ingestion Pathway			
Ingestion Rate, Leafy Vegetables (kg/yr)	NA	NA	16.5 ^c
Ingestion Rate, Fruits, Non-Leafy Vegetables & Grain (kg/yr)	NA	NA	101.8 ^b
Fraction Ingested	NA	NA	0.25 ^{b,d}

^aRisk Assessment Guidance for Superfund, Vol. 1, Part B (EPA 1991).

^bExposure Factors Handbook (EPA August 1997).

^cEPA Region VI guidance (EPA 1996).

^dFor radionuclides, RESRAD (ANL 1993).

^eSNL/NM (February 1998).

EPA = U.S. Environmental Protection Agency.

g = Gram(s)

hr = Hour(s).

kg = Kilogram(s).

m = Meter(s).

mg = Milligram(s).

NA = Not applicable.

wk = Week(s).

yr = Year(s).

References

ANL, see Argonne National Laboratory.

Argonne National Laboratory (ANL), 1993. *Manual for Implementing Residual Radioactive Material Guidelines Using RESRAD*, Version 5.0, ANL/EAD/LD-2, Argonne National Laboratory, Argonne, IL.

DOE, see U.S. Department of Energy.

DOE and USAF, see U.S. Department of Energy and U.S. Air Force.

EPA, see U.S. Environmental Protection Agency.

New Mexico Environment Department (NMED), March 2000. "Assessing Human Health Risks Posed by Chemical: Screening-level Risk Assessment," Hazardous and Radioactive Materials Bureau, NMED, March 6, 2000.

New Mexico Environment Department (NMED), December 2000. "Technical Background Document for Development of Soil Screening Levels," Hazardous Waste Bureau and Ground Water Quality Bureau Voluntary Remediation Program, December 18, 2000.

Sandia National Laboratories/New Mexico (SNL/NM), February 1998. "RESRAD Input Parameter Assumptions and Justification," Sandia National Laboratories/New Mexico Environmental Restoration Project, Albuquerque, New Mexico.

U.S. Department of Energy (DOE), 1993. DOE Order 5400.5, "Radiation Protection of the Public and the Environment," U.S. Department of Energy, Washington, D.C.

U.S. Department of Energy (DOE), 1996. "Environmental Assessment of the Environmental Restoration Project at Sandia National Laboratories/New Mexico," U.S. Department of Energy, Kirtland Area Office.

U.S. Department of Energy, U.S. Air Force, and U.S. Forest Service, September 1995. "Workbook: Future Use Management Area 2," prepared by the Future Use Logistics and Support Working Group in cooperation with U.S. Department of Energy Affiliates, the U.S. Air Force, and the U.S. Forest Service.

U.S. Department of Energy, U.S. Air Force, and U.S. Forest Service, October 1995. "Workbook: Future Use Management Area 1," prepared by the Future Use Logistics and Support Working Group in cooperation with U.S. Department of Energy Affiliates, the U.S. Air Force, and the U.S. Forest Service.

U.S. Department of Energy and U.S. Air Force (DOE and USAF), January 1996. "Workbook: Future Use Management Areas 3,4,5, and 6," prepared by the Future Use Logistics and Support Working Group in cooperation with U.S. Department of Energy Affiliates, and the U.S. Air Force.

U.S. Department of Energy and U.S. Air Force (DOE and USAF), March 1996. "Workbook: Future Use Management Area 7," prepared by the Future Use Logistics and Support Working Group in cooperation with U.S. Department of Energy Affiliates and the U.S. Air Force.

U.S. Environmental Protection Agency (EPA), 1989. "Risk Assessment Guidance for Superfund, Volume I: Human Health Evaluation Manual," EPA/540-1089/002, U.S. Environmental Protection Agency, Office of Emergency and Remedial Response, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1991. "Risk Assessment Guidance for Superfund, Volume I: Human Health Evaluation Manual (Part B)," EPA/540/R-92/003, U.S. Environmental Protection Agency, Office of Emergency and Remedial Response, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1992. "Dermal Exposure Assessment: Principles and Applications," EPA/600/8-91/011B, Office of Research and Development, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1996. "Soil Screening Guidance: Technical Background Document," EPA/540/1295/128, Office of Solid Waste and Emergency Response, Washington, D.C.

U.S. Environmental Protection Agency (EPA), August 1997. *Exposure Factors Handbook*, EPA/600/8-89/043, U.S. Environmental Protection Agency, Office of Health and Environmental Assessment, Washington, D.C.

U.S. Environmental Protection Agency (EPA), 1997. (OSWER No. 9200.4-18) *Establishment of Cleanup Levels for CERCLA Sites with Radioactive Contamination*, U.S. EPA Office of Radiation and Indoor Air, Washington D.C, August 1997.



355005

JUSTIFICATION FOR CLASS III
PERMIT MODIFICATION SEPTEMBER
2005 SWMU 148 OPERABLE UNIT 1295
BUILDING 9927 SEPTIC SYSTEM
COYOTE TEST FIELD

AUG 29 2005